

SAFETY RECALL MESSAGE

9 July 2025

Trane Recalls Gas/Electric Packaged Units Due to Risk of Gas Leak, Fire Hazard (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-369

Name of Product: Trane and American Standard Gas/Electric Packaged Units

Hazard: The fuel gas valve can open unexpectedly, allowing a gas leak and posing a fire hazard.

Consumer Contact: Both Trane and American Standard toll-free at 800-889-0129 Monday through Friday 8 a.m. to 6 p.m. ET, or online at <https://www.trane.com/residential/gas-electric-packaged-unit-recall/> or www.trane.com/residential and click on “Product Recall” at the bottom of the page for more information, or at <https://www.americanstandardair.com/gas-electric-packaged-unit-recall/> and click on “Product Recall” at the bottom of the page for more information.

Description: This recall involves five different models of Gas/Electric Packaged Units sold under Trane and American Standard brand names. The model and serial number ranges can be found on the outside of the back of the unit. Trane or American Standard is printed on the front of the units. Visit <https://www.cpsc.gov/Recalls/2025/Trane-Recalls-Gas-Electric-Packaged-Units-Due-to-Risk-of-Gas-Leak-Fire-Hazard> for the complete list of Serial Numbers and Models.

Remedy: Consumers should immediately stop using the heating mode of the recalled units and contact their dealer who installed the unit to schedule an appointment for a free inspection and repair, by replacing the ignition board of the unit. Consumers with Trane products can locate their nearest dealer at www.trane.com/residential/en/dealer-locator/. Consumers with American Standard products can locate their nearest dealer at www.americanstandardair.com/find-your-dealer/. Consumers can also contact Trane or American Standard directly for support.

Incidents/Injuries: The firm has received one report of gas leaking from the recalled two-stage gas furnace/air conditioners. No injuries have been reported.

Sold At: HVAC distributors and dealers nationwide from **January 2024 through March 2025 for between \$8,250 and \$12,900.**



Model Number
Serial Number



SAFETY RECALL MESSAGE

9 July 2025

Jeriflyer Pool Drain Covers Recalled Due to Risk of Serious Injury or Death from Entrapment Hazard (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-368

Name of Product: Jeriflyer 8-inch pool drain covers

Hazard: The recalled drain covers do not conform to the entrapment protection standards of the Virginia Graeme Baker Pool and Spa Safety Act (VGBA), posing an entrapment hazard to swimmers and bathers.


Consumer Contact: Jeriflyer by email at Junjuanshop2025@outlook.com, or online at [Amazon.com: Jeriflyer: Recall](https://www.amazon.com/Jeriflyer-Recall) or [Amazon.com: Jeriflyer](https://www.amazon.com/Jeriflyer) and click "Recall" at the top of the page for more information.

Description: This recall involves Jeriflyer 8-inch pool drain covers that are sold for use in swimming pools. The drain covers are white and made of plastic. The drain measures 8.1 inches in diameter.

Remedy: Pool owners/operators and consumers should immediately stop using pools with the recalled pool drain covers. To receive a refund, consumers should remove the drain cover from the pool, take a photo of the removed cover, and send it to the recalling firm by email at Junjuanshop2025@outlook.com. Ensure all pools and spas have VGBA compliant drain covers and teach children to stay away from drains. Junjuanshop and Amazon are contacting all known purchasers directly.

Incidents/Injuries: None reported

Sold At: Amazon from **April 2024 through May 2025** for between \$10 and \$15.

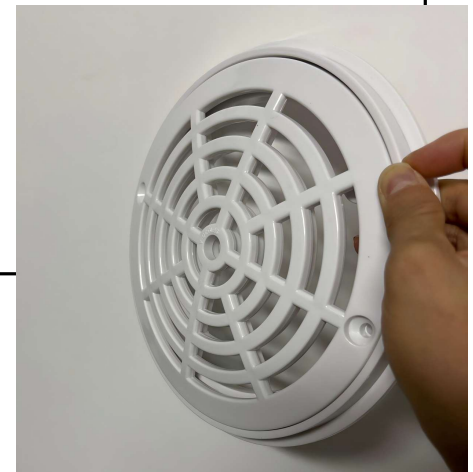

SAFETY RECALL MESSAGE

9 July 2025

DEWALT Recalls Grinder Flap Discs Due to Laceration and Injury Hazards (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-367

Name of Product: DEWALT® Grinder Flap Discs

Hazard: The ceramic cloth abrasive flaps on the disc can detach while in use on a grinder, posing laceration and injury hazards.


Consumer Contact: DEWALT online at <https://www.dewalt.com/support/safety-notices-and-recalls/flap-disc-recall>, toll-free at 800-990-6421 from 8 a.m. to 6 p.m. ET Monday through Friday, email at recall@sbdinc.com, or online at <https://www.dewalt.com/support/safety-notices-and-recalls> or www.dewalt.com and click on “Safety Notices and Recalls” for more information.

Description: This recall involves DEWALT Elite Grinder Series 4.5-inch 40G T27 High Density Flap Discs, models DWA8280HRT and DWA8280RT, that are compatible with angle grinders for heavy duty use. Only units with date codes 2024-36 to 2024-48 are part of the recall. The model number is on the front cover of the flap disc located at the top above the name “DEWALT.” The date code for recalled discs is printed on the shipping boxes in year - week format and is also stamped on the individual discs. If you are unable to determine the date code, contact DEWALT for assistance.

Remedy: Consumers should immediately stop using the recalled flap discs and go to the DEWALT website at <https://www.dewalt.com/support/safety-notices-and-recalls/flap-disc-recall> to participate in the recall. Consumers will be asked to write “Recall” on the disc and upload a photograph to the firm’s website. Consumers will then be asked to certify that they disposed of it in the trash to receive a refund.

Incidents/Injuries: The firm has received three reports of the flap disc coming apart while in use on the grinder, including three injuries resulting in cuts and scrapes.

Sold At: Industrial supply stores nationwide, including Grainger, Fastenal and Airgas, and online on Amazon.com from **September 2024 through May 2025 for between \$7 and \$10.**

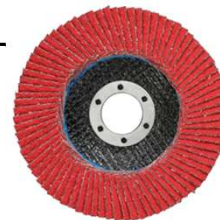

SAFETY RECALL MESSAGE

9 July 2025

Harbor Freight Tools Recalls Predator 2000-Watt Power Stations Due to Shock Hazard (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-366

Name of Product: Predator 2000W Power Stations

Hazard: The wires in the power station's AC outlet receptacles are reversed when the product is in Emergency Power Supply ("EPS") mode, posing a shock hazard to consumers operating the power station.

Consumer Contact: Harbor Freight Tools toll-free at 800-444-3353 from 8 a.m. to 4:30 p.m. PT Monday through Friday, email recall@harborfreight.com, or online at <https://www.harborfreight.com/customer-service-product-support.html#5> or at www.harborfreight.com and click on "Recall & Safety" at the bottom of the page for more information.

Description: This recall involves the Predator 2000-Watt Power Station (SKU #70084, UPC 193175488718). The Power Stations are red and black and have "PREDATOR" in large white letters on the top of the front panel. "2000 Power Station" is in large white letters on the bottom of the front panel of the unit. The power stations are portable generators that run on a 1545-Watt lithium-ion phosphate battery that can be charged via A/C, solar power, or car. The power station can power up to 11 devices at once and has four A/C outlets, three USB-C outlets, three USB-A outlets and one 12V DC outlet. The SKU and UPC are located on labels affixed to the product.

Remedy: Consumers should immediately stop using the recalled power stations and return them to their local Harbor Freight Tools store for a free replacement unit that will be available at the store. Harbor Freight Tools is contacting all known purchasers directly.

Incidents/Injuries: The firm has received one report of the wires being reversed in EPS mode. No injuries have been reported.

Sold At: Harbor Freight Tools stores nationwide from February 2025 through April 2025 for about \$950.



SAFETY RECALL MESSAGE

9 July 2025

SNLN Party Supply Toys Recalled Due to Ingestion Hazard; Risk of Serious Injury or Death (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-372

Name of Product: SNLN Party Supply Toys

Hazard: The recalled party supply toys violate the mandatory standard for toys containing button cell batteries because the compartment that holds the batteries can be easily accessed and opened by children, posing a deadly ingestion hazard to children. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.

Consumer Contact: Yiwu Dixikeji Douxiangongsi via email at dixikeji@gmail.com.

Description: This recall involves SNLN Party Supply Toys, which include three bunny ears, three cat ears, twelve party glasses, 100-piece glow bracelets, eight light-up mini flashlights, four light-up rings, six butterfly clips and a sticker book. The products come in red, blue, green, yellow, white and pink.

Remedy: Consumers should immediately stop using the recalled party supply toys and take them away from children. Contact Yiwu Dixikeji Douxiangongsi for a full refund. To receive a refund, consumers should send a photo of the recalled toys being disposed of in the trash by email at dixikeji@gmail.com. Yiwu Dixikeji Douxiangongsi and Amazon are contacting all known purchasers directly.

Incidents/Injuries: None reported

Sold At: Amazon from **January 2025 through May 2025** for about \$22.



SAFETY RECALL MESSAGE

9 July 2025

Positec Recalls Electric Corded Chainsaws and Pole Saws Due to Laceration Hazard (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-371

Name of Product: Hyper Tough, Worx and Portland Chainsaws and Pole Saws

Hazard: The main switch on the recalled chainsaws and pole saws can fail, allowing the saws to continue to run even after the switch is released, posing a laceration hazard.

Consumer Contact: Positec toll-free at 888-997-8871 from 9 a.m. to 6 p.m. ET Monday through Friday, email at chainsawrecall@positecgroup.com or online at <https://www.worx.com/chainsaw-recall> or <https://www.worx.com> and click on “Chainsaw Recall” at the bottom of the page for more information.

Description: This recall involves Hyper Tough 9 Amp Electric Corded 14” Chainsaws, Worx 8 Amp 14” Electric Chainsaws, Worx 8 Amp Electric Pole Saws, and Portland 9 Amp 14” Chainsaws. The Hyper Tough 9 Amp Electric Corded 14” Chainsaw is a black saw with red trim, marked Hyper Tough on the saw body and on the bar. The Worx 8 Amp 14” Electric Chainsaw is an orange and black saw marked WORX on the saw body and on the bar. The Worx 8 Amp Electric Pole Saw is an orange and black saw marked WORX on the saw body and on the bar and is shipped with an 8-foot pole extension. The Portland 9 Amp 14” Chainsaw is a green saw with a black bar, marked Portland on the bar. Visit <https://www.cpsc.gov/Recalls/2025/Positec-Recalls-Electric-Corded-Chainsaws-and-Pole-Saws-Due-to-Laceration-Hazard> for a complete list of models and serial numbers involved in the recall.

Remedy: Consumers should immediately stop using the recalled products and contact Positec for a pre-paid shipping label, and a new box as needed, to return the units free of charge. Positec will provide a free replacement chainsaw or pole saw upon receipt of the recalled product.

Incidents/Injuries: None reported

Sold At: Walmart (Hyper Tough brand only) and Harbor Freight (Portland brand only) stores nationwide and online at [Worx.com](https://www.worx.com), [Amazon.com](https://www.amazon.com) and [HarborFreight.com](https://www.harborfreight.com) from **September 2024 through March 2025 for between \$50 and \$120.**



SAFETY RECALL MESSAGE

9 July 2025

509 Recalls Helmets Due to Risk of Head Injury (Recall Alert)

Company Recall Date: 3 July 2025

Recall Number: 25-374

Name of Product: 509 helmets and 509 for Polaris helmets

Hazard: The recalled helmets fail to provide sufficient protection in the event of a crash, posing a risk of head injury.

Consumer Contact: 509 toll-free at 877-743-3509 from 7 a.m. to 7 p.m. CT Monday through Friday, email at support@ride509.com, or online at <https://ride509.com/pages/recalls> or www.ride509.com and click on “Safety Recalls” under the “Support” column at the bottom of the page for more information. Polaris Industries toll-free at 800-765-2747 from 7 a.m. to 7 p.m. CT Monday through Friday, or online at www.polaris.com and click on “Product Safety News” located under the “Safety” column at the bottom of the page. Consumers can contact Polaris’ owner connections team at Owner.Connections@polaris.com or via an online forum accessible at <https://www.polaris.com/en-us/off-road/owner-resources/help-center/email>.

Description: This recall involves 509 Tactical 3.0 (Youth, Mountain, and Trail) helmets and 509 for Polaris Tactical 3.0 (Youth and Mountain) helmets. This recall also involves small and medium size 509 Tactical 2.0 helmets, 509 Tactical 2.0 helmets with Fidlock®, and 509 for Polaris Tactical 2.0 helmets, which were all manufactured in 2023. This recall also involves 509 and 509 for Polaris helmets with Fidlock®, including Tactical 2.0, Altitude 2.0, Delta R3L, Delta R4, Delta V, Mach III, Mach IV and Mach V (manufactured from 2020 to present with a stainless-steel glide bar). The 509 logo and “FIVE O NINE” are printed on the 509 helmets. The 509 logo and “Polaris” are printed on the 509 for Polaris helmets.

Remedy: Consumers should immediately stop using the recalled helmets. Consumers with a recalled “509” branded Tactical 3.0 or Tactical 2.0 (small/medium manufactured in 2023) helmet should contact 509 for instructions on how to participate in the recall and to receive a choice of a refund (if purchased online), or a credit to be used on 509’s website or a replacement helmet. Consumers with a recalled “509 for Polaris” branded Tactical 3.0 or Tactical 2.0 (small/medium manufactured in 2023) helmet should contact Polaris for a choice of a refund, a credit to use at a Polaris dealership or on the Polaris website, or a replacement helmet. Proof of purchase is not required. All helmets should be discarded in the local household trash after consumers have confirmed their helmet is being recalled by 509 or Polaris and follow the destruction instructions located on the website. Polaris is also providing their customers who have the recalled 509 and 509 for Polaris helmets with Fidlock®, with instructions on how to inspect the webbing on the chin strap to make sure it is repaired, by routing it correctly. 509 and Polaris are contacting all known purchasers directly.

Incidents/Injuries: The firm received one incident where the rider’s helmet became detached during a crash, resulting in a concussion.

Sold At: Online at www.ride509.com and www.polaris.com and at 509 and Polaris dealers nationwide from **January 2020 through May 2025 for between \$140 and \$900.**

