

FINAL

**CORRECTIVE ACTION PLAN - PART A REPORT
FOR
FACILITY ID #9-089088
UNDERGROUND STORAGE TANK 29
AT
BUILDING 1636/1643
FORT STEWART, GEORGIA**

Prepared for:

**U.S. Army Corps of Engineers - Savannah District
and
Fort Stewart Directorate of Public Works
Under Contract Number DACA21-95-D-0022
Delivery Order 0003**

Prepared by:

**Science Applications International Corporation
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831**

May 1997

1

2

3

4

5

6
7
8
9
10

11

TABLE OF CONTENTS

	<u>Page</u>
I. CORRECTIVE ACTION PLAN - PART A FORM & CERTIFICATION	I-1
II. INITIAL RESPONSE REPORT	II-1
A. Initial Abatement.....	II-1
B. Free Product Removal	II-1
C. Tank History	II-1
D. Initial Site Characterization	II-1
D.1 Regulated Substance Released	II-3
D.2 Source of Contamination	II-4
D.3 Impacted Environmental Media	II-4
D.3.a Soils	II-4
D.3.b Groundwater	II-5
D.3.c Surface Water Impacted	II-5
D.3.d Drinking Water Supply Impacted	II-5
D.4 Local Water Resources	II-6
D.4.a Drinking Water Supplies	II-6
D.4.b Surface Water Bodies	II-6
D.5 Other Hydrogeologic Data	II-7
D.5.a Depth to Groundwater	II-8
D.5.b Groundwater Flow Direction	II-8
D.5.c Hydraulic Gradient	II-9
D.5.d Total Organic Carbon (Optional)	II-9
D.5.e Grain-Size Distribution	II-9
D.5.f Total Petroleum Hydrocarbons (Optional)	II-9
D.6 Corrective Action Completed or In-Progress	II-9
D.6.a USTs Removed.....	II-9
D.6.b Excavation and Treatment/Disposal of Backfill and Native Soils	II-9
D.7 Conclusions and Recommendations	II-10
D.8 Site Ranking	II-11
III. SITE INVESTIGATION PLAN	III-1
A. Horizontal and Vertical Extent of Contamination.....	III-1
A.1 Soils	III-1
A.2 Groundwater	III-1
A.3 Surface Water	III-1
B. Vadose Zone and Aquifer Characteristics	III-2
B.1 Vertical Soil Permeability (Optional)	III-2
B.2 Infiltration Rate (Optional)	III-2

B.3	Saturated Horizontal Hydraulic Conductivity	III-2
B.4	Total Organic Carbon (Optional)	III-2
B.5	Dissolved Iron (Optional)	III-2
B.6	Effective Porosity	III-2
B.7	Seepage Velocity	III-3
B.8	Grain-size Distribution (Optional)	III-3
B.9	Total Petroleum Hydrocarbons (TPH) (Optional)	III-3
B.10	Pilot Test(s) (Optional)	III-3
IV.	PUBLIC NOTICE	IV-1
V.	CLAIM FOR REIMBURSEMENT: GUST TRUST FUND.....	V-1
VI.	REFERENCES	VI-1

APPENDICES

Report Tables (as listed below)

Report Figures (as listed below)

Appendix A Soil Boring Logs for the Facility ID #9-089088 Site Investigation

Appendix B Technical Approach for the Facility ID #9-089088 Site Investigation

Appendix C Analytical Data Sheets and Quality Control Summary Report
for the Facility ID #9-089088 Site Investigation

Appendix D Documentation of Water Supply Survey for the Fort Stewart
Garrison Area

Appendix E Site Ranking Form for the Facility ID #9-089088 Site

Appendix F Public Notification Newspaper Announcement for the Facility
ID #9-089088 Site CAP-Part A Activities

LIST OF TABLES

II-1 Analytical Results for Soil Samples Collected by Anderson Columbia
During Removal of UST 29

II-2 Soil and Groundwater Samples Collected by SAIC During the
Facility ID #9-089088 Site Investigation

II-3 Soil Analytical Results for the Facility ID #9-089088 Site Investigation

- II-4 Groundwater Analytical Results for the Facility ID #9-089088 Site Investigation
- II-5 Groundwater Depth Measurements and Calculated Groundwater Elevations for the Facility ID #9-089088 Site Investigation

LIST OF FIGURES

- II-1 Facility ID #9-089088, UST 29, Site Map
- II-2 Site Map of Sampling Locations for the UST 29 Removal
- II-3 Site Map of Soil Sampling Locations and Analytical Results for the Facility ID #9-089088 Site Investigation
- II-4 Site Map of Groundwater Sampling Locations and Analytical Results for the Facility ID #9-089088 Site Investigation
- II-5 Vicinity Map Illustrating the Locations of Groundwater Supply Wells and Surface Water Bodies Within the Fort Stewart Garrison Area
- III-1 Proposed Sampling Locations for Facility ID #9-089088 Site Investigation

LIST OF ACRONYMS

Anderson Columbia	Anderson Columbia Environmental, Inc.
ATL	Alternate Threshold Level
BTEX	benzene, toluene, ethylbenzene, xylenes
CAP	Corrective Action Plan
DPW	Directorate of Public Works
FSMR	Fort Stewart Military Reservation
GDNR	Georgia Department of Natural Resources
GUST	Georgia Underground Storage Tank
MCL	Maximum Contaminant Level
mg/kg	milligrams per kilogram
µg/L	micrograms per liter
PAH	polynuclear aromatic hydrocarbon
PVC	polyvinyl chloride
QCSR	Quality Control Summary Report
SAIC	Science Applications International Corporation
TPH	total petroleum hydrocarbon
USACE	U.S. Army Corps of Engineers
UST	underground storage tank

I. CORRECTIVE ACTION PLAN - PART A FORM & CERTIFICATION

This document represents the Corrective Action Plan (CAP)-Part A Report for underground storage tank (UST) 29 that was located at Building 1636/1643 (Facility ID #9-089088), Fort Stewart, Georgia. This report has been prepared in accordance with requirements defined in the Georgia Underground Storage Tank (GUST) CAP-Part A guidance document GUST-7A *Underground Storage Tank Release: Corrective Action Plan - Part A Content*. The version of guidance document GUST-7A used for this report was issued by the Georgia Department of Natural Resources (GDNR), Environmental Protection Division, Underground Storage Tank Management Program, in November 1995.

Part I of this report contains the completed CAP-Part A form and certification. Supporting documentation related to information indicated on the CAP-Part A form is presented in Parts II through VI of the report, and in the attached appendices.

Georgia Department of Natural Resources

Environmental Protection Division

Underground Storage Tank Management Program

4244 International Parkway, Suite 104, Atlanta, Georgia 30354

Lonice C. Barrett, Commissioner

Harold Reheis, Director

(404)362-2687



CORRECTIVE ACTION PLAN PART A

Facility Name: Building 1636/1643 Area, UST 29 Site

Street Address: McFarland Avenue south of W. 15th Street

City: Fort Stewart County: Liberty Facility ID: 9-089088

Submitted by UST Owner/Operator:

Prepared by:

Name: John H. Spears

Name: Patricia Stoll

Company: U.S. Army/HQ3d Inf. Div. (Mech.)

Company: SAIC

Address: ATTN: AFZP-DEV (Spears)
Building 1139

Address: 800 Oak Ridge Turnpike

City: Fort Stewart State: Georgia

City: Oak Ridge State: Tennessee

Zip Code: 31314-5000

Zip Code: 37830

I. PLAN CERTIFICATION:

A. UST Owner/Operator

I hereby certify that the information contained in this plan and in all the attachments is true, accurate, and complete, and the plan satisfies all criteria and requirements of Rule 391-3-15-.09 of the Georgia Rules for Underground Storage Tank Management.

Name: John H. Spears

Signature: _____

Date: _____

B. Professional Engineer or Professional Geologist

I hereby certify that I have directed the field work and preparation of this plan, in accordance with State Rules and Regulations. As a registered geologist and/or engineer, I certify that I am a qualified groundwater professional, as defined by the Georgia State Board of Professional Geologists. All of the information and laboratory data in this plan and in all of the attachments are true, accurate, complete, and in accordance with applicable State Rules and Regulations.

Name: Patricia Stoll

Signature: Patricia Stoll

Date: 5/1/97



Please complete the following form, check all of the boxes below that apply, and attached supporting documentation (such as narrative, figures, tables, maps, boring/well logs, etc.) where specified and applicable. Supporting documentation should be three-hole punched and prepared in conformity with the attached guidance document "Underground Storage Tank (UST) Release: Corrective Action Plan - Part A (CAP-A) Content", GUST-7A.

II. INITIAL RESPONSE REPORT:

A. Initial Abatement:

- ☒ No Action Required
- ☐ Further Release or Migration of Contaminants Prevented
- ☐ Fire And Safety Hazards From Vapors And/Or Free Product Monitored and Mitigated
- ☐ Other (specify) _____

B. Free Product Removal:

- ☒ No Free Product Identified As Originating From Release
- ☐ Free Product (Non-Aqueous Phase Hydrocarbons) Removed by:
 - ☐ Manual Bailing
 - ☐ Passive Skimming
 - ☐ Automated Skimming
 - ☐ Automated Total Fluids Pumping, With Treatment System And Approved Wastewater Discharge
 - ☐ Other (specify) _____

C. Tank History

- ☒ Site Map Attached Identifying Former and/or Existing USTs
- ☐ Not Applicable

D. Initial Site Characterization:

☒ Site Map: include the following items on an attached site map

- Tank Pit Area • Piping Trenches • Dispensers
- Sewer Lines • Water Lines • North Arrow
(if present)
- Sample Locations (with sample numbers and depths)
- Tanks with ID#s, corresponding to Notification Form 7530-1
- Scale 1 in = 40 ft

1. Regulated Substance Released

- ☐ Gasoline ☐ Diesel ☐ Kerosene ☒ Waste oil
- ☐ Other _____

2. Source of Contamination

Number of USTs: in use 0 ; closed/removed 1

- ☐ Existing UST System(s): ☐ piping ☐ tank ☐ other
- ☒ Former UST System(s): ☒ piping ☐ tank ☒ other

3. Impacted Environmental Media

- ☒ Groundwater
- ☐ Free product
- ☒ Dissolved (BTEX and/or PAH) contamination exceeding:
- ☐ In-stream water quality standards
- ☒ Drinking water Maximum Contaminant Levels (MCLs)
- ☒ Soil Exceeding:
- ☐ Laboratory Detection Limits, but TPH is vertically delineated to Below Detection Limits (BDL) above the groundwater table or a groundwater sample from the worst-case location has BTEX and/or PAHs below applicable Drinking and/or In-stream water quality standards.
- ☒ Thresholds listed in Table A, Rule 391-3-15-.09
- ☐ Thresholds listed in Table B, Rule 391-3-15-.09
- ☐ Alternate Threshold Levels (ATLs) (Reference Appendix I)

D. Initial Site Characterization (continued):

- ☐ Drinking Water Supply Impacted
- ☐ Surface Water Impacted
- ☒ Attach Laboratory Analytical Data: the following items must be included.
 - Laboratory Method
 - Date of Sampling
 - Date of Analysis
 - Detection Limits
 - Signed Chain of Custody
 - Quality Control Data

4. Local Water Resources

- ☒ Drinking Water Supplies Located In:

High or average groundwater pollution susceptibility area:*

- ☒ Public water systems within 2.0 miles
- ☐ Non-public water systems within 0.5 mile

Low groundwater pollution susceptibility area:*

- ☐ Public water systems within 1.0 mile
- ☐ Non-public water systems within 0.25 mile

* As defined by the Groundwater Pollution Susceptibility Map of Georgia.

- ☒ Surface Water Bodies: Distance (nearest) 2190 feet
(regardless of hydraulic gradient)
- ☒ Attach Documentation of Water Supply Survey and Field Reconnaissance

5. Other Hydrogeologic Data (specify values)

- ☒ Depth To Groundwater (shallowest) 1.97 feet BGS
- ☒ Groundwater Flow Direction Northwest and Southeast
- ☒ Hydraulic Gradient 0.077 feet/feet (southeast) and
0.040 feet/feet (northwest)

6. Corrective Action Completed Or In-Progress

- ☒ USTs/Source Removed (after confirmed release)
- ☐ Excavation And Treatment/Disposal Of Contaminated Backfill Materials & Native Soils
 - ☐ Attach manifest of proper soil disposal
- ☐ Other (specify) _____

D. Initial Site Characterization (continued):

7. Conclusions And Recommendations

☐ No Further Action Required, including the preparation or implementation of a Site Investigation Plan

OR

☒ Prepare Corrective Action Plan - Part B, with a schedule for SIP implementation and submittal of CAP-Part B

8. Site Ranking

Environmental Sensitivity Score: 1860
(see Appendix II)

III. SITE INVESTIGATION PLAN:

A. Horizontal And Vertical Extent Of Contaminants In:

- ☒ Soil
- ☒ Groundwater
- ☐ Free product
- ☒ Dissolved phase
- ☐ Surface Water

B. Vadose Zone and Aquifer Characteristics:

- ☐ Vertical Soil Permeability (Optional)
- ☐ Infiltration Rate (Optional)
- ☒ Saturated Horizontal Hydraulic Conductivity
- ☒ Total Organic Carbon (Optional)
- ☒ Dissolved Iron (Optional)
- ☒ Effective Porosity
- ☒ Seepage Velocity
- ☒ Grain-size Distribution (Optional)
- ☒ Total Petroleum Hydrocarbons (Optional)
- ☐ Pilot Test(s) (Optional)
- ☐ Other (specify) _____

IV. PUBLIC NOTICE:

- ☐ Certified Letters to Adjacent and Potentially Affected Property Owners and Local Officials
- ☒ Legal Notice in Newspaper, as pre-approved by EPD
- ☐ Other EPD Approved Method (specify):

V. CLAIM FOR REIMBURSEMENT: (For GUST Trust Fund sites only)

- ☐ GUST Trust Fund Application (GUST-36), must be attached if applicable
- ☐ Cost Proposal
 - ☐ Non-Reimbursable Costs
 - OR
 - ☐ Reimbursable Costs
 - ☐ Invoices and Proofs-of-Payment, per GUST-91
 - ☐ Total Projected Costs to implement the Site Investigation Report (SIR) and prepare data for the Site Investigation Review Meeting, per GUST-91
- ☐ Payment Schedule for Reimbursement

II. INITIAL RESPONSE REPORT

A. Initial Abatement

No actions were required to abate imminent hazards and/or emergency conditions at the UST 29, Facility ID #9-089088, site because contaminant migration and release prevention, fire and vapor mitigation, or emergency free product removal were not required prior to or during the removal of this tank.

B. Free Product Removal

No free product was identified as originating from the release that occurred at the site. Therefore, free product removal at this site was not required.

C. Tank History

UST 29 was previously located within the Building 1636/1643 area in the northwest quadrant of the Fort Stewart garrison area. The location of the tanks within the Building 1636/1643 area is illustrated in Figure II-1. According to operational information maintained by the Fort Stewart Directorate of Public Works (DPW), UST 29 had a capacity of 1,000 gallons and was used for the storage of waste oil. The tank was constructed of fiberglass reinforced plastic and the associated piping was galvanized steel. The tank and piping were installed on or about January 1, 1982 and the system was last used in April 1995. The tank and piping were excavated and removed on October 25, 1995.

D. Initial Site Characterization

Characterization of petroleum-related contamination at the site was initiated during the tank removal activities on October 25, 1995. After removal of the tank and ancillary piping, two soil samples were collected from the tank pit excavation by Anderson Columbia Environmental, Inc. (Anderson Columbia), the contractor responsible for the tank removal. The location where each of these samples was collected is illustrated in Figure II-2. According to the field report prepared by Anderson Columbia for the site, the soil samples were collected two feet below both ends of the excavated tank (Anderson Columbia 1995). However, the depth below ground level from which each of the samples was collected was not identified in the field report.

Analytical results reported for these soil samples are presented in Table II-1. The soil results were compared to the applicable soil threshold levels for Facility ID #9-089088. The applicable threshold levels for the site are those listed in Table A (GDNR Rules for Underground Storage Tank Management, Chapter 391-3-15) for the Average or Higher Groundwater Pollution Susceptibility Area, Column 2, greater than 500 feet to a withdrawal point. Documentation supporting the use of this threshold level category

is presented in Section D.4 of this report. Based on this comparison, it was determined that benzene, toluene, ethylbenzene, and xylene were not presented at concentrations exceeding the applicable soil threshold level. However, total petroleum hydrocarbon (TPH) concentrations ranging between 76.5 milligrams per kilogram (mg/kg) and 394 mg/kg were also reported.

Based on these findings, the U.S. Army Corps of Engineers (USACE) - Savannah District and Fort Stewart DPW contracted Science Applications International Corporation (SAIC) to perform a CAP-Part A investigation of the site, and numerous other UST sites located throughout the Fort Stewart garrison area. The scope developed by the USACE-Savannah District and Fort Stewart DPW for the initial site investigation was as follows:

1. Drill four soil boreholes, one located within the former UST 29 pit and the other three around the perimeter of the pit, down to the local water table using a hollow-stem auger rig.
2. Continuously collect soil samples at 2.5-foot intervals during borehole drilling and perform field headspace gas analysis on each sample to determine organic vapor concentration.
3. Select two soil samples for laboratory chemical analysis from each borehole drilled. Chemical parameters for soil samples submitted for laboratory analysis included benzene, toluene, ethylbenzene, and xylenes (BTEX), polynuclear aromatic hydrocarbons (PAH), and TPH.

In boreholes where organic vapors were detected, collect one sample from the 2.5-foot interval where the highest vapor concentration was encountered, and the other from the 2.5-foot interval where the lowest concentration was encountered.

In boreholes where no organic vapors were detected, collect one sample from the 2.5-foot interval located near the mid-depth point between the ground surface and the water table, and the other from the 2.5-foot interval located immediately above or at the water table.

4. Upon reaching the water table, collect one groundwater sample from each borehole using a Hydropunch II, or similar sampling device. Chemical parameters for groundwater samples submitted for laboratory analysis included BTEX and PAH.
5. After completion of all soil and groundwater sampling, install a temporary polyvinyl chloride (PVC) piezometer within each drilled borehole. Measure static groundwater level 24 hours after piezometer installation, remove each piezometer, and abandon each borehole by grouting to the surface.

The rationale for the design of the site investigation was based on the results from the sampling conducted during the tank removal. These results were insufficient to determine the vertical and horizontal extent of contamination in soil and groundwater. The site investigation was designed to fulfill these identified data needs.

However, the initial site investigation results were also found to be insufficient to determine the vertical and horizontal extent of contamination at the UST 29 site. Therefore, a subsequent investigation was conducted at the site. The scope for the subsequent investigation was identical to the scope of the initial investigation and involved the drilling of two additional soil boreholes, both located around the perimeter of the former UST 29 pit, down to the local water table using a hollow-stem auger rig.

The field work for the site investigation was performed by SAIC during September 1996 (initial investigation) and December 1996 (subsequent investigation). Five soil boreholes (designated 14-01 through 14-06) were drilled at the site down to the following depths: 14-01 (20.0 feet), 14-02 (15.0 feet), 14-03 (9.0 feet), 14-04 (8.0 feet), 14-05 (17.0 feet), and 14-06 (15.0 feet). The boreholes were advanced between approximately 0.5 feet to 5.0 feet below the water table to accomplish groundwater sampling using a PowerPunch sampler. Figure II-3 illustrates the locations of the site investigation boreholes, and boring logs recorded during drilling are presented in Appendix A of this report.

Collection of two soil samples for laboratory chemical analysis from each of the site investigation boreholes was accomplished as planned. Collection of one groundwater sample from each borehole and measurement of static water levels were also accomplished as planned. However, due to problems encountered regarding the collection of the groundwater samples using the PowerPunch sampler, the samples at the borehole 14-01, 14-02, 14-03, 14-04, and 14-06 locations were collected from the pre-cleaned temporary piezometers installed in the boreholes using disposable bailers.

A summary of the soil and groundwater samples submitted for analytical analysis during the site investigation is presented in Table II-2. Additional information regarding the technical approach used by SAIC for implementation of the site investigation is presented in Appendix B of this report. Details regarding the analytical results for soil and groundwater samples collected during the investigation are discussed in Section D.3 of this report.

D.1 Regulated Substance Released

According to operational records maintained by the Fort Stewart DPW, UST 29 was used for waste oil storage. Therefore, waste oil is the only regulated substance believed to have been released at this site.

D.2 Source of Contamination

The location of former UST 29 is illustrated in Figure II-1. Detailed schematics illustrating the location of the tank and ancillary piping as configured during operation is not available. During removal activities, Fort Stewart DPW personnel observed no holes in the tank and, therefore, the source of contamination is believed to have been piping leakage and/or tank overflows. At the present time, the only remaining source of contamination at the site is contaminated soil located below the former tank pit.

D.3 Impacted Environmental Media

D.3.a Soils

A summary of the analytical results for the soil samples collected during the CAP-Part A site investigation at the site is presented in Table II-3. Laboratory data sheets for these samples and the project Quality Control Summary Report (QCSR) are presented in Appendices C-1 and C-3 of this report. Figure II-3 illustrates the site investigation borehole locations and corresponding analytical results for soil samples collected at each location.

Soil sample analytical results were compared to their applicable soil threshold levels. Soil samples collected from the tank pit after the removal of the tank did not indicate concentrations of BTEX compounds in the tank pit above the soil threshold levels. An additional investigation was required based on the TPH concentrations in the tank removal samples.

During the site investigation, due to the construction of a storage area over the former tank pit location, soil borings could not be drilled into the tank pit. Trace concentrations of toluene, ethylbenzene, and xylenes were detected in samples located around the perimeter; however, the concentrations were well below the corresponding soil threshold levels. Soil samples from boreholes 14-03 and 14-06 contained concentrations of benzene above soil threshold levels. These two boreholes are located 45 to 65 feet from the tank pit. An electrical conduit leading from Building 1636 was encountered during drilling of borehole 14-03. TPH concentrations from the site investigation samples ranged from 69.1 mg/kg to 275 mg/kg.

Evaluation of the nature and extent of the soil contamination at the site was accomplished using analytical data from both the site investigation and the tank removal sampling. Soil samples collected during the initial site characterization of the CAP-Part A investigation indicated elevated concentrations of benzene in boreholes 14-03 and 14-06. The location of the soil contamination suggests the source is not from the former UST 29.

D.3.b Groundwater

A summary of the analytical results for the groundwater samples collected during the CAP-Part A site investigation at the site is presented in Table II-4. Laboratory data sheets for these samples and the project QCSR are presented in Appendices C-2 and C-3 of this report. Figure II-4 illustrates the site investigation borehole locations and corresponding analytical results for groundwater samples collected at each location.

Groundwater sample analytical results were compared to Maximum Contaminant Levels (MCLs) for Safe Drinking Water. No groundwater samples were collected during tank removal activities.

During the site investigation, analytical results of groundwater indicated that a benzene concentration exceeded the corresponding MCL of 5 $\mu\text{g/L}$. The benzene concentration was reported to be 238 $\mu\text{g/L}$ in borehole 14-03. No other BTEX compounds were detected above their respective MCLs. In addition, naphthalene was detected in groundwater samples at a concentration of 51.2 $\mu\text{g/L}$, however, no MCL exists for this PAH compound.

Based on an evaluation of the site investigation analytical data, groundwater contaminated with benzene exceeding its MCL is present at the site and the extent of contamination was determined during the CAP-Part A investigation and is limited to the vicinity of borehole 14-03. The location of the groundwater contamination suggests the source is not from the former UST 29.

D.3.c Surface Water Impacted

Based on the estimated nature and extent of petroleum-related groundwater contamination detected at the site, this finding suggests that contamination at the site has not migrated to the point of impacting surface water bodies located in the vicinity of the site. Therefore, collection and analysis of surface water samples were not conducted as part of the site investigation.

D.3.d Drinking Water Supply Impacted

Based on the estimated nature and extent of petroleum-related groundwater contamination detected at the site, this finding suggests that contamination at the site has not migrated to the point of impacting groundwater supply wells located in the vicinity of the site. Therefore, collection and analysis of groundwater samples from vicinity supply wells were not conducted as part of the site investigation.

D.4 Local Water Resources

D.4.a Drinking Water Supplies

According to the Groundwater Pollution Susceptibility Map of Georgia (GDNR 1992), Facility ID #9-089088 is located within an average or higher groundwater pollution susceptibility area. A total of seven groundwater supply wells are located within a 2-mile radius of the Fort Stewart garrison area. Fort Stewart does not use any surface water bodies as water supplies. Documentation of the water supply survey is presented in Appendix D of this report.

Six of these wells are located within the confines of the garrison area. The other well is located at Wright Army Airfield, approximately 1.2 miles northeast of the garrison area. All of the groundwater supply wells are classified as public wells that supply water to Fort Stewart for drinking and nondrinking purposes. These wells are approximately 450 feet in depth and draw groundwater from the Principal Artesian (also known as the Floridan) aquifer. Chlorine and fluoride are added into the groundwater at the well heads prior to being pumped into storage tanks and/or water towers, according to Fort Stewart DPW personnel. The location of these wells along with a 500-foot radius is shown in Figure II-5. Based on the location of Facility ID #9-089088 relative to the identified groundwater supply wells, this site is classified as being located greater than 500 feet to a withdrawal point.

D.4.b Surface Water Bodies

Several surface water bodies are located within a 1-mile radius of the Fort Stewart garrison area. These are shown in Figure II-5 and include Mill Creek, Taylors Creek, Peacock Creek, Childpen's Pond, and two unnamed ponds. Mill Creek extends along the western side of the garrison area and flows into Taylors Creek located approximately 0.75 miles northwest of the garrison area. Taylors Creek then flows northward approximately 3.5 miles to its confluence with Canoochee Creek. Peacock Creek originates near the east corner of the garrison area and flows southward from the garrison. Mill Creek, Taylors Creek, and Peacock Creek all have natural streambeds and exhibit perennial flow.

Childpen's Pond is located at the northwest end of the garrison area. The two unnamed ponds are located at the northwest end of the facility golf course in the vicinity of Childpen's Pond. All of the ponds are isolated water bodies that are relatively small in size, measuring less than 500 feet in diameter. Based on the location of Facility ID #9-089088 relative to the area surface water bodies, this site is classified as being located greater than 500 feet to a surface water body.

D.5 Other Hydrogeologic Data

Regional Geology

The Fort Stewart Military Reservation (FSMR) is located within the coastal plain physiographic province. This province is typified by nine southeastward dipping strata that increase in thickness from zero feet at the fall line located approximately 350 miles inland from the Atlantic coast, to approximately 4,200 feet at the coast. State geologic records describe a probable petroleum exploration well (the No. 1 Jelks-Rogers) located in the region as encountering crystalline basement rocks at a depth of 4254 feet below the land surface. This well provides the most complete record for Cretaceous, Tertiary, and Quaternary sedimentary strata in the region.

The Cretaceous section was found to be approximately 1,970 feet in thickness and dominated by clastics. The Tertiary section was found to be approximately 2,170 feet in thickness and dominated by limestone with a 175-foot thick cap of dark green phosphatic clay. This clay is regionally extensive and is known as the Hawthorn Group. The interval from approximately 110 feet to the surface is Quaternary in age and composed primarily of sand with interbeds of clay or silt. This section is undifferentiated into separate formations (Metcalf & Eddy 1996).

Local Geology

State geologic records contain information regarding a well drilled in October 1942, 1.8 miles north of Flemington at Liberty Field of Camp Stewart (now known as Fort Stewart). This well is believed to be an artesian well located approximately one-quarter mile north of the runway at Wright Army Airfield within the FSMR. The log for this well describes a 410-foot section, the lowermost 110 feet of which consisted predominantly of limestone sediments above which 245 feet of dark green phosphatic clay typical of the Hawthorn Group was encountered. The uppermost portion of the section was found to be Quaternary age interbedded sands and clays. The top 15 feet of these sediments were described as sandy clay (Metcalf & Eddy 1996).

The surface soil located throughout the Fort Stewart garrison area consists of Stilson loamy sand. The surface layer of this soil is typically dark grayish brown loamy sand measuring approximately 6 inches in depth. The surface layer is underlain by material consisting of pale yellow loamy sand and extends to a depth of approximately 29 inches. The subsoil is dominantly sandy clay loam and extends to a depth of 72 inches or more (Metcalf & Eddy 1996).

Hydrogeology

The hydrogeology in the vicinity of the FSMR is dominated by two aquifers referred to as the Principal Artesian and the surficial. The Principal Artesian aquifer is the lowermost hydrologic unit and is regionally extensive from South Carolina through

Georgia, Alabama, and most of Florida. Known elsewhere as the Floridan, this aquifer is composed primarily of Tertiary age limestone including the Bug Island Formation, the Ocala Group, and the Suwannee Limestone. These formations are approximately 800 feet in thickness, and groundwater from this aquifer is used primarily for drinking water (Arora 1984). The confining layer for the Principal Artesian aquifer is the phosphatic clay of the Hawthorn Group. There are minor occurrences of aquifer material within the Hawthorn Group; however, they have limited utilization (Miller 1990).

The uppermost hydrologic unit is the surficial aquifer, which consists of widely varying amounts of sand and clay ranging from 55 to 150 feet in thickness. This aquifer is primarily used for domestic lawn and agricultural irrigation. The top of the water table ranges from approximately 2 to 10 feet below ground level (Geraghty and Miller 1993). However, soil surveys for Liberty and Long Counties describe the occurrence of a perched water table within the Stilson loamy sands present within the FSMR (Looper 1980).

D.5.a Depth to Groundwater

Determination of the depth to groundwater at the site was accomplished by measuring water levels within temporary piezometers. Each temporary piezometer consisted of 2.0-inch PVC slotted screen and casing that was placed into each soil borehole drilled at the site after completion of soil and groundwater sampling. The piezometers remained in the boreholes for an approximately 24-hour period to allow for stabilization of the water table surface. At the end of the stabilization period, static groundwater levels were measured in each piezometer.

Table II-5 presents a summary of the groundwater depth measurement results for the site investigation. Details regarding the procedures used by SAIC for the installation of temporary piezometers, measurement of static water levels, and surveying of borehole elevations are presented in Appendix B of this report.

D.5.b Groundwater Flow Direction

Based on groundwater elevations calculated from the depth to groundwater measurements recorded during the site investigation, groundwater at Facility ID #9-089088 flows to the northwest and southeast away from the former UST 29 tank pit area. Equipotential contours illustrating the specific groundwater flow pattern at the site are presented in Figure II-4. However, the groundwater depth measurement recorded at the borehole 14-01 location drilled within the former tank pit (i.e., non-native material) was not included in the interpretation of the groundwater flow pattern at the site. Groundwater elevations, referenced to mean sea level, for each temporary piezometer installed during the site investigation are also presented in Figure II-4.

D.5.c Hydraulic Gradient

The hydraulic gradient at Facility ID #9-089088 was calculated using the groundwater elevations measured in the boreholes located outside of the tank pit, as these boreholes represent native undisturbed soil. The groundwater flow direction was determined and the hydraulic gradient was computed along the direction of flow. The hydraulic gradient at Facility ID #9-089088 is estimated to be 0.040 feet/feet toward the northwest from the former UST 29 tank pit area, and 0.077 feet/feet toward the southeast from the tank pit area.

D.5.d Total Organic Carbon (Optional)

Alternate Threshold Levels (ATLs) are not planned to be calculated for contaminated soils located at the site. Therefore, analysis of total organic carbon was not conducted as part of the site investigation.

D.5.e Grain-Size Distribution

ATLs are not planned to be calculated for contaminated soils located at the site. Therefore, analysis of grain-size distribution was not conducted as part of the site investigation.

D.5.f Total Petroleum Hydrocarbons (Optional)

ATLs are not planned to be calculated for contaminated soils located at the site. However, analysis of TPH was included as part of the site investigation in order to provide additional data for use in determining the extent of soil contamination.

D.6 Corrective Action Completed or In-Progress

D.6.a USTs Removed

The UST system, tank and ancillary piping, was removed from service in April 1995, and was subsequently excavated and removed on October 25, 1995. According to Fort Stewart DPW personnel, the UST system was closed in accordance with guidance document GUST-9 *So You Want to Close an UST*.

D.6.b Excavation and Treatment/Disposal of Backfill and Native Soils

The backfill material excavated during the removal of the UST was disposed of at KEDESH, Inc., an asphalt treatment plant, located on Highway 17N in Kingsland, Georgia. No overexcavation of native soil surrounding the tank pit was conducted during the tank removal operation. The excavation was backfilled with clean soil material upon completion of the removal activities.

D.7 Conclusions and Recommendations

Summary of Conclusions

The UST 29 site, Facility ID #9-089088, is located within an average or higher groundwater pollution susceptibility area. Public groundwater supply wells are located within a 2-mile radius of the site; however, the distance between the site and the nearest supply well is greater than 500 feet. Surface water bodies are located within a 1-mile radius of the site; however, the distance between the site and the nearest body is greater than 500 feet. Based on this information, the applicable soil threshold levels for the site are those listed in Table A (GDNR Rules for Underground Storage Tank Management, Chapter 391-3-15) for the Average or Higher Groundwater Pollution Susceptibility Area (Column 2) greater than 500 feet to a withdrawal point category. Regulatory limits (i.e., MCLs) for groundwater contamination at the site are those associated with the Safe Drinking Water Act.

Characterization of the site was accomplished through soil sampling conducted during removal of the tank, and a subsequent two-phase site investigation that involved both soil and groundwater sampling. Two soil samples were collected from the tank pit excavation during tank removal activities. Six soil boreholes were drilled during the site investigations, all located around the perimeter of the pit. Due to the construction of a storage area over the former tank pit location, soil borings could not be drilled into the tank pit. Two soil samples and one groundwater sample were collected from each of the six boreholes.

Soil analytical data from the tank removal sampling indicated that the soil from the tank pit was not contaminated with BTEX compounds; however, TPH concentrations were elevated. Soil contamination found during the CAP-Part A investigation was located in boreholes 45 to 65 feet from the tank pit and is probably from a different source than UST 29 tank pit.

Groundwater analytical data from the initial site characterization of the CAP-Part A investigation indicate that benzene contamination in groundwater exceeds its respective MCL. The contamination was determined to be limited to the borehole 14-03 location suggesting that the source of contamination is not the UST 29 tank pit.

Recommendations

Analytical results for soil and groundwater samples collected during the site investigation at the site are insufficient to define the nature and extent of petroleum-related contamination at the site. Based on these findings, further investigation of the UST 29 site, Facility ID #9-089088, is required.

As required by GDNR Underground Storage Tank Management Program, a CAP-Part B report should be prepared to document the remedial actions to be taken at the UST 29 site, Facility ID #9-089088.

D.8 Site Ranking

The Environmental Sensitivity Score for the UST 29 site, Facility ID #9-089088, was determined by completing the Site Ranking Form presented in Appendix II of the GUST-7A CAP-Part A guidance document. The result of the Site Ranking Form calculation indicates that the Environmental Sensitivity Score for the site is 1,860. A copy of the completed Site Ranking Form is presented in Appendix E of this report.

III. SITE INVESTIGATION PLAN

This Site Investigation Plan (SIP) presents the technical approach that will be used to delineate the horizontal and vertical extent of soil and groundwater contamination as a result of the release from UST 29, Facility ID #9-089088. In addition, this SIP discusses the relevant aquifer parameters that will be measured or calculated at the site to assist in the design of a corrective action.

A. Horizontal and Vertical Extent of Contamination

This section presents the methodology for delineation of the horizontal and vertical extent of contamination in the soil and groundwater.

A.1 Soils

Soil contamination will be delineated by analyzing soil collected from four boreholes (three of the boreholes will be converted into monitoring wells) installed around the area of operations (Figure III-1). Soil samples will be collected continuously on 5.0-foot centers using split-spoon samplers. These soil samples will be field screened to determine which samples will be sent for laboratory analysis. Two soil samples from each borehole will be sent off site for analysis of BTEX, PAH, and TPH. These samples will correspond to the sample with the highest field screening result and the deepest sample with the lowest field screening result. These samples should provide sufficient information to determine both vertical and horizontal extent of soil contamination. In the event that these boreholes do not fully delineate the soil contamination, additional boreholes will be installed.

A.2 Groundwater

Groundwater contamination was determined to be confined to the vicinity of 14-03. One monitoring well will be completed within the borehole installed in the area of highest groundwater contamination and two others downgradient (Figure III-1). The monitoring wells will be constructed of new, pre-cleaned, 2.0-inch Schedule 40 PVC. The screened interval will be 10.0 feet in length with 0.010-inch Slot. A Groundwater sample will be analyzed at an off-site laboratory for BTEX and PAH.

A.3 Surface Water

The extent of groundwater contamination is limited to the tank pit and does not intersect a surface water body. Therefore, surface water and sediment samples will not be collected.

B. Vadose Zone and Aquifer Characteristics

In addition to delineating the vertical and horizontal extent of contamination at the site, site-specific vadose zone and aquifer characteristics needed to design a remediation system or conduct a risk assessment will be measured and/or calculated. This section describes which characteristics will be determined and the methods used to determine them for the site.

B.1 Vertical Soil Permeability (Optional)

The vertical soil permeability is defined as the soil's capacity to transmit fluids from the surface to the water table. This parameter will not be measured at this site.

B.2 Infiltration Rate (Optional)

The infiltration rate is defined as the rate at which a liquid can enter the soil under specified conditions and is used to design systems for the disposal of treated groundwater. This parameter will not be measured at this site.

B.3 Saturated Horizontal Hydraulic Conductivity

The saturated horizontal hydraulic conductivity is defined as the proportional rate at which water can move through the subsurface. At several of the Ft. Stewart UST sites, this parameter will be determined through rising head slug tests. In accordance with EPD recommendations, a data logger will be used to obtain accurate results from three independent slug tests and the results will be analyzed using the Bouwer and Rice Method (Water Resources Research, V. 12, pp. 423-428, 1976 and Update).

B.4 Total Organic Carbon (Optional)

The total organic carbon is the amount of naturally occurring organic carbon contained in the soil and is used in the design of groundwater treatment systems and performance of risk assessments for groundwater. This parameter will be measured at this site.

B.5 Dissolved Iron (Optional)

The dissolved iron content in groundwater is used to assist in the design of groundwater treatment systems. This parameter will be measured at this site.

B.6 Effective Porosity

The effective porosity is defined as the ratio of the void space through which flow can occur to the total volume of a soil sample. These data are used to assist in the design of groundwater remediation systems and risk assessments. The effective porosity is

approximately equal to the specific yield and, at this site, typical values from documented literature will be used based on soil types at this site.

B.7 Seepage Velocity

The seepage velocity is defined as the speed that groundwater moves through the soil, relative to the hydraulic gradient, hydraulic conductivity, and effective porosity and is determined through a calculation. These data are used to design groundwater remediation systems and perform risk assessments.

B.8 Grain-size Distribution (Optional)

These data are used for determining Alternate Threshold Levels for soil. Grain size distribution will be determined by laboratory analysis of soil collected at this site from the depth interval between the contaminated soil and the water table. The grain size distribution will be determined using ASTM Method D 422-63 for all grain sizes, and ASTM Method D1140-92 may be used to more accurately determine the amount of material in soils that are finer than the No. 200 sieve.

B.9 Total Petroleum Hydrocarbons (TPH) (Optional)

As part of the additional soil sampling performed at this site, TPH will be analyzed at an off-site laboratory.

B.10 Pilot Test(s) (Optional)

Pilot tests will not be performed at this site.

IV. PUBLIC NOTICE

Facility ID #9-089088 is located within the confines of the Fort Stewart garrison area, which is part of the FSMR, a federally-owned facility. All of the property contiguous to the site is owned by the U.S. Government. The Fort Stewart DPW will comply with the public notice requirement defined in guidance document GUST-7A for CAP-Part A activity notification by publishing an announcement in the *Coastal Courier* and the *Patriot*, which are both newspapers that are circulated throughout Fort Stewart and the Hinesville, Georgia areas. The announcement will appear in both newspapers over a period of one week.

Publication of this announcement will be completed simultaneously with the submittal of this CAP-Part A report for review by the GDNR Environmental Protection Division. A copy of the newspaper announcement to be used for public notification is presented in Appendix F of this report.

V. CLAIM FOR REIMBURSEMENT: GUST TRUST FUND

The FSMR is a federally-owned facility, and, the owner of Facility ID #9-089088 (i.e., the U.S. Government) is not filing a claim for reimbursement of reasonable cleanup expenses from the GUST Trust Fund.

VI. REFERENCES

- Anderson Columbia Environmental, Inc., 1995. *Field Report for Testing, Cleaning, and Removing of Underground Storage Tanks (UST), Fort Stewart, Hinesville, Georgia.*
- Arora, Ram, 1984. *Hydrologic Evaluation for Underground Injection Control in the Coastal Plain of Georgia*, Department of Natural Resources, Environmental Protection Division, Georgia Geological Survey.
- Georgia Department of Natural Resources (GDNR), 1992. *Groundwater Pollution Susceptibility Map of Georgia*, Environmental Protection Division, Georgia Geologic Survey.
- Geraghty and Miller, 1993. *RCRA Facility Investigation Work Plan, Fort Stewart, Georgia.*
- Looper, Edward E., 1980. *Soil Survey of Liberty and Long Counties, Georgia*, U.S. Department of Agriculture, Soil Conservation Service.
- Metcalf & Eddy, 1996. *Final Work Plan for RCRA Facility Investigation at Bulk Fuel Storage System, Wright Army Airfield, Fort Stewart, Georgia.*
- Miller, James A., 1990. *Groundwater Atlas of the United States, Segment 6*, U.S. Department of the Interior, U.S. Geological Survey, Hydrologic Inventory Atlas 730G.

REPORT TABLES

1

Table II-1. Analytical Results for Soil Samples Collected by Anderson Columbia
During Removal of UST 29

FACILITY ID # 9-089088 (SOIL)							
Tank #	Sample # (Sample Date)	Benzene (mg/kg)	Toluene (mg/kg)	Ethylbenzene (mg/kg)	Xylenes (mg/kg)	TPH (mg/kg)	
29	T29-T1-S1 (10/25/95)	<0.00114	0.0593	0.035	0.2049	394.0	
	T29-T1-S2 (10/25/95)	<0.00118	0.00501	<0.00118	0.01161	76.5	
TPH Total Petroleum Hydrocarbons							
Applicable Soil Threshold Levels (mg/kg):							
		Benzene = 0.008	Toluene = 6.00	Ethylbenzene = 10.0	Xylenes = 700.0		

Table II-2. Soil and Groundwater Samples Collected by SAIC
During the Facility ID #9-089088 Site Investigation

Tank	Borehole Number	Sample Number & Type	Collection Date	Depth Interval (below ground surface)
29	Borehole 14-01	1401B1 (Soil)	9/21/96	2.5 - 5.0 Feet
		1401H1 (Soil)	9/21/96	17.5 - 20.0 Feet
		1401W2 (Groundwater)	9/21/96	15.0 - 20.0 Feet
	Borehole 14-02	1402C1 (Soil)	9/20/96	5.0 - 7.5 Feet
		1402D1 (Soil)	9/20/96	7.5 - 10.0 Feet
		1402W2 (Groundwater)	9/20/96	10.0 - 15.0 Feet
	Borehole 14-03	1403A1 (Soil)	9/8/96	1.0 - 2.5 Feet
		1403B1 (Soil)	9/8/96	2.5 - 5.0 Feet
		1403W2 (Groundwater)	9/8/96	4.0 - 9.0 Feet
	Borehole 14-04	1404A1 (Soil)	9/8/96	1.0 - 2.5 Feet
		1404B1 (Soil)	9/8/96	2.5 - 5.0 Feet
		1404W2 (Groundwater)	9/8/96	3.0 - 8.0 Feet
	Borehole 14-05	1405A1 (Soil)	12/15/96	1.0 - 2.5 Feet
		1405F1 (Soil)	12/15/96	10.0 - 12.5 Feet
		1405W2 (Groundwater)	12/15/96	15.0 - 17.0 Feet

Table II-2. (Continued)

Borehole 14-06	1406A1 (Soil)	12/15/96	1.2 - 2.5 Feet
	1406B1 (Soil)	12/15/96	2.5 - 5.0 Feet
	1406W2 (Groundwater)	12/16/96	10.0 - 15.0 Feet

Table II-3. Soil Analytical Results for the
Facility ID #9-089088 Site Investigation

Investigation: 14

Investigation: 14

Station	14-01	14-01	14-02	14-02	14-02	14-03	14-03	14-04	14-05	14-05
Sample ID	1401B1	1401H1	1402C1	1402D1	1403A1	1403B1	1404A1	1404B1	1405A1	1405F1
Date Collected	9/21/96	9/21/96	9/20/96	9/20/96	9/8/96	9/8/96	9/8/96	9/8/96	12/15/96	12/15/96
Depth	2.5 - 5.0 FT	17.5 - 20.0 FT	5.0 - 7.5 FT	7.5 - 10.0 FT	1.0 - 2.5 FT	2.5 - 5.0 FT	1.0 - 2.5 FT	2.5 - 5.0 FT	1.0 - 2.5 FT	10.0 - 12.5 FT
GDNR Level										
Polynuclear Aromatic Hydrocarbons										
MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG
2-Chloronaphthalene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Acenaphthene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Acenaphthylene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Anthracene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Benzo(a)anthracene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Benzo(a)pyrene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Benzo(b)fluoranthene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Benzo(g,h,i)perylene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Benzo(k)fluoranthene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Chrysene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Dibenzo(a,h)anthracene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Fluoranthene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Fluorene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Indeno(1,2,3-cd)pyrene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Naphthalene	NA	0.418 U	0.37 U	0.445 U	0.775 =	0.385 U	0.363 U	0.357 U	0.182 J	0.411 U
Phenanthrene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
Pyrene	NA	0.418 U	0.37 U	0.445 U	0.358 U	0.385 U	0.363 U	0.357 U	0.359 U	0.411 U
GDNR Level										
Petroleum Hydrocarbons										
MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG
Total Petroleum Hydrocarbons	NRC	75.9 =	12.8 U	96.6 =	24.9 U	28.9 U	9.7 U	7.83 U	69.1 =	275 =
GDNR Level										
Volatile Organics										
MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG	MG/KG
Benzene	0.008	0.0057 U	0.0063 U	0.0057 U	0.0068 U	0.0304 J	0.0116 =	0.0056 U	0.0054 U	0.0063 U
Ethylbenzene	10	0.0057 U	0.0063 U	0.0057 U	0.0068 U	0.132 J	0.0143 J	0.0056 U	0.0138 =	0.0063 U
Toluene	6	0.027 =	0.0075 =	0.0071 J	0.0068 U	0.0127 J	0.006 U	0.0062 =	0.0063 =	0.0063 U
Xylenes, Total	700	0.0057 U	0.0063 U	0.0057 U	0.0068 U	0.309 J	0.0479 =	0.0056 U	0.0139 J	0.0063 U

Table II-3. (Continued)

Investigation: 14		Station	14-06	14-06
		Sample ID	1406A1	1406B1
		Date Collected	12/15/96	12/15/96
		Depth	1.2 - 2.5 FT	2.5 - 5.0 FT
		GDNr Level	MG/KG	MG/KG
Polynuclear Aromatic Hydrocarbons		MG/KG	MG/KG	MG/KG
2-Chloronaphthalene		NA	0.364 U	0.382 U
Acenaphthene		NA	0.364 U	0.382 U
Acenaphthylene		NA	0.364 U	0.382 U
Anthracene		NA	0.364 U	0.382 U
Benzo(a)anthracene		NA	0.364 U	0.382 U
Benzo(a)pyrene		NA	0.364 U	0.382 U
Benzo(b)fluoranthene		NA	0.364 U	0.382 U
Benzo(g,h,i)perylene		NA	0.364 U	0.382 U
Benzo(k)fluoranthene		NA	0.364 U	0.382 U
Chrysene		NA	0.364 U	0.382 U
Dibenzo(a,h)anthracene		NA	0.364 U	0.382 U
Fluoranthene		NA	0.364 U	0.382 U
Fluorene		NA	0.364 U	0.382 U
Indeno(1,2,3-cd)pyrene		NA	0.364 U	0.382 U
Naphthalene		NA	0.398 =	0.382 U
Phenanthrene		NA	0.364 U	0.382 U
Pyrene		NA	0.364 U	0.382 U
		GDNr Level	MG/KG	MG/KG
Petroleum Hydrocarbons		MG/KG	MG/KG	MG/KG
Total Petroleum Hydrocarbons		NRC	637 =	144 =
		GDNr Level	MG/KG	MG/KG
Volatile Organics		MG/KG	MG/KG	MG/KG
Benzene		0.008	0.0059 J	0.0152 =
Ethylbenzene		10	0.155 J	0.0111 J
Toluene		6	0.0088 J	0.0162 =
Xylenes, Total		700	0.0355 J	0.0058 U

NRC - No Regulatory Criteria

NA - Not Applicable, the health based threshold level would be exceeded only if free product conditions existed

U - Indicates the compound was not detected at the concentration reported.

J - Indicates that the value for the compound is an estimated value.

UJ - Indicates the compound was not detected at the reported concentration and the concentration was estimated.

= - Indicates the compound was detected at the concentration reported.

Table II-4. Groundwater Analytical Results for the
Facility ID #9-089088 Site Investigation

Investigation: 14		Station	14-01	14-02	14-03	14-04	14-05	14-06
		Sample ID	1401W2	1402W2	1403W2	1404W2	1405W2	1406W2
		Date Collected	9/21/96	9/20/96	9/8/96	9/8/96	12/15/96	12/16/96
		Depth	15.0 - 20.0 FT	10.0 - 15.0 FT	4.0 - 9.0 FT	3.0 - 8.0 FT	15.0 - 17.0 FT	10.0 - 15.0 FT
		EPA MCL	UG/L	UG/L	UG/L	UG/L	UG/L	UG/L
Polynuclear Aromatic Hydrocarbons								
2-Chloronaphthalene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Acenaphthene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Acenaphthylene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Anthracene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Benzo(a)anthracene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Benzo(a)pyrene		0.2	10 U	10 U	10 U	10 R	10 U	10.2 U
Benzo(b)fluoranthene		NRC	10 U	10 U	10 U	10 R	10 U	10.2 U
Benzo(g,h,i)perylene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Benzo(k)fluoranthene		NRC	10 U	10 U	10 U	10 R	10 U	10.2 U
Chrysene		NRC	10 U	10 U	10 U	10 R	10 U	10.2 U
Dibenzo(a,h)anthracene		NRC	10 U	10 U	10 U	10 R	10 U	10.2 U
Fluoranthene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Fluorene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Indeno(1,2,3-cd)pyrene		NRC	10 U	10 U	10 U	10 R	10 U	10.2 U
Naphthalene		NA	10 U	10 U	51.2 =	10 R	10 U	10.2 U
Phenanthrene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Pyrene		NA	10 U	10 U	10 U	10 R	10 U	10.2 U
Volatile Organics		EPA MCL	UG/L	UG/L	UG/L	UG/L	UG/L	UG/L
Benzene		5	5 U	2.8 J	238 =	5 U	5 U	2.4 J
Ethylbenzene		700	5 U	0.17 J	71.4 =	5 U	0.098 J	0.53 J
Toluene		1000	5 U	5 U	6 =	5 U	5 U	5 U
Xylenes, Total		10000	5 U	2.4 J	180 =	5 U	4.6 J	5 U

NRC - No Regulatory Criteria

NA - Not Applicable, the health based threshold level would be exceeded only if free product conditions existed

IV - Insufficient volume to collect sample for analysis

U - Indicates the compound was not detected at the concentration reported.

J - Indicates that the value for the compound is an estimated value.

UJ - Indicates the compound was not detected at the reported concentration and the concentration was estimated.

= - Indicates the compound was detected at the concentration reported.

Table II-5. Groundwater Depth Measurements and Calculated Groundwater Elevations
for the Facility ID #9-089088 Site Investigation

Tank	Borehole	Date Measured	Water Level Depth	Screened Interval Depth	Ground Surface Elevation	Water Level Elevation
29	Borehole 14-01	9/22/96	4.95 Feet BGS	15 - 20 Feet BGS	70.56 Feet MSL	65.61 Feet MSL
	Borehole 14-02	9/21/96	3.50 Feet BGS	10 - 15 Feet BGS	70.28 Feet MSL	66.78 Feet MSL
	Borehole 14-03	9/9/96	1.97 Feet BGS	4 - 9 Feet BGS	70.29 Feet MSL	68.32 Feet MSL
	Borehole 14-04	9/9/96	2.52 Feet BGS	3 - 8 Feet BGS	71.87 Feet MSL	69.35 Feet MSL
	Borehole 14-05	12/16/96	4.24 Feet BGS	12 - 17 Feet BGS	70.21 Feet MSL	65.97 Feet MSL
	Borehole 14-06	12/17/96	Not Recorded	10 - 15 Feet BGS	70.67 Feet MSL	Not Recorded
BGS MSL	Below Ground Surface Mean Sea Level					



REPORT FIGURES

)

)

)

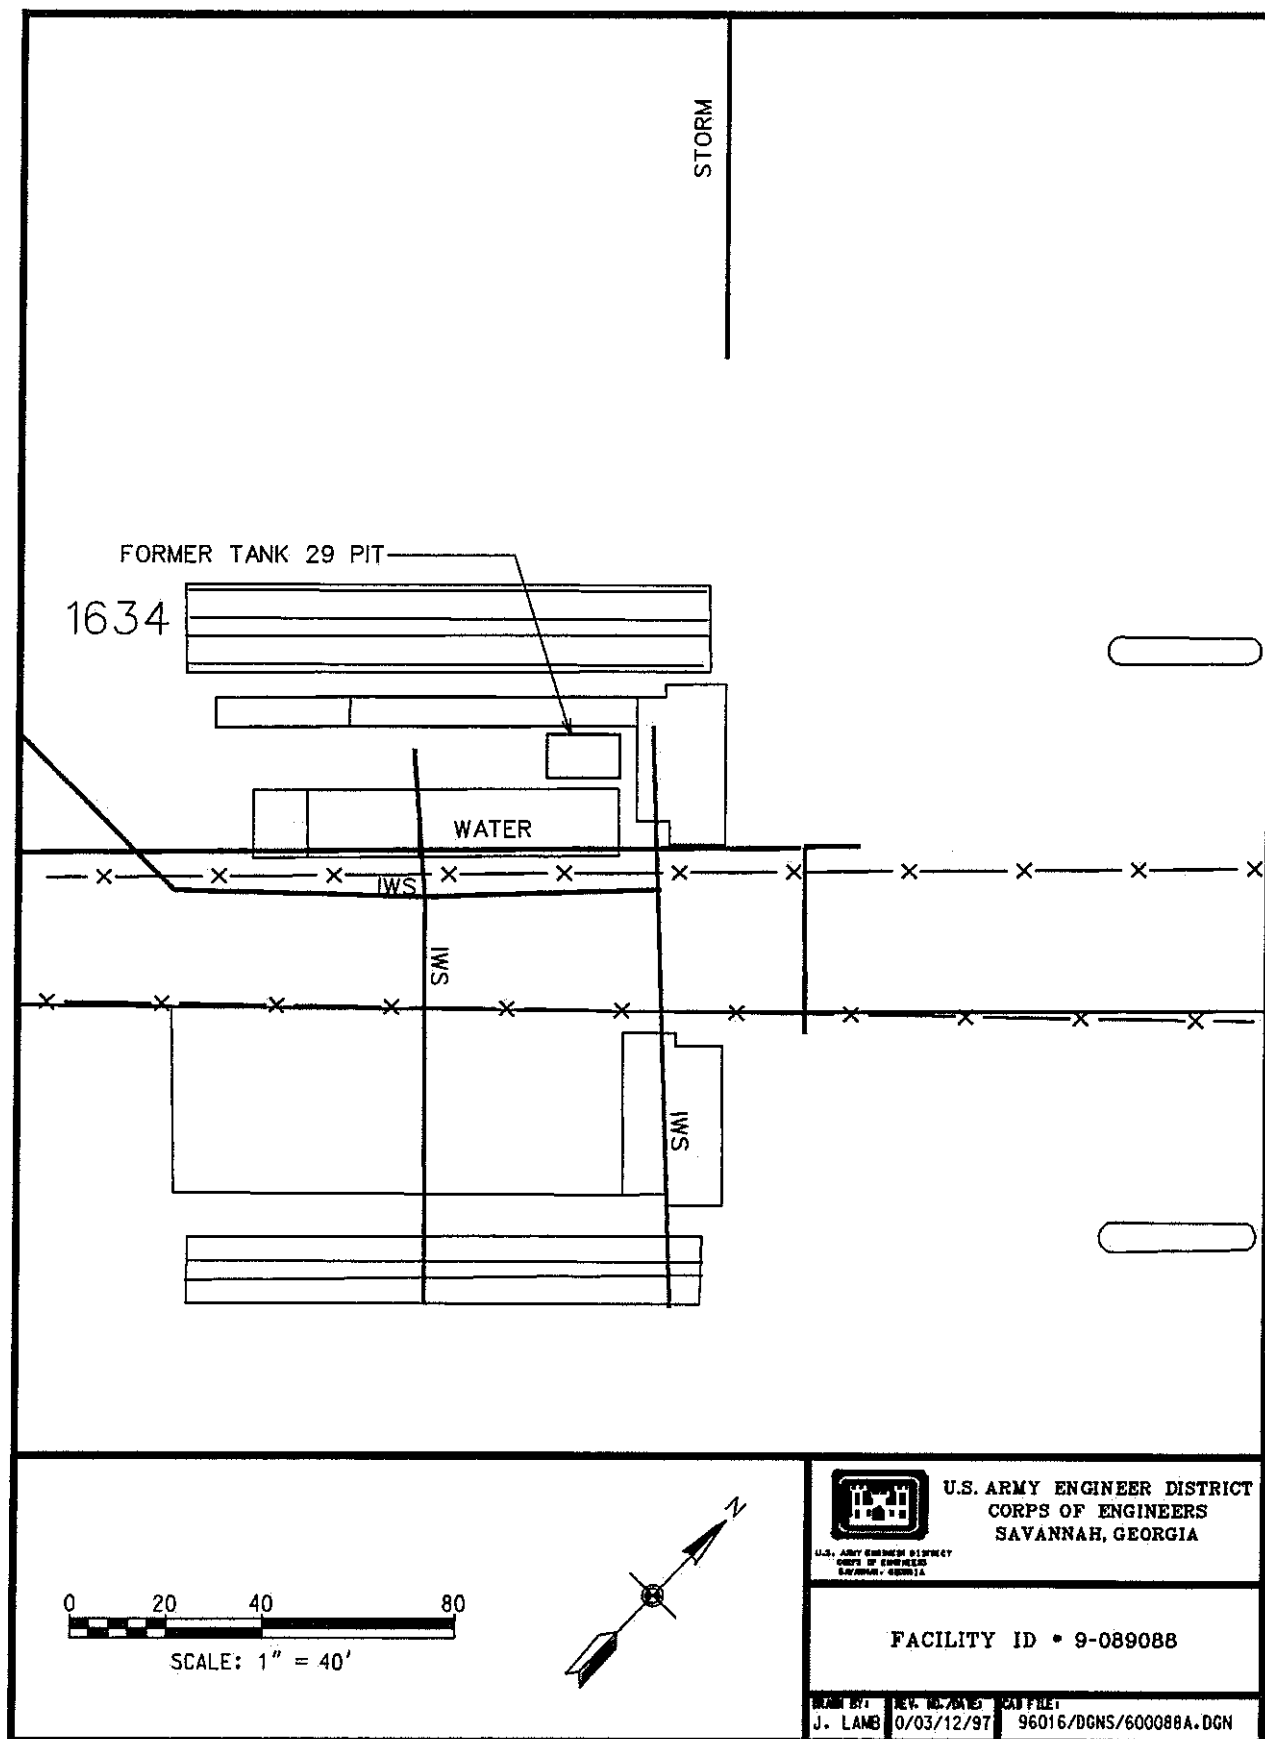


Figure II-1. Facility ID #9-089088, UST 29, Site Map



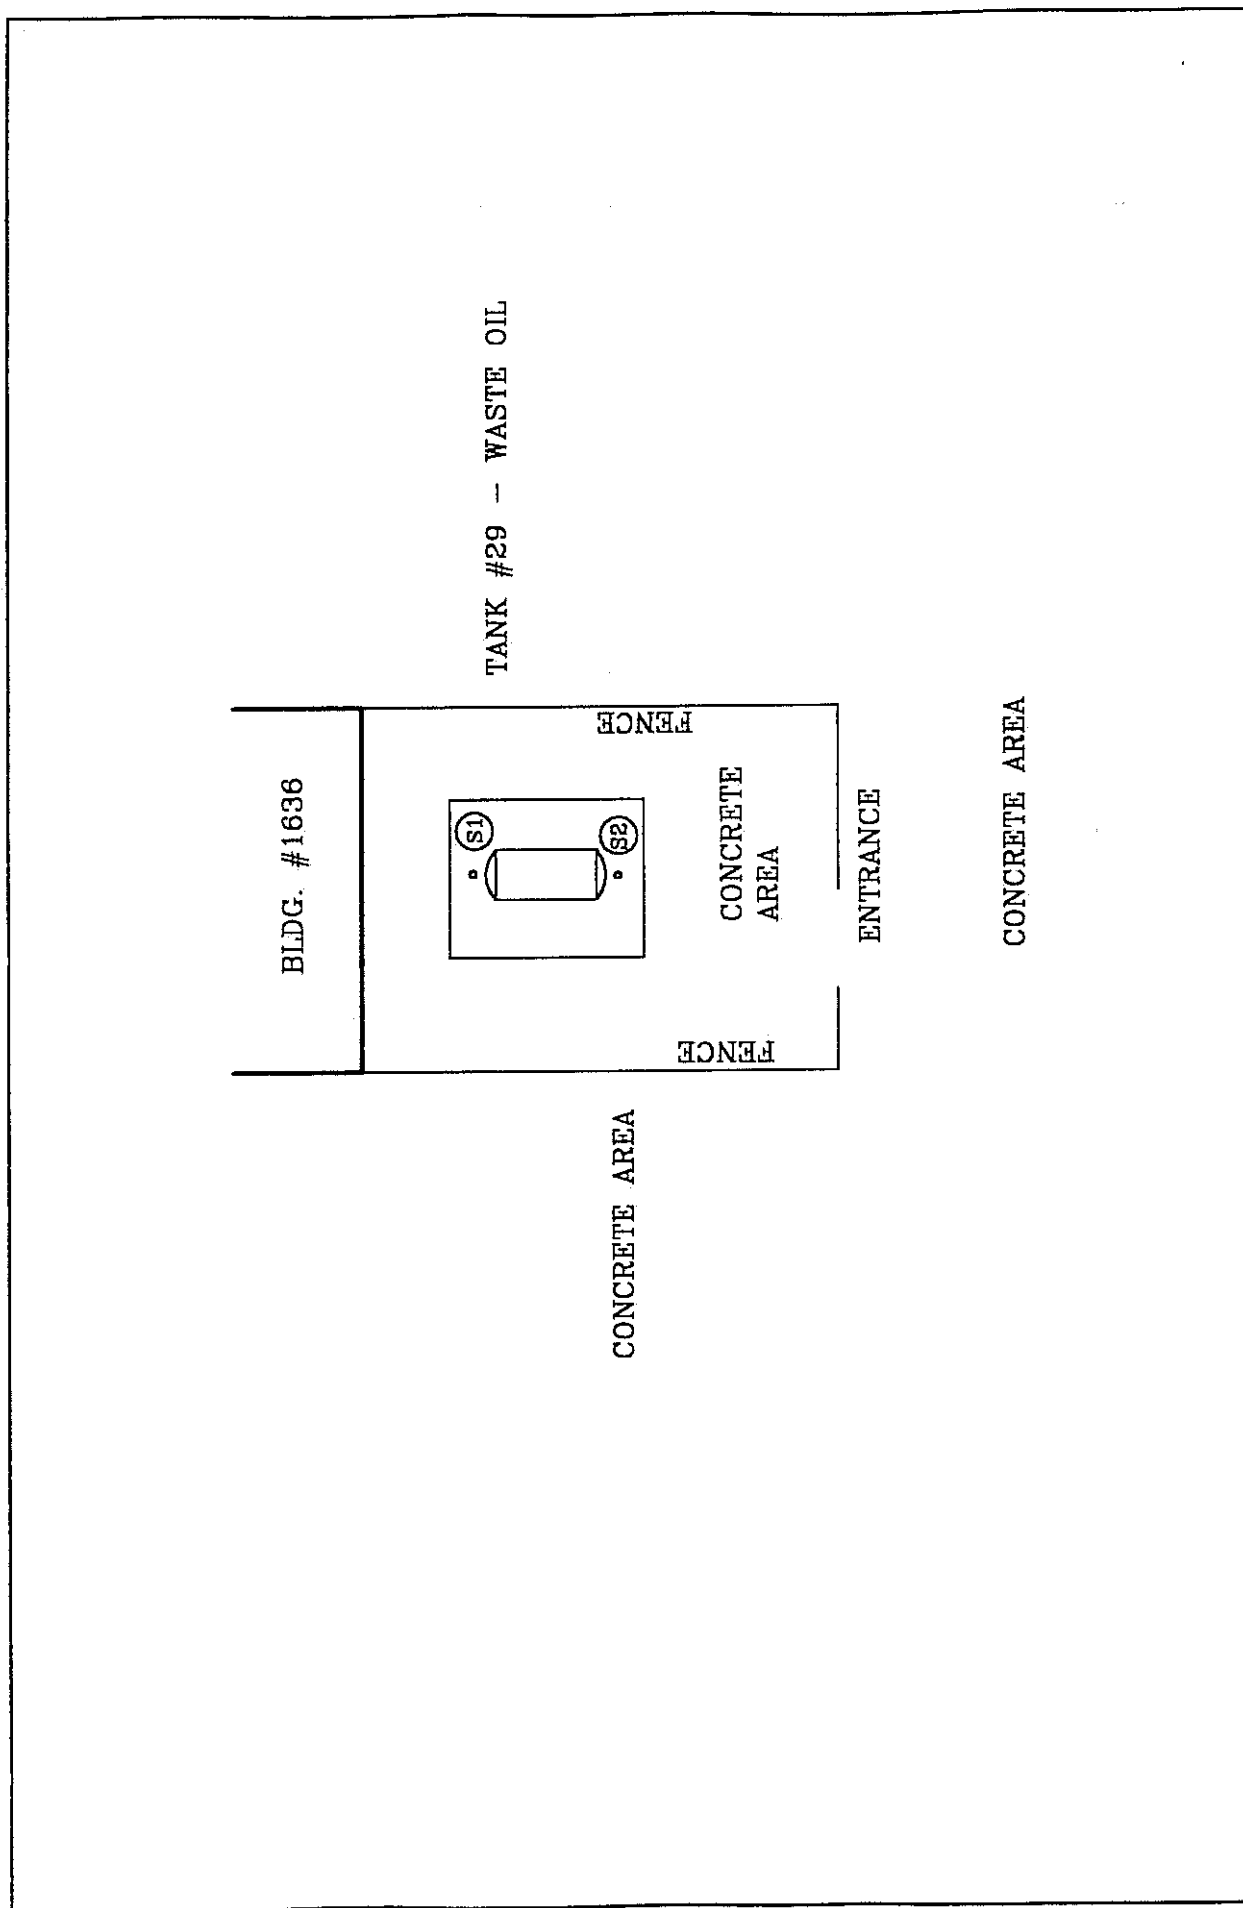


Figure II-2. Site Map of Sampling Locations for the UST 29 Removal

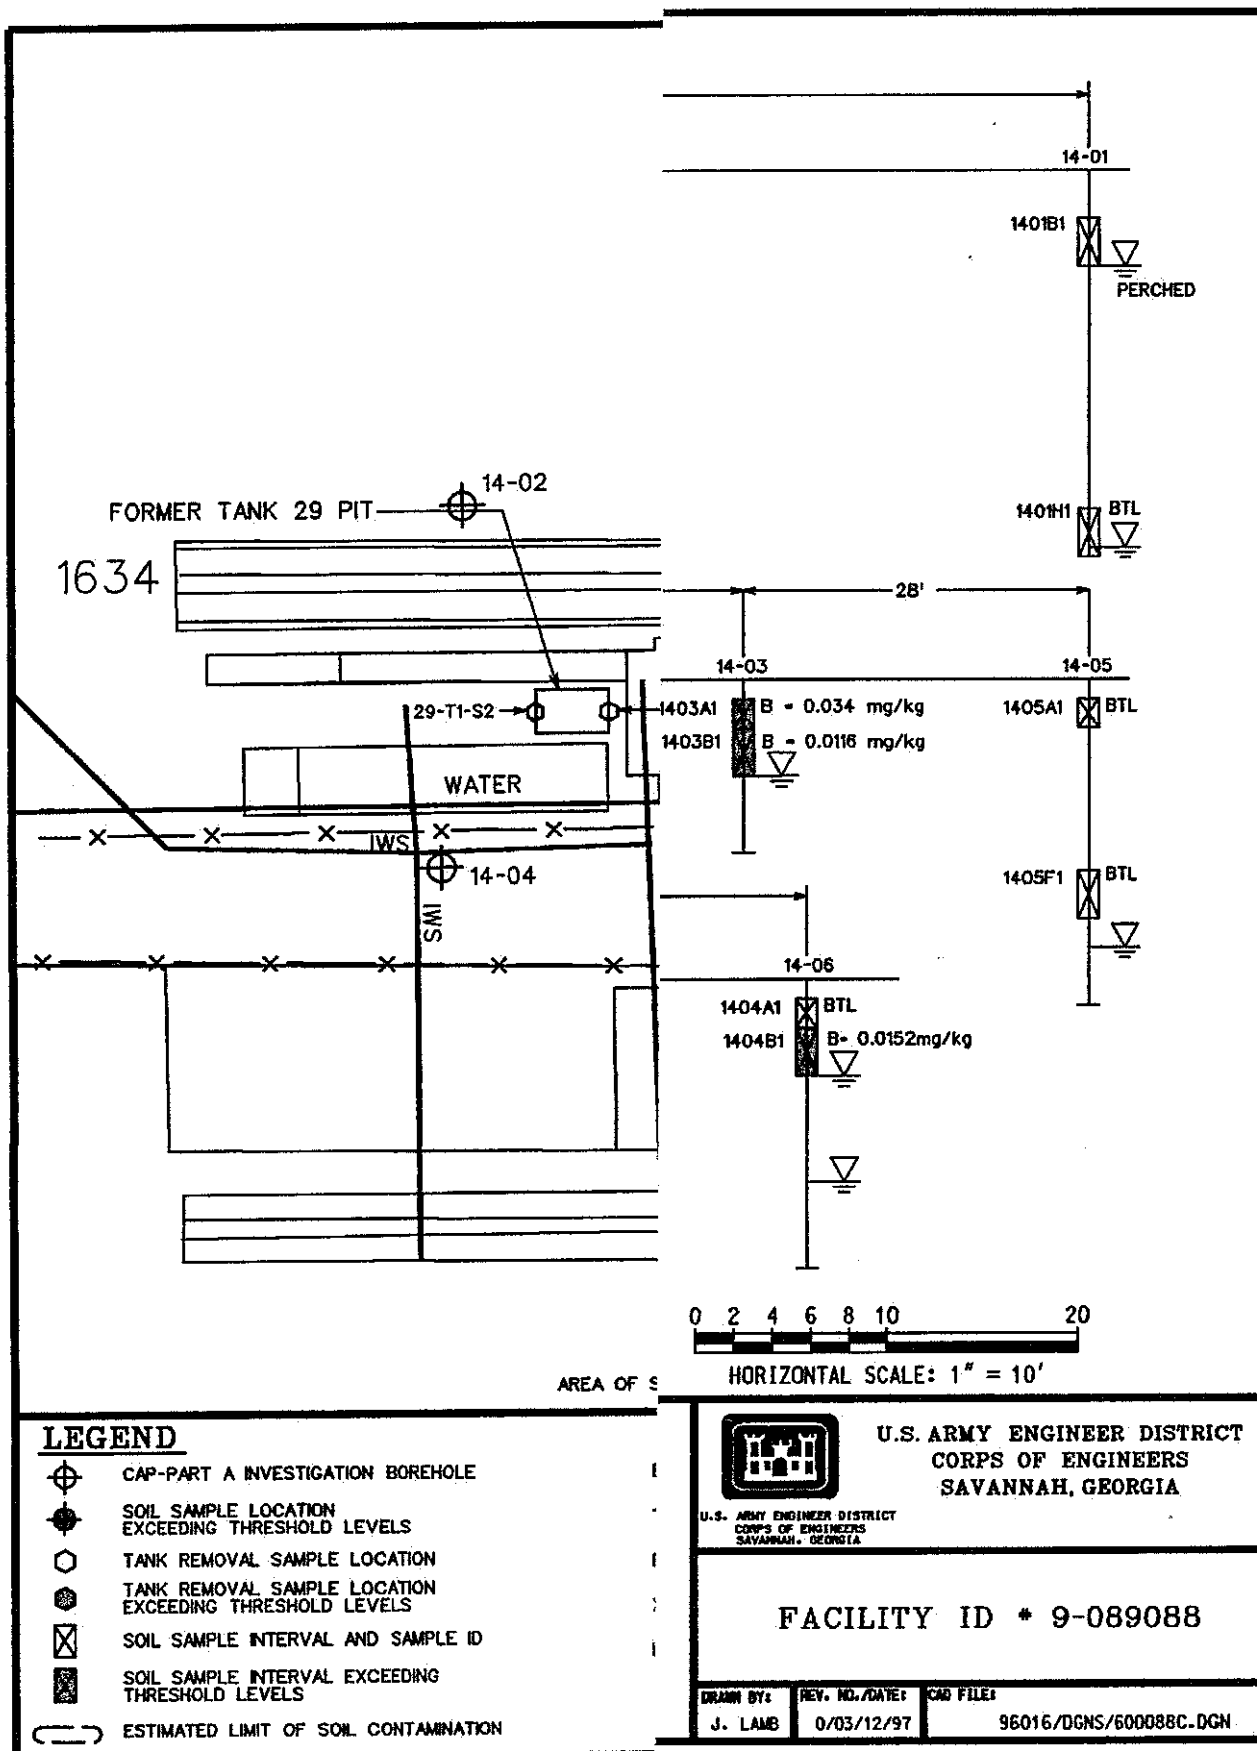

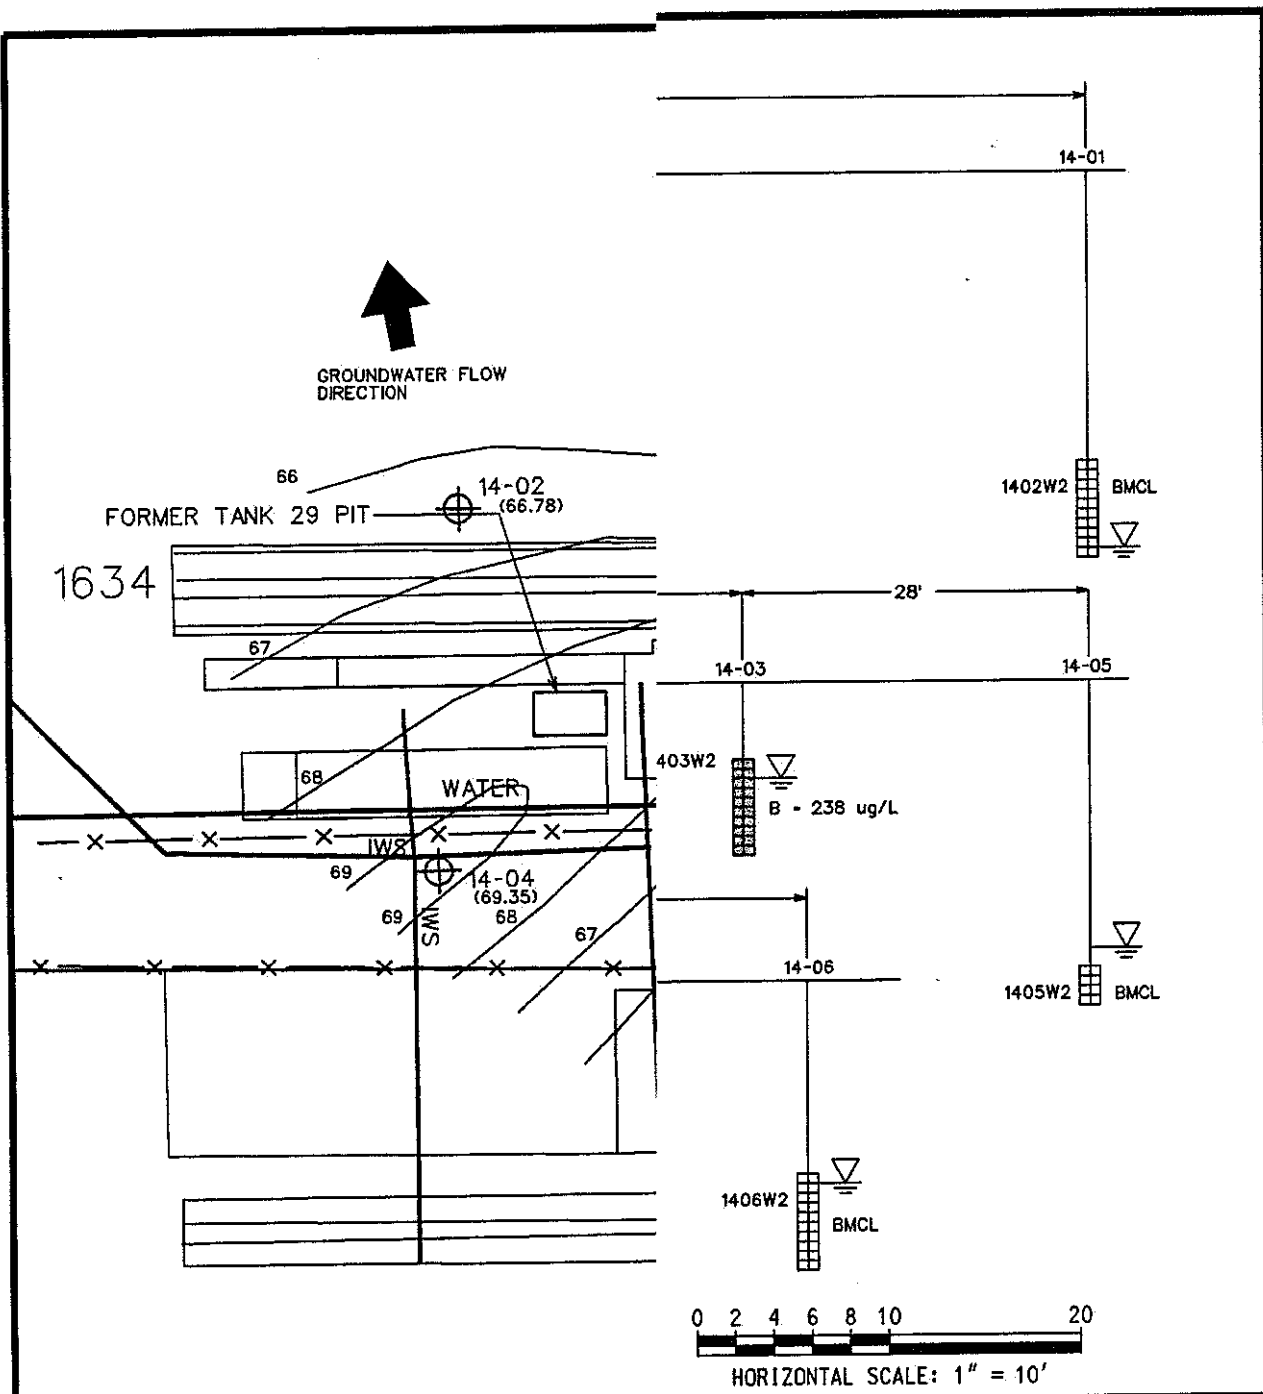

LEGEND

- CAP-PART A INVESTIGATION BOREHOLE
- GROUNDWATER SAMPLE LOCATION EXCEEDING MCLs
- SCREENED GROUNDWATER SAMPLE INTERVAL AND SAMPLE ID
- GROUNDWATER SAMPLE INTERVAL EXCEEDING MCLs
- ESTIMATED LIMIT OF GROUNDWATER CONTAMINATION



U.S. ARMY ENGINEER DISTRICT
CORPS OF ENGINEERS
SAVANNAH, GEORGIA

U.S. ARMY ENGINEER DISTRICT
CORPS OF ENGINEERS
SAVANNAH, GEORGIA


FACILITY ID * 9-089088

DRAWN BY:
J. LAMB

REV. NO./DATE:
0/03/12/97

CAD FILE:

96016/DCNS/600088B.DGN

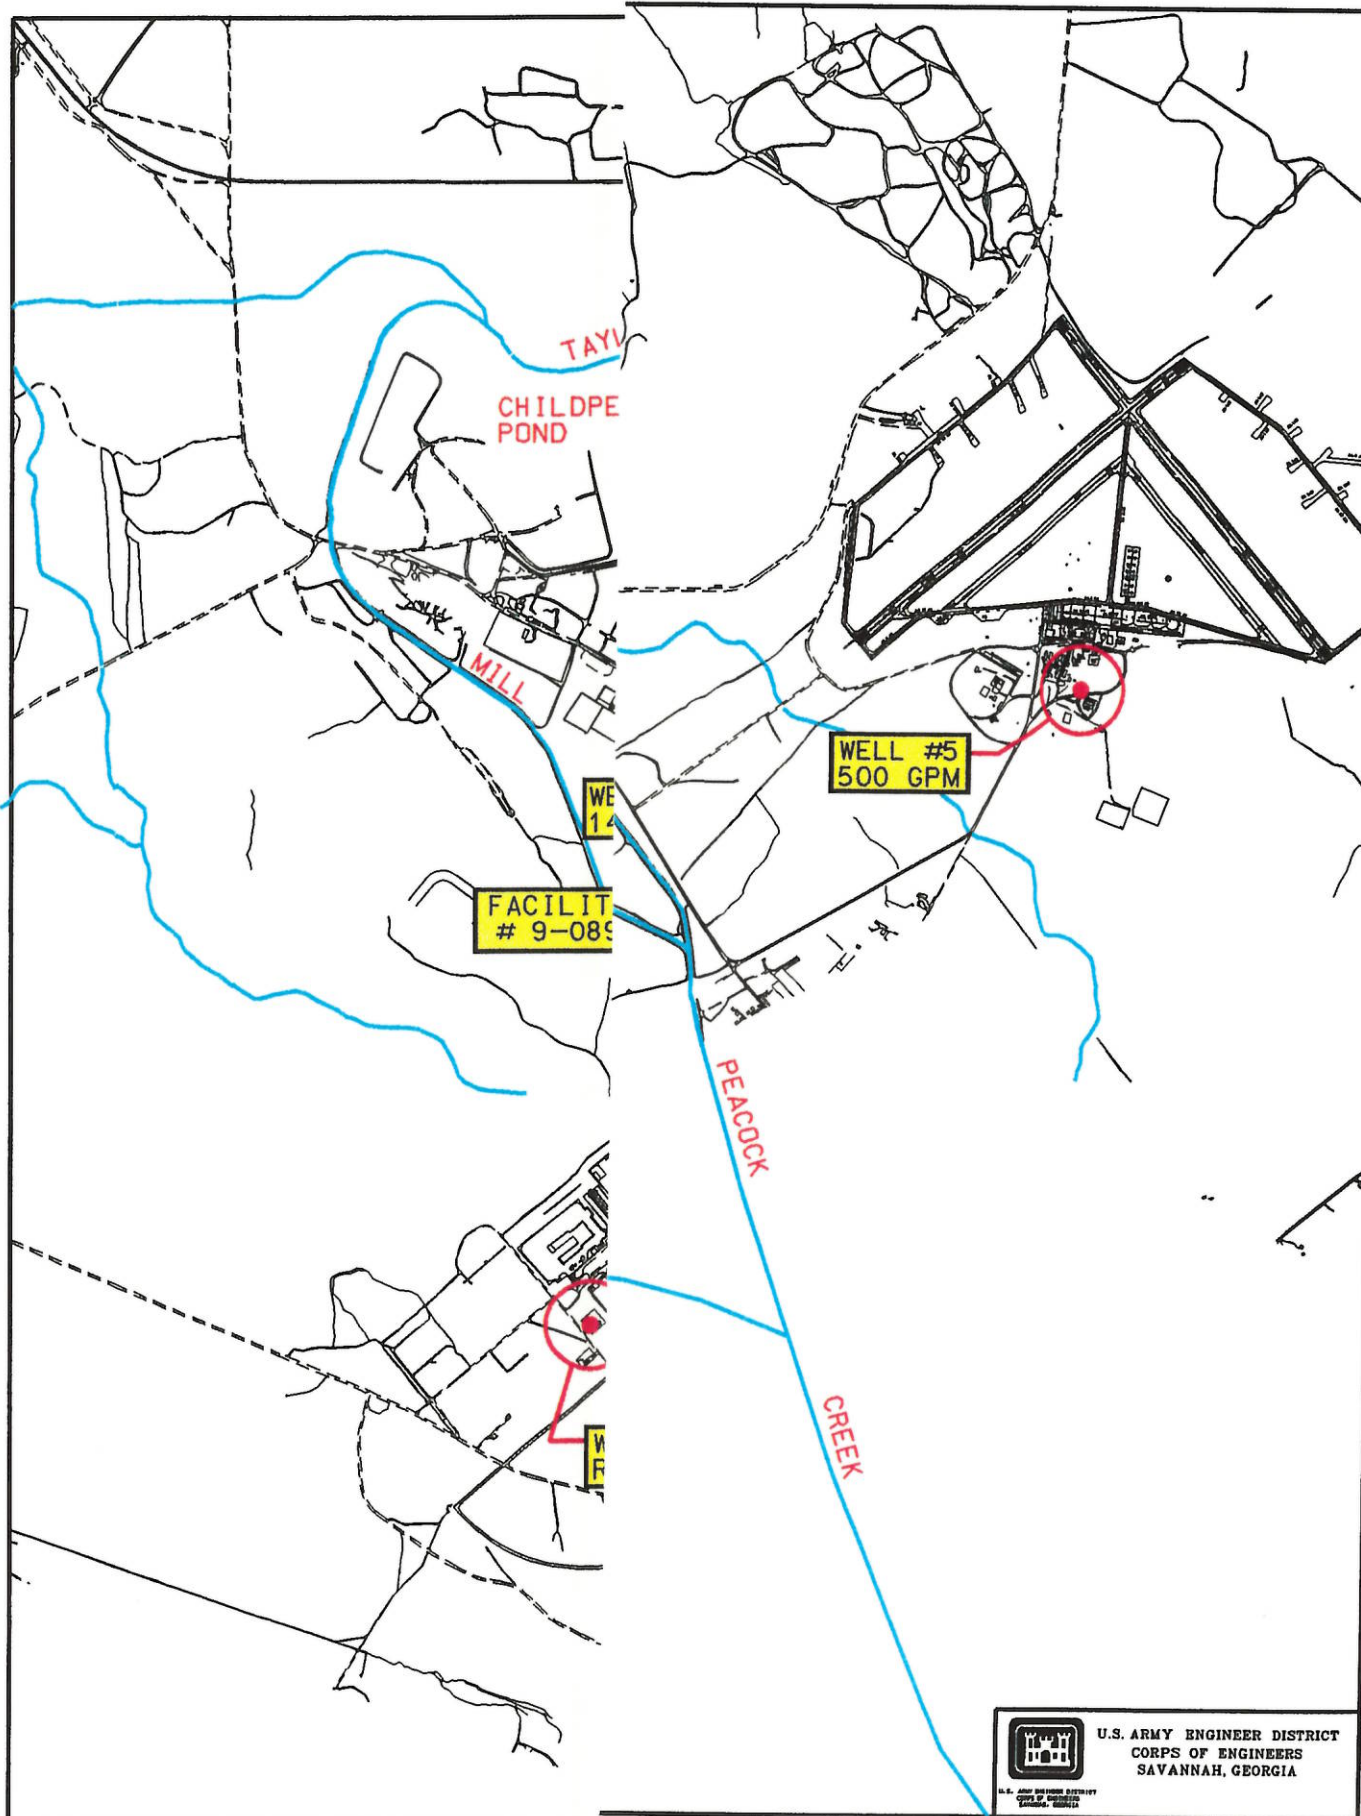

LEGEND

- CREEK
- POND

100 2200

" = 2200'

GPM =



U.S. ARMY ENGINEER DISTRICT
CORPS OF ENGINEERS
SAVANNAH, GEORGIA

FACILITY ID # 9-089088

DESIGN BY: J. LAMB REV. NO./DATE: 0/03/03/97 DGN FILE: 96016/DGNS/600088.DGN

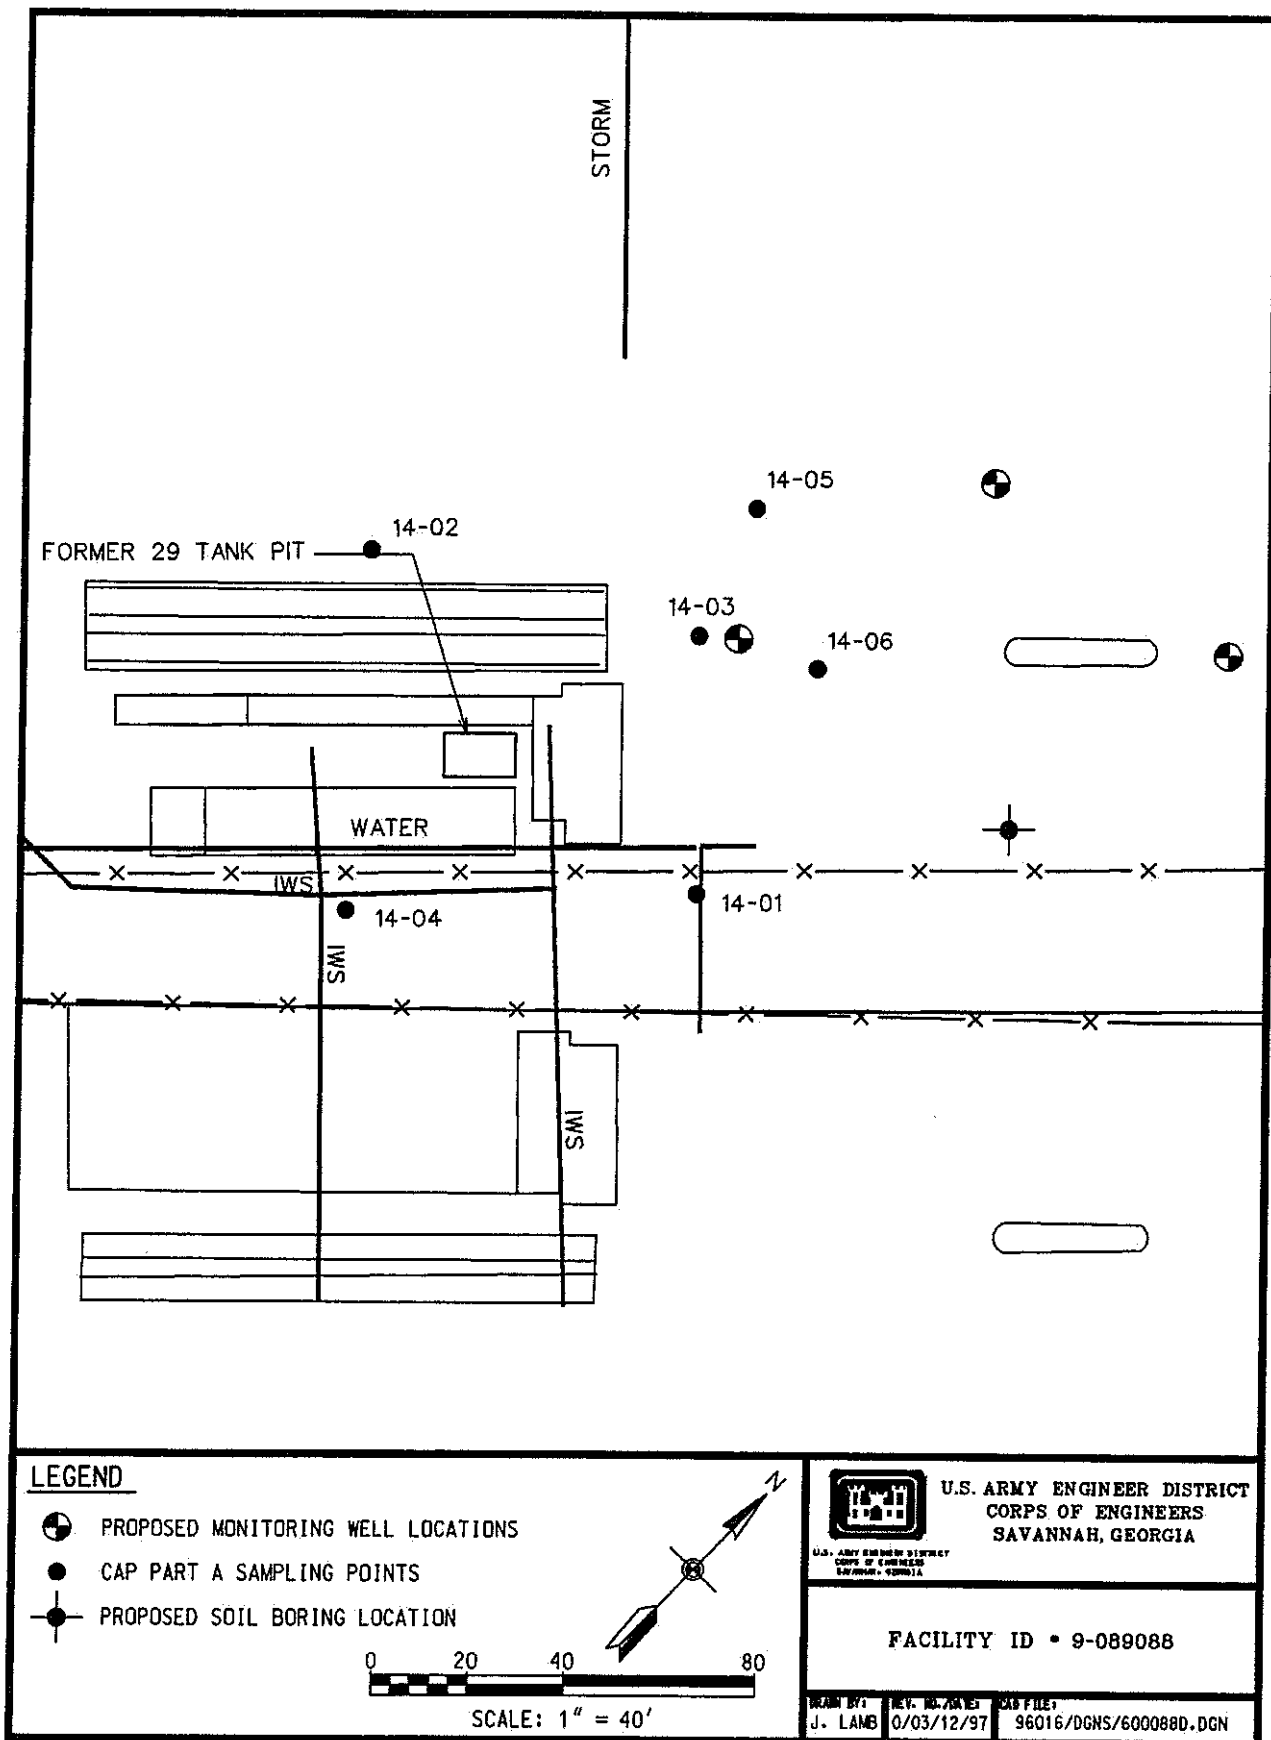


Figure III-1. Proposed Sampling Locations for
Facility ID #9-089088 Site Investigation Plan



APPENDIX A

SOIL BORING LOGS FOR THE FACILITY ID #9-089088 SITE INVESTIGATION

HTRW DRILLING LOG

14-01

PROJECT		INSPECTOR		SHEET		
Ft. Stewart HST		M. Vart		1 of 2		
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GROUTED SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)
	0.0	Concrete pad				
	1.0	Sandy clay, reddish brown, fine	0.0 rpm			
	2.0	Sand, dark gray, fine				
	3.0	Sandy clay, gray, fine	16.2 rpm		Soil Sample 1401B1	
	4.0					
	5.0	Sand, gray, fine	0.0 rpm			Patched
	6.0	Sandy clay, gray, fine to medium				
	7.0					
	8.0	Sand, brown, fine to medium	0.0 rpm			
	9.0	Sand, black, fine to medium				
	10.0					

Piezometer Casing

Piezometer casing

HTRW DRILLING LOG

PROJECT		INSPECTOR		HOLE NO.		SHEET	
Ft. Stewart HST		M. Vent		14-01		2 of 2	
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GRAVITY SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)	
	10.0						
	11.0	Clay, greenish gray	0.0 ppm				
	12.0						
	13.0						
	14.0		0.0 ppm				
	15.0						
	16.0		0.0 ppm				
	17.0						
	18.0		0.0 ppm				
	19.0						
	20.0	Clayey sand, greenish gray, fine					

Groundwater Sample 1401W2 collected from Piezometer

HTRW DRILLING LOG

DATE 14-02

PROJECT		INSPECTOR		SHEET		
Ft. Stewart HST		M. Vest		1 of 2		
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GEOTECH SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)
	0.0	Concrete Pad				
	1.0	Sand, brown, fine	0.0 rpm			
	2.0					
	3.0	Clay, greenish gray	0.0 rpm			
	4.0					
	5.0	Sand, gray, fine to medium				
	6.0					
	7.0	0.0 rpm				
	8.0					
	9.0	0.0 rpm				
	10.0					

Piezometer Casing

HTRW DRILLING LOG

PROJECT *1st. Stewart HST*

INSPECTOR

17. Vast

DATE *14-02*
SHEET *2 of 2*

ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GEOTECH SAMPLE OR CORE BOX NO. (E)	ANALYTICAL SAMPLE NO. (F)	REMARKS (G)
	10.0					<div> <div>▼</div> <div>Approx.</div> </div>
	11.0		0.0 ppm			
	12.0					
	13.0					
	14.0	Clay, greenish gray	0.0 ppm			
	15.0					Groundwater Sample 1402W2 Collected from Piezometer

Piezometer Screen

HTRW DRILLING LOG

Project No. 14-03

PROJECT Ft. Stewart LST

INSPECTOR

M. Patti

SHEET 1 of 1

ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GEOCHEM SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)
	0.0	Concrete pad				
	1.0	Sandy silt, gray				
	2.0		21.6 ppm		Soil Sample 1403A1	
	3.0				Soil Sample 1403B1	
	4.0		0.0 ppm			
	5.0	No Material Collected (Power Punch)				Approx.
	6.0					
	7.0					
	8.0					
	9.0					
						Groundwater Sample 1403W2 Collected From Piezometer

HTRW DRILLING LOG

PROJECT		INSPECTOR		DATE		SHEET	
Ft. Stewart HST		M. Patti		14-04		1 of 1	
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GEOTECH SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)	
	0.0	Concrete Pad					
	1.0	Sandy Silt, olive	0.0 ppm		Soil Sample 1404A1		Piezometer Casing
	2.0	Sand, reddish brown, fine			Soil Sample 1404B1		
	3.0						
	4.0		0.0 ppm				
	5.0	No Material Collected (Power Punch)				Approx.	Piezometer Screen
	6.0						
	7.0						
	8.0						
						Groundwater Sample 1404W2 Collected From Piezometer	

HTRW DRILLING LOG

HOLE NUMBER 14-05

PROJECT Ft. Stewart MST

INSPECTOR J. King

SHEET 1 of 2

ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	DEPTH SAMPLE OR CORE BOX NO (E)	ANALYTICAL SAMPLE NO (F)	REMARKS (G)
	0.0	Concrete Pad				
	1.0	Silty Sand, dark gray, fine to medium	14.5 ppm			
	2.0					
	3.0					
	4.0		2.1 ppm			
	5.0	Clayey Sand, bluish gray, fine to coarse				
	6.0		0.0 ppm			
	7.0					
	8.0	Clay, greenish gray				
	9.0		0.0 ppm			
	10.0					

 Soil Sample
1405A1

Piezometer Casing

HTRW DRILLING LOG

PROJECT		INSPECTOR		DATE		SHEET	
Ft. Stewart HST		J. King		14-05		2 of 2	
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GRAVE OF SAMPLE OR CORE BOX NO. (E)	ANALYTICAL SAMPLE NO. (F)	REMARKS (G)	
	10.0				↑		
	11.0		0.0 ppm		Soil Sample		
	12.0				↓ 1405 F1		
	13.0						
	14.0		0.0 ppm				
	15.0	Clayey sand, greenish gray, fine to medium				▼ Approx.	
	16.0	No Material Collected (Power Punch)			Groundwater Sample		
	17.0				↓ 1405 W2		Piezometer Screen

HTRW DRILLING LOG

14-06

PROJECT Ft. Stanton HST

INSPECTOR J. King

SHEET 1 of 2

ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	DEPTH OF SAMPLE OR CORE BOX NO. (E)	ANALYTICAL SAMPLE NO. (F)	REMARKS (G)
	0.0	Concrete Pad				
	1.0					
	2.0	Clayey, Silty Sand, dark gray, fine to medium	133.3 ppm		Soil Sample 1406A1 →	
	3.0				→ 1406B1	
	4.0		5.8 ppm		Soil Sample 1406B1	
	5.0				←	
	6.0		109.4 ppm			
	7.0					
	8.0	No Sample Due To Poor Recovery				
	9.0					
	10.0					

Piezometer Casing

HTRW DRILLING LOG						
PROJECT		INSPECTOR		DATE & SHEET		
Ft. Stewart HST		J. King		14-06 SHEET 2 of 2		
ELEV (A)	DEPTH (B)	DESCRIPTION OF MATERIALS (C)	FIELD SCREENING RESULTS (D)	GEOTECH SAMPLE OR CORE BOX NO. (E)	ANALYTICAL SAMPLE NO. (F)	REMARKS (G)
	10.0	Wood Fragments				
	11.0	Sand, greenish gray, fine to medium	14.2 rpm			Approx.
	12.0	Sandy clay, greenish gray, fine				
	13.0	No Sample due To Poor Recovery				
	14.0					
	15.0					
						Groundwater Sample 1406W2 Collected From Piezometer

APPENDIX B

TECHNICAL APPROACH FOR THE FACILITY ID #9-089088 SITE INVESTIGATION

TECHNICAL APPROACH

1.0 INTRODUCTION

The overall objective of this project is to provide the engineering services required to produce Corrective Action Plans (CAPs) for the subject UST sites. These reports will conform to the site closure requirements of a CAP-Part A for sites in Georgia. The field investigations necessary to support the report preparation included the installation of temporary piezometers, soil borings, and associated sampling of soil and groundwater. Upon completion of the field investigations, a CAP-Part A will be prepared to meet Georgia Environmental Protection Division (EPD), Fort Stewart, and the USACE-Savannah requirements.

2.0 FIELD ACTIVITIES

The following sections detail the methodologies used for drilling, Powerpunch sampling, and piezometer installation. All boreholes were drilled and piezometers installed by Miller Drilling Company, a drilling firm licensed in the state of Georgia. A geologist from SAIC, either registered or working under the direction of a registered professional, was on site at all times during operations. No drilling activities were undertaken until all utility clearances and permits had been obtained from Fort Stewart's utility personnel.

2.1 Subsurface Soil Sampling

2.1.1 Drilling

The hollow-stem auger drilling method was used during the project for drilling of soil boreholes. The augers used for drilling of boreholes for soil sample collection and groundwater collection using a Powerpunch sampler had a 4.25-inch inside diameter. During all borehole drilling, soil samples were collected continuously on 5.0-foot centers from the ground surface to the bottom of the borehole.

Soil drilling using the hollow-stem auger method was accomplished using truck-mounted CME-55 or similar auger rigs. The total depth of each borehole was dictated by the depth where the water table was encountered.

2.1.2 Sample Collection

Soil samples for chemical analyses were collected from boreholes using 5.0-foot split-barrel samplers. Samples were collected using these samplers as part of hollow-stem auger drilling of the boreholes. Each sampler was inserted into the lead hollow-stem auger and filled as the auger was advanced. Upon retrieval of the sampling device, the soil core was split into two 2.5-foot sections using a stainless steel knife. A portion of each 2.5-foot section was collected for possible laboratory analysis. The remaining portion of each 2.5-foot section was used for field measurements.

Samples designated for possible laboratory analysis were collected from the section using a stainless steel spoon. The spoon was run lengthwise down the core to collect a sample representative of the entire core section. The portion of the sample designated for volatile organic analyses was placed into laboratory sample containers first, followed by placement of the remaining portion of the sample into the containers designated for other types of analyses. Sample containers designated for volatile organic analyses were filled so that minimal headspace was present in the containers. Headspace gas concentration measurements were made using a field organic vapor meter (OVM). Initially, soil from each 2.5-foot interval was placed into a glass jar, leaving some air space, and covered with aluminum foil to create an air-tight seal. The sample was allowed to volatilize for a minimum of 15 minutes. The sealed jar was punctured with the OVM probe and headspace gas drawn until the meter reading was stable. The concentration of the headspace gas was recorded to the nearest 0.1 part per million.

Immediately after collection of each sample and completion of bottle label information, each potential analytical sample container was placed into an ice-filled cooler to ensure preservation. A clean split-barrel sampling device was used to collect soil core from each interval of the project boreholes. Information regarding the criteria for selection of soil samples for off-site shipment to a laboratory for chemical analysis is presented in Section 3.1.3 of the project Work Plan. Soil samples, which were not selected for laboratory analysis, were disposed of as investigation-derived waste.

2.2 Groundwater Sampling

2.2.1 Groundwater Collection

Collection of groundwater samples from soil boreholes advanced during Preliminary Groundwater and CAP-Part A investigations was accomplished using a PowerPunch sampler or from temporary piezometers. The PowerPunch is a probe that allows the collection of a groundwater sample from a discrete undisturbed depth interval in a soil boring. The probe consists of a 1.5-inch outside diameter PVC sample screen that is 5 feet long, a retrievable steel outer casing, and a hardened steel drive point. Temporary piezometers were constructed of 2.5-inch ID PVC casing with a 5-foot screened interval. These piezometers were installed in the open borehole following completion of all drilling activities.

Each soil borehole was advanced to the top of the water table using a 4.25-inch ID HSA. For each borehole, the PowerPunch was inserted into the hollow-stem augers, lowered to the bottom of the borehole, and driven through the undisturbed soil underlying the lead auger to a depth of approximately 3.0 feet below the water table. The outer casing of the PowerPunch was retracted to expose the screen and allow groundwater to enter the chamber. In cases where the PowerPunch could not be driven or where groundwater recovery through the PowerPunch was poor, the groundwater sample was collected through the temporary piezometer.

Groundwater samples were collected using a bailer lowered into the PowerPunch (0.75-inch stainless steel mini bailer) or temporary piezometer (1.0-inch Teflon bailer). The portion of the sample designated for volatile organic analysis was poured into laboratory sample containers first, followed by pouring of the remaining sample portion into containers designated for other types of chemical analyses. Sample containers designated for volatile organic analysis were filled so that no headspace was present in the containers. Samples were poured directly into all containers from the mini or Teflon bailer used for sample retrieval.

2.2.2 Field Measurements

Groundwater field measurements performed during the project included measurement of static groundwater level, pH, specific conductance, and temperature. Measurement of groundwater levels in soil boreholes was accomplished through the installation of temporary PVC piezometers. A summary of the procedures and criteria to be used for groundwater sample field measurements is presented in the following sections.

Static Groundwater Level

Static groundwater level measurements were made using an electronic water level indicator. Initially, the indicator probe was lowered into each temporary piezometer casing until the alarm sounded and/or the indicator light illuminated. The probe was withdrawn several feet and slowly lowered again until the groundwater surface was contacted as noted by the alarm and/or indicator light. Water level measurements were estimated to the nearest 0.01 foot based on the difference between the nearest probe cord mark to the top of the piezometer casing.

The distance between the top of casing and the surrounding ground surface was taken into account in measuring the water level to within 0.01 foot. The static water level measurement procedure was repeated two or three times to ensure that the water level measurements were consistent (plus or minus 0.01 foot). If this was the case, then the first measured level was recorded as the depth to groundwater. If this was not the case, the procedure was repeated until consistent readings were obtained from three consecutive measurements.

pH, Specific Conductance, and Temperature

The pH, specific conductance, and temperature measurements were recorded for groundwater during groundwater sampling. The pH, temperature, and conductivity measurements were made using a combination meter designed to measure these parameters. A portion of each groundwater sample was retrieved from the PowerPunch sampler and poured into the collection cup. With the combination meter set in the pH mode, the meter electrode was swirled at a slow constant rate within the sample until the meter reading reached equilibrium. The sample pH was recorded to the nearest 0.1 pH unit. The pH measurement procedure was repeated, using a new sample each time, until the pH measurements were consistent (less than 0.2 pH units variation).

Upon completion of the pH measurement, conductivity and temperature measurements were made on a groundwater sample collected in the same manner as described above. With the combination meter set in the conductivity mode, the meter electrode was swirled at a slow constant rate within the sample until the meter reading reached equilibrium. Concurrently, a temperature probe was placed into the sample and allowed to reach equilibrium. The sample conductivity was recorded to the nearest 10 mmhos/cm and the temperature to the nearest 0.1° C. All recorded conductivity values were converted to conductance at 25° C. The conductivity and temperature measurement procedure was repeated a minimum of three times using a new sample each time, until the measurements are consistent (less than 10 percent variation for conductance and less than 0.5° C variation for temperatures).

2.3 Temporary Piezometer Installation

Following the collection of the groundwater sample, the borehole was over drilled down to the bottom of the PowerPunch. A 2-inch PVC piezometer, with a 5-foot screened section, was installed in the borehole to prevent the borehole from collapsing. These piezometers remained in the boreholes approximately 24-hours, after which time the static water level was measured.

2.4 Borehole Abandonment

Once the static water level was measured, the temporary piezometers were removed and the boreholes were abandoned. Abandonment was conducted in a manner precluding any current or subsequent fluid media from entering or migrating within the subsurface environment along the axis or from the endpoint of the borehole. Abandonment was accomplished by filling the entire volume of the borehole with grout.

For each borehole located in grass/gravel-covered areas, the borehole was sealed by grouting from the bottom of the borehole to the ground surface. For boreholes located in concrete-covered areas, grout was poured to the interface between the overlying concrete pad and the underlying gravel/soil base. All grouting was accomplished by placing a tremie pipe to the bottom of the borehole and pumping grout through this pipe until undiluted grout was present at the ground surface or the base of the concrete cover. After a 24-hour period, the abandoned borehole was checked for grout settlement. At that time, any settlement depression was filled with grout. Additional grout was added using a tremie pipe. This process was repeated until firm grout remained at the surface.

2.5 Surveying

A topographic survey of the horizontal and vertical locations of all soil boreholes was conducted after completion of all field activities. The topographic survey was conducted by a surveyor registered in the state of Georgia.

The horizontal coordinates for each soil borehole were surveyed to the closest 1.0 foot and referenced to the State Plane Coordinate System. Ground elevations were surveyed to the closest 0.1 foot. Elevations were referenced to the National Geodetic Vertical Datum of 1983.

2.6 Decontamination Procedures

2.6.1 Drilling Equipment

Decontamination of equipment used for the drilling of boreholes was conducted within the temporary decontamination pad constructed at the central staging area. The decontamination pad was constructed so that all decontamination liquids were contained from the surrounding environment and were recovered for disposal as investigation-derived waste (IDW). The entire drill rig and equipment was decontaminated once it arrived on site and the hollow-stem auger drilling equipment was decontaminated after completion of each soil borehole. The drilling equipment was decontaminated by removing the caked soil material from the exterior of equipment using a rod and/or brush, steam cleaning the interior and exterior of equipment, allowing the equipment to air dry as long as possible, and wrapping or covering the equipment in plastic.

2.6.2 Sampling Equipment

Decontamination of equipment used for soil sampling and collection of groundwater samples was conducted at the temporary decontamination area. Nondedicated equipment was decontaminated after each use. The sampling equipment was washed with potable water and phosphate-free detergent using various types of brushes required to remove particulate matter and surface films, followed by a potable water rinse, ASTM Type I or equivalent water rinse, isopropyl alcohol rinse, ASTM Type I or equivalent water rinse, allowed to air dry, and wrapped in plastic or aluminum foil.

In addition to the sampling equipment, field measurement instruments were also decontaminated between uses. Only those portions of each instrument that come into contact with potentially contaminated environmental media were decontaminated. Because of the delicate nature of these instruments, the decontamination procedure only involved initial rinsing of the instrument probes with ASTM Type I or equivalent water.

2.7 Investigation Derived Waste (IDW) Management

Indigenous IDW generated during the project was soil cuttings from boreholes. Nonindigenous generated IDW included solid compactible trash, decontamination solutions, and sludges.

2.7.1 Waste Collection and Containment

All soil and sludge wastes were segregated by borehole and drummed in 55-gallon DOT Specification 17C drums at the point of generation. Drummed wastes were transported to the Central Staging Area (CSA) and stored pending final disposal. Sanitary waste was placed in trash bags at the point of generation. Water derived from decontamination activities was collected in polyethylene tanks and stored at the CSA. All containers were appropriately labeled with generation point information completed on each container.

2.7.2 Waste Characterization

Analytical data gathered from investigation field samples was used to characterize the indigenous soil IDW generated during the project. Where investigation sample analytical data were insufficient for characterization of the wastes, the wastes were sampled and analyzed for RCRA toxicity characteristic contaminants using the Toxicity Characteristic Leaching Procedure (TCLP). Soil from a specific source location was considered noncontaminated if the analytical results for the associated field samples indicated all of the following:

- BTEX and PAH concentrations below applicable Table A or B Threshold Levels as defined in Rules of Georgia Department of Natural Resources, Environmental Protection Division, rule 391-3-15-.09;
- TPH concentrations below 100 ppm; and
- total lead concentrations below 100 ppm.

Soil from a specific source location was considered contaminated nonhazardous if the analytical results for the associated field samples indicated all of the following:

- BTEX and PAH concentrations exceed applicable Table A or B Threshold Levels;
- TPH concentrations exceed 10,000 ppm; and
- total lead concentrations are below 100 ppm.

Soil from a specific source location was considered potentially hazardous, and would be sampled for full TCLP analysis and waste characterization, if one of the following conditions was encountered:

- soil collected from the source location was found to contain free petroleum product or
- total lead concentrations in soil samples collected from the source location exceeded 100 ppm.

Soil/sludge generated from decontamination activities was characterized by collecting one composite sample from each drum of sludge waste. Each composite sample was analyzed for BTEX, PAH, TPH, and total lead. The contents of each drum will be classified based on the analytical results and the categories outlined above.

Decontamination fluid generated from decontamination activities was characterized by collecting one sample from each filled poly tank. Each sample was analyzed for BTEX, pH, oil and grease, and phenols.

2.7.3 Waste Disposal

Soil and soil/sludge waste characterized as being noncontaminated was spread at an area designated by Fort Stewart DPW personnel. Soil and soil/sludge waste characterized as being contaminated nonhazardous or hazardous will be disposed of off-site in accordance with all applicable EPA, DOT, and state of Georgia regulations. Hazardous waste will be transported off-site within 90 days of receipt of characterization data indicating that the waste is hazardous.

Decontamination fluids characterized as meeting the acceptance criteria of the Fort Stewart Industrial Waste Treatment Plant (IWTP) will be transported to and disposed of at the plant. Decontamination fluids exceeding the IWTP waste acceptance criteria will be transferred to 55-gallon DOT Specification 17E closed-top drums and disposed of off-site in accordance with all applicable EPA, DOT, and state of Georgia regulations.

2.8 Documentation of field activities

All information pertinent to drilling and sampling activities, including instrument calibration data, was recorded in field logbooks. The logbooks were bound and the pages consecutively numbered. Entries in the logbooks were made in black permanent ink and included, at a minimum, a description of all activities, individuals involved in drilling and sampling activities, date and time of drilling and sampling, weather conditions, any problems encountered, and all field measurements. Lot numbers, manufacturers name, and expiration dates of standard solutions used for field instrument calibration were also recorded in the field logbooks.

Sufficient information was recorded in the logbooks to permit reconstruction of all drilling and sampling activities. For a detailed description of all field documentation, see section 4.5 of Attachment IV of the Work Plan.

3.0 SAMPLE HANDLING AND ANALYSIS

3.1 Analytical Program

Soil samples were screened for the presence of volatile vapors using a MiniRae organic vapor analyzer (PID). The MiniRae was calibrated daily using 100 parts per million (ppm)

isobutylene. The headspace of each sample was measured approximately 15 minutes after collection.

For sites where the UST had contained waste oil, soil samples were analyzed for BTEX by method SW846- 8020, PAH by method SW846-8270, and TPH by method SW846-9073. Groundwater samples were analyzed for BTEX by method SW 846-8240 and PAH by method SW 846-8270. All samples were sent to General Engineering Laboratories, Charleston, South Carolina.

For sites where the UST had contained gasoline or diesel, soil samples were analyzed for BTEX by method SW 846-8020, PAH by method SW 846-8270, and TPH by method SW 846-8015 (modified). Groundwater samples were analyzed for BTEX by method SW 846-8240 and PAH by method SW 846-8270. TPH analysis included both gasoline range organics (GRO) and diesel range organics (DRO). All samples were sent to General Engineering Laboratories, Charleston, South Carolina.

Duplicate samples of soil and groundwater were collected throughout the project and represented approximately 10 percent of the total sample population. Rinsate blanks were collected to determine whether the sampling equipment was causing cross-contamination of the samples and represented approximately 5 percent of the total sample population. Duplicates and rinsates were submitted to General Engineering Laboratories, Charleston, South Carolina.

Split samples were collected in addition to the other quality control samples but were sent to the USACE QA laboratory in Marietta, Georgia as an independent quality check.

3.2 Sample Containers, Preservation, and Holding Times

The soil sample containers, preservatives, and holding times are summarized in Table B-1. The groundwater sample containers, preservatives, and holding times are summarized in Table B-2.

3.3 Sampling Packaging and Shipment

Each sample container was labeled, taped shut with electrical tape (except those containing samples designated for volatile organic analysis), and a initialed/dated custody seal was placed over the lid. Each sample bottle was placed into a separate plastic bag and sealed. The samples were placed upright in thermally insulated rigid-body coolers and surrounded by vermiculite to prevent breakage during shipment. In addition, samples were cooled to approximately 4° C with wet ice. These measures were taken to slow the decomposition and volatilization of contaminants during shipping and handling. The sample coolers were shipped to the analytical laboratory via courier service provided by the laboratory.

Table B-1. Summary of Sample Containers, Preservation Techniques, and Holding Times for Soil Samples Collected During the Site Investigation

Analyte Group	Container ¹	Minimum Sample Size	Preservative	Holding Time
Benzene, Toluene, Ethylbenzene, Xylene (BTEX)	1 - 4 oz glass jar with Teflon®-lined cap (no headspace)	20 g	Cool, 4°C	14 d
TPH - GRO	use same container as BTEX	20 g	Cool, 4°C	14 d
Polyaromatic Hydrocarbons (PAHs)	1 - 8 oz glass jar with Teflon®-lined cap	90 g	Cool, 4°C	14 d (extraction) 40 d (analysis)
TPH - DRO	use same container as PAHs	90 g	Cool, 4°C	14 d (extraction) 40 d (analysis)
TPH (9073)	use same container as PAHs	90 g	Cool, 4°C	14 d (extraction) 40 d (analysis)
Metals (lead)	use same container as PAHs	20 g	Cool, 4°C	180 d
Waste Samples for TCLP analysis	1 - 16 oz wide mouth glass jar with Teflon®-lined cap	200 g	Cool, 4°C	14 d (extraction)

¹ Container and preservation specifications shall meet all appropriate requirements (See Appendix F to ER 1110-1-263 [31 Mar 95] and in EM200-1-3, Table I-1 [1 Sept 94]).

Table B-2. Summary of Sample Containers, Preservation Techniques, and Holding Times for Groundwater Samples Collected During the Site Investigation

Analyte Group	Container ¹	Minimum Sample Size	Preservative	Holding Time
Benzene, Toluene, Ethylbenzene, Xylene (BTEX)	2 - 40 mL glass vials with Teflon [®] -lined septum (no headspace)	40 mL	Cool, 4°C 0.008 % Na ₂ S ₂ O ₃ pH 4.5	14 d
Polycyclic Aromatic Hydrocarbons (PAHs)	2 - 1L amber glass bottle with Teflon [®] -lined lid ²	1000 mL	Cool, 4°C 0.008 % Na ₂ S ₂ O ₃ pH 4.5	7 d (extraction) 40 d (analysis)
Metals (Lead only)	1 - 250 mL polybottle	100 mL	HNO ₃ to pH <2 Cool, 4°C	180 d

¹ Container and preservation specifications shall meet all appropriate requirements (See Appendix F to ER 1110-1-263 [31 Mar 95] and in EM200-1-3, Table I-1 [1 Sept 94]).

² One investigative water sample in twenty will require an additional 2 liters volume for the laboratory to perform appropriate laboratory QC analysis.

APPENDIX C

ANALYTICAL DATA SHEETS AND QUALITY CONTROL SUMMARY REPORT FOR THE FACILITY ID #9-089088 SITE INVESTIGATION

)

)

)

APPENDIX C-1

ANALYTICAL DATA SHEETS FOR SOIL SAMPLES

)

)

)

Definition of Data Qualifiers (Flags)

During the data validation process, all laboratory data were assigned appropriate data validation flags and flagging codes. Validation flags are defined as follows:

- "U" When the material was analyzed for, but not detected above the level of the associated value.
- "J" When the associated value is an estimated quantity. Indicating there is cause to question accuracy or precision of the reported value.
- "UJ" When the analyte was analyzed for, but not detected, above the associated value, however, the reported value is an estimate and demonstrates an decreased knowledge of its accuracy or precision.
- "R" When the analyte value reported is unusable. The integrity of the analyte's identification, accuracy, precision, or sensitivity have raised significant question as to the reality of the information presented.

SAIC validation flagging codes have been provided on the next page.

DATA VALIDATION FLAGGING CODES

Blanks

- F01 Sample data were qualified as a result of the method blank.
- F02 Sample data were qualified as a result of the field blank.
- F03 Sample data were qualified as a result of the equipment rinse.
- F04 Sample data were qualified as a result of the trip blank.
- F05 Gross contamination exists.
- F06 Concentration of the contaminant was detected at a level below the CRQL.
- F07 Concentration of the contaminant was detected at a level less than the action limit, but greater than the CRQL.
- F08 Concentration of the contaminant was detected at a level that exceeds the action level.
- F09 No laboratory blanks were analyzed.
- F10 Blank had a negative value $> 5 \times$ the IDL.
- F11 Blanks were not analyzed at required frequency.
- F12 Professional judgement was used to qualify the data.

Surrogate Recovery

- G01 Surrogate recovery was above the upper control limit.
- G02 Surrogate recovery was below the lower control limit.
- G03 Surrogate recovery was $< 10\%$.
- G04 Surrogate recovery was zero.
- G05 Surrogate was not present.
- G06 Professional judgement was used to qualify the data.

Matrix Spike/Matrix Spike Duplicate

- H01 MS/MSD recovery was above the upper control limit.
- H02 MS/MSD recovery was below the lower control limit.
- H03 MS/MSD recovery was $< 10\%$.
- H04 MS/MSD pairs exceed the RPD limit.
- H05 No action was taken on MS/MSD results.
- H06 Professional judgement was used to qualify the data.

Matrix Spike

- I01 MS recovery was above the upper control limit.
- I02 MS recovery was below the lower control limit.
- I03 MS recovery was $< 30\%$.
- I04 No action was taken on MS data.
- I05 Professional judgement was used to qualify the data.

Laboratory Duplicate

- J01 Duplicate RPD was outside the control limit.
- J02 Duplicate sample results were $> 5 \times$ the CRDL.
- J03 Duplicate sample results were $< 5 \times$ the CRDL.
- J04 Professional judgement was used to qualify the data.

Internal Area Summary

- K01 Area counts were outside the control limits.
- K02 Extremely low area counts or performance was exhibited by a major drop off.
- K03 IS retention time varied by more than 30 seconds.
- K04 Professional judgement was used to qualify the data.

Laboratory Control Samples (LCSs)

- P01 LCS recovery was above upper control limit.
- P02 LCS recovery was below lower control limit.
- P03 LCS recovery was $< 50\%$.
- P04 No action was taken on the LCS data.
- P05 LCS was not analyzed at required frequency.

Target Compound Identification

- M01 Incorrect identifications were made.
- M02 Qualitative criteria were not met.
- M03 Cross contamination occurred.
- M04 Confirmatory analysis was not performed.
- M05 No results were provided.
- M06 Analysis occurred outside 12 hr GC/MS window.
- M07 Professional judgement was used to qualify the data.
- M08 The %D between the two pesticide/PCB column checks was $> 25\%$.

Initial/Continuing Calibration - Organics

- C01 Initial calibration RRF was < 0.05 .
- C02 Initial calibration RSD was $> 30\%$.
- C03 Initial calibration sequence was not followed as required.
- C04 Continuing calibration RRF was < 0.05 .
- C05 Continuing calibration %D was $> 25\%$.
- C06 Continuing calibration was not performed at the required frequency.
- C07 Resolution criteria were not met.
- C08 RPD criteria were not met.
- C09 RSD criteria were not met.
- C10 Retention time of compounds was outside windows.
- C11 Compounds were not adequately resolved.
- C12 Breakdown of endrin or DDT was $> 20\%$.
- C13 Combined breakdown of endrin/DDT was $> 30\%$.
- C14 Professional judgement was used to qualify the data.



CHAIN OF CUSTODY RECORD

COC NO.: 614024

[illegible]

CHAIN OF CUSTODY RECORD

COC NO.: 640130

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL									
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417									
PROJECT MANAGER: Chris Potter														PHONE NO.: (803) 556-8171									
Sampler (Signature): <i>Shawn Spencer</i>														OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS									
Sampler (Printed Name): Shawn Spencer																							
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	BTEX	PAH, Lead, DRO	PAH	Lead	DRO	PAH, LEAD, TPH	PAH, TPH	PAH, DGC	TPH	No. of Bottles/Vials	OVA SCREENING								
1403A1	9/8/96	1154	SOIL	1						1				2	21.6 ppm								
4501A1	9/8/96	1530	SOIL	1						1				2	0 ppm								
0604D1	9/8/96	1650	SOIL	1							1			2	7.0 ppm								
0604A1	9/8/96	1635	SOIL	1										2	7.7 ppm								
4401B1	9/8/96	1435	SOIL	1						1				2	105.5 ppm								
4401B3	9/8/96	1435	SOIL	1						1				2	105.5 ppm								
4401A3	9/8/96	1435	SOIL	1						1				2	46.3 ppm								
4401A1	9/8/96	1435	SOIL	1						1				2	46.3 ppm								
4502A1	9/8/96	1340	SOIL	1						1				2	0 ppm								
4703E1	9/8/96	1040	SOIL	1							1			2	3.9 ppm								
4703D1	9/8/96	1015	SOIL	1										2	11.3 ppm								
5301D1	9/8/96	0845	SOIL	1							1			2	15.0 ppm								
5301A1	9/8/96	0840	SOIL	1						1				2	24.3 ppm								
RELINQUISHED BY: <i>Shawn Spencer</i>				RECEIVED BY: <i>Blackburn</i>		Date/Time 9/10/96 1545		Date/Time 9/10/96 1545		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		LABORATORY NAME: GEL	
COMPANY NAME: SAIC				COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417	
RECEIVED BY:				RELINQUISHED BY: <i>Blackburn</i>		Date/Time 9/10/96 1545		Date/Time 9/10/96 1545		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		PHONE NO.: (803) 556-8171	
COMPANY NAME:				COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417	
RELINQUISHED BY:				RECEIVED BY: <i>Blackburn</i>		Date/Time 9/10/96 1545		Date/Time 9/10/96 1545		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		PHONE NO.: (803) 556-8171	
COMPANY NAME:				COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		COMPANY NAME: Blackburn		PAH, LEAD, DRO		PAH, TPH		PAH, DGC		TPH		No. of Bottles/Vials		OVA SCREENING		LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417	



۱۔ حق تعالیٰ کے لئے

COC NO.: 614431

CHAIN OF CUSTODY RECORD

PROJECT NAME: Fort Stewart UST Sites				LABORATORY NAME: GEL			
PROJECT NUMBER: 0003				LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417			
PROJECT MANAGER: Chris Potter				PHONE NO: (803) 556-8171			
Sample (Signature) <i>Chris Potter</i>				OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS			
Sample ID	Date Collected	Time Collected	Matrix	OVA SCREENING			
1503B1	9/18/96	1010	SOIL	11.1 ppm			
1503A1	9/18/96	1008	SOIL	23.7 ppm			
1404A1	9/18/96	0846	SOIL	0 ppm			
1404B1	9/18/96	0850	SOIL	0 ppm			
5702D1	9/19/96	1438	SOIL	5.6 ppm			
5702A1	9/19/96	1335	SOIL	0 ppm			
5701A1	9/19/96	1415	SOIL	3.5 ppm			
5701B1	9/19/96	1420	SOIL	5.0 ppm			
5401E3	9/19/96	1440	SOIL	104322 ppm			
SSS 9/18/96							
RECEIVED BY: <i>B. Baker</i>				TOTAL NUMBER OF CONTAINERS: 47			
COMPANY NAME: SAIC				Cooler ID: # 147			
RECEIVED BY: <i>B. Baker</i>				Cooler Temperature:			
COMPANY NAME: SAIC							
RECEIVED BY: <i>B. Baker</i>							
COMPANY NAME: SAIC							
RECEIVED BY: <i>B. Baker</i>							
COMPANY NAME: SAIC							



SAIC An Employee-Owned Company
Science Applications International Corporation

800 Oak Ridge Turnpike, Oak Ridge, TN 37831 (423) 481-4600


Page 1 of 2

CHAIN OF CUSTODY RECORD

COC NO.: 60086

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL					
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417					
PROJECT MANAGER: Chris Potter														PHONE NO: (803) 556-8171					
Sampler (Signature) <i>Sharon Stoller</i>				(Printed Name) Sharon Stoller														OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS	
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	PAH, Lead, DRO	PAH	Lead	DRO	PAH, Lead, TPH	PAH, TPH	PH, DRO	THF	No. of Bottles/Vials	OVA SCREENING					
3401A3	9/20/96	1450	SOIL	1							1		2	0 ppm	9609420-0%				
3401A1	9/20/96	1430	SOIL	1							1		2	0 ppm	9609420-0%				
3401C3	9/20/96	1510	SOIL	1									2	144 ppm	9609420-12%				
3401C1	9/20/96	1510	SOIL	1									2	144 ppm	9609420-12%				
3404D1	9/20/96	1400	SOIL	1									2	0 ppm	9609420-12%				
3404C1	9/20/96	1400	SOIL	1									2	0 ppm	9609420-12%				
1802C1	9/20/96	1630	SOIL	1									2	0 ppm	9609420-12%				
1402D1	9/20/96	1715	SOIL	1									2	0 ppm	9609420-12%				
1402C1	9/20/96	1700	SOIL	1									2	0 ppm	9609420-12%				
1801A1	9/20/96	1431	SOIL	1									2	0 ppm	9609420-12%				
1801B1	9/20/96	1434	SOIL	1									2	0 ppm	9609420-12%				
1802F1	9/20/96	1645	SOIL	1									2	0 ppm	9609420-12%				
3402C1	9/20/96	0920	SOIL	1									2	0 ppm	9609420-12%				
RELINQUISHED BY: <i>Sharon Stoller</i>				Date/Time 9/21/96	RECEIVED BY: <i>J. G. Genderson</i>		Date/Time 9/21/96		TOTAL NUMBER OF CONTAINERS: Cooler ID: #133										
COMPANY NAME: SAIC				12/5	COMPANY NAME: GEL				Cooler Temperature: 11°										
RECEIVED BY: <i>J. G. Genderson</i>				Date/Time 9/21/96	RELINQUISHED BY: <i>J. G. Genderson</i>		Date/Time 9/21/96												
COMPANY NAME: SAIC				11/9/96	COMPANY NAME: GEL		Date/Time 09-21-96												
RELINQUISHED BY:				Date/Time	RECEIVED BY: <i>J. G. Genderson</i>		Date/Time												
COMPANY NAME:					COMPANY NAME: <i>J. G. Genderson</i>		Date/Time												

0011



COC NO.: GZØ916

CHAIN OF CUSTODY RECORD

PROJECT NAME: Fort Stewart UST Sites				LABORATORY NAME: GEL			
PROJECT NUMBER: 0003				LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417			
PROJECT MANAGER: Chris Potter				PHONE NO: (803) 556-8171			
RELINQUISHED BY: <i>[Signature]</i>		RECEIVED BY: <i>[Signature]</i>		TOTAL NUMBER OF CONTAINERS: 32		Cooler Temperature: 7 Temp 6	
COMPANY NAME: SAFL		COMPANY NAME: GEL		Cooler ID: #52			
RECEIVED BY:		RECEIVED BY:		Cooler ID: #52			
COMPANY NAME:		COMPANY NAME:		Cooler ID: #52			
RELINQUISHED BY:		RECEIVED BY:		Cooler ID: #52			
COMPANY NAME:		COMPANY NAME:		Cooler ID: #52			

CHAIN OF CUSTODY RECORD

[illegible]



800 Oak Ridge Turnpike, Oak Ridge, TN 37831 (423) 481-4800

FAC An Employee-Owned Company
FAC International Corporation

CHAIN OF CUSTODY RECORD

COC NO.: 60119

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL	
PROJECT NUMBER: 0003				No. of Bottles/Vials: SVOC VOC TPH PAH, DRO PAH, TPH PAH, LEAD, TPH DRO Lead PAH PAH, Lead, DRO BTEX BTEX, GRO										LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417	
PROJECT MANAGER: Chris Potter				OVA SCREENING										PHONE NO: (803) 556-8171	
Sampler (Signature) <i>Sharon Souler</i>				OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS 9612332-12 9612332-02 different analysis than usual 9612332-02 9612332-03 9612332-01 9612332-06											
Date Collected				Time Collected				Matrix							
12/14/96				0905				WATER							
12/14/96				1015				WATER							
12/15/96				1420				SOIL							
12/15/96				1435				SOIL							
12/15/96				1520				SOIL							
12/15/96				1530				SOIL							
12/15/96				1545				SOIL							
545 12/16/96															
RELINQUISHED BY: <i>SAIC</i>				Date/Time 12/16/96				RECEIVED BY:				TOTAL NUMBER OF CONTAINERS: 17			
COMPANY NAME: SAIC				1330				COMPANY NAME:				Cooler ID: #20			
RELINQUISHED BY: <i>SAIC</i>				Date/Time 12/16/96				RELINQUISHED BY:				Cooler Temperature: 40			
COMPANY NAME: GEL				1330				COMPANY NAME:							
RELINQUISHED BY: <i>SAIC</i>				Date/Time 12/16/96				RECEIVED BY: <i>SAIC</i>							
COMPANY NAME: GEL				1600				COMPANY NAME: SAIC							

CHAIN OF CUSTODY RECORD

COC NO.: G0129

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL		
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417		
PROJECT MANAGER: Chris Potter														PHONE NO: (803) 556-8171		
Sampler (Signature) <i>Shirley S. Satter</i>				(Printed Name) SHARON SATTER												
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	BTEX	PAH, Lead, DRO	PAH	Lead	DRO	PAH, Lead, TPH	PAH, TPH	PAH, DRO	TPH	No. of Bottles/Vials	OVA SCREENING	OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS
2705C1	12/16/96	1350	SOIL	1							1			2	Ø ppm	96123378-01
2705B1	12/16/96	1340		1	1									2	1.1 ppm	96123378-02
3203D1	12/16/96	1015			1									2	1.6 ppm	96123378-03
3203B1	12/16/96	1000			1									2	1.1 ppm	96123378-03
1406B1	12/15/96	1705			1									2	5.8 ppm	96123378-06
1406A1	12/15/96	1705			1									2	133.3 ppm	96123378-04
2705W2	12/16/96	1410	WATER	2										2	Ø ppm	96123372-09
4003W2	12/16/96	0930		2										2	30.5 ppm	96123372-10
4003W4	12/16/96	0930		2										2	30.5 ppm	96123372-11
4005W2	12/16/96	1000		2										2	Ø ppm	96123372-12
2705RS	12/16/96	1335		2										2	N/A	96123372-17
3203W2	12/16/96	1100		2										2	Ø ppm	96123372-13
2605W2	12/16/96	1215		2										2	Ø ppm	96123372-14
RELINQUISHED BY: <i>[Signature]</i>				Date/Time 12/17/96	RECEIVED BY:				Date/Time	TOTAL NUMBER OF CONTAINERS: Cooler ID: #18				Cooler Temperature: 50		
COMPANY NAME: SAIC				1130	COMPANY NAME:											
RECEIVED BY: <i>[Signature]</i>				Date/Time 12/17/96	RELINQUISHED BY:				Date/Time							
COMPANY NAME: GEL				1130	COMPANY NAME:											
RELINQUISHED BY: <i>[Signature]</i>				Date/Time 12/17/96	RECEIVED BY: <i>[Signature]</i>				Date/Time 12-17-96							
COMPANY NAME: <i>[Signature]</i>				1545	COMPANY NAME: <i>[Signature]</i>				1545							

5.7.8.9.10.11.12.13.14.15.16.17.18.19.20.21.22.23.24.25.26.27.28.29.30.31.32.33.34.35.36.37.38.39.40.41.42.43.44.45.46.47.48.49.50.51.52.53.54.55.56.57.58.59.60.61.62.63.64.65.66.67.68.69.70.71.72.73.74.75.76.77.78.79.80.81.82.83.84.85.86.87.88.89.90.91.92.93.94.95.96.97.98.99.100.

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401B1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69430S

Matrix: (soil/water) SOIL Lab Sample ID: 9609430-15

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2C422

% Moisture: 12 decanted: (Y/N) N Date Received: 09/23/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 10/03/96

Injection Volume: (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

71-43-2-----Benzene	5.7	U	U
108-88-3-----Toluene	27	X	=
100-41-4-----Ethylbenzene	5.7	U	U
1330-20-7-----Xylenes (total)	5.7	U	U

sub
12/30/98

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401B1RA0

Lab Name: GENERAL ENGINEERING LABOR Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69430S

Matrix: (soil/water) SOIL Lab Sample ID: 9609430-15

Sample wt/vol: 30.0 (g/mL) g Lab File ID: 20206

Level: (low/med) LOW Date Received: 09/23/96

% Moisture: 12 decanted: (Y/N) N Date Extracted: 10/04/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 10/08/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg


CAS NO.

COMPOUND

Q

91-20-3-----	naphthalene	379	U	U ↓ USC ↓
91-58-7-----	2-chloronaphthalene	379	U	
209-96-8-----	acenaphthylene	379	U	
83-32-9-----	acenaphthene	379	U	
86-73-7-----	fluorene	379	U	
85-01-8-----	phenanthrene	379	U	
120-12-7-----	anthracene	379	U	
206-44-0-----	fluoranthene	379	U	
129-00-0-----	pyrene	379	U	
56-55-3-----	benzo(a)anthracene	379	U	
218-01-9-----	chrysene	379	U	
205-99-2-----	benzo(b)fluoranthene	379	U	
207-08-9-----	benzo(k)fluoranthene	379	U	
50-32-8-----	benzo(a)pyrene	379	U	
193-39-5-----	indeno(1,2,3-cd)pyrene	379	U	
53-70-3-----	dibenz(a,h)anthracene	379	U	
191-24-2-----	benzo(g,h,i)perylene	379	U	

USC

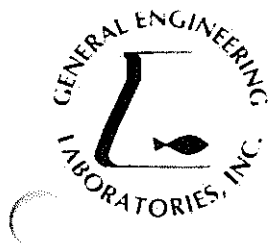

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow.

Laboratory Certifications

STATE	GEL	EPI
FL	E87156/87294	E87472/87458
NC	233	
SC	10120	10582
TN	02934	02934

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Contact: Mr. Nile Luedtke

Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: October 25, 1996

Page 1 of 2

Sample ID : 1401B1
Lab ID : 9609430-15
Matrix : Soil
Date Collected : 09/21/96
Date Received : 09/23/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		12.0	1.00	1.00	wt%	1.0	JDB	10/03/96	1545	91526	1
General Chemistry											
Total Rec. Petro. Hydrocarbons B		75.9	7.71	11.4	mg/kg	1.0	EAN	09/27/96	1600	91265	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

P O Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29414

(803) 556-8171 • Fax (803) 766-1178



Printed on recycled paper



9609430-15

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401H1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69460S

Matrix: (soil/water) SOIL Lab Sample ID: 9609460-14

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1C422

% Moisture: 21 decanted: (Y/N) N Date Received: 09/24/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (mL) Date Analyzed: 10/03/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

71-43-2-----Benzene	6.3	U	U
108-88-3-----Toluene	7.5		=
100-41-4-----Ethylbenzene	6.3	U	U
1330-20-7-----Xylenes (total)	6.3	U	U

7051

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401H1

Lab Name: GENERAL ENGINEERING LABS. Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69460S

Matrix: (soil/water) SOIL Lab Sample ID: 9609460-14

Sample wt/vol: 30.2 (g/mL) g Lab File ID: 80204

Level: (low/med) LOW Date Received: 09/24/96

% Moisture: 21 decanted: (Y/N) N Date Extracted: 10/04/96


Concentrated Extract Volume: 1 (mL) Date Analyzed: 10/08/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3	naphthalene	418	U
91-58-7	2-chloronaphthalene	418	U
209-96-8	acenaphthylene	418	U
83-32-9	acenaphthene	418	U
86-73-7	fluorene	418	U
85-01-8	phenanthrene	418	U
120-12-7	anthracene	418	U
206-44-0	fluoranthene	418	U
129-00-0	pyrene	418	U
56-55-3	benzo (a) anthracene	418	U
218-01-9	chrysene	418	U
205-99-2	benzo (b) fluoranthene	418	U
207-08-9	benzo (k) fluoranthene	418	U
50-32-8	benzo (a) pyrene	418	U
193-39-5	indeno (1,2,3-cd) pyrene	418	U
53-70-3	dibenz (a,h) anthracene	418	U
191-24-2	benzo (g,h,i) perylene	418	U

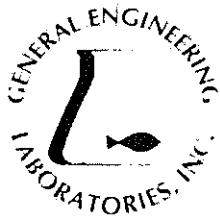

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Contact: Mr. Nile Luedtke

Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: November 03, 1996

Page 1 of 2

Sample ID : 1401H1
Lab ID : 9609460-14
Matrix : Soil
Date Collected : 09/21/96
Date Received : 09/24/96
Priority : Routine
Collector : Client

VALIDATION
QUAL

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		21.0	1.00	1.00	wt%	1.0	JDB	10/02/96	1615	91527	1
General Chemistry											
Total Rec. Petro. Hydrocarbons	B	12.8	UF21, F07	8.59	12.7 mg/kg	1.0	EAN	09/27/96	1600	91265	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:
The qualifiers in this report are defined as follows:
ND indicates that the analyte was not detected at a concentration greater than the detection limit.
J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).
U indicates that the analyte was not detected at a concentration greater than the detection limit.
* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

P O Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29414

(803) 556-8171 • Fax (803) 766-1178

Printed on recycled paper



9609460-14

0247

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402C1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69426S

Matrix: (soil/water) SOIL Lab Sample ID: 9609426-07

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1C36

% Moisture: 12 decanted: (Y/N) N Date Received: 09/21/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (mL) Date Analyzed: 10/02/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

71-43-2-----Benzene	5.7	U
108-88-3-----Toluene	7.1	P
100-41-4-----Ethylbenzene	5.7	U
1330-20-7-----Xylenes (total)	5.7	U

u
5, mfg
u
u

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402C1

Lab Name: GENERAL ENGINEERING LABOR Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69426S

Matrix: (soil/water) SOIL Lab Sample ID: 9609426-07

Sample wt/vol: 30.8 (g/mL) g Lab File ID: 8M414

Level: (low/med) LOW Date Received: 09/21/96

% Moisture: 12 decanted: (Y/N) N Date Extracted: 09/30/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 10/04/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0


GPC Cleanup: (Y/N) N pH: 7.0

CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg

CAS NO. COMPOUND Q

91-20-3-----	naphthalene	370	U
91-58-7-----	2-chloronaphthalene	370	U
209-96-8-----	acenaphthylene	370	U
83-32-9-----	acenaphthene	370	U
86-73-7-----	fluorene	370	U
85-01-8-----	phenanthrene	370	U
120-12-7-----	anthracene	370	U
206-44-0-----	fluoranthene	370	U
129-00-0-----	pyrene	370	U
56-55-3-----	benzo (a) anthracene	370	U
218-01-9-----	chrysene	370	U
205-99-2-----	benzo (b) fluoranthene	370	U
207-08-9-----	benzo (k) fluoranthene	370	U
50-32-8-----	benzo (a) pyrene	370	U
193-39-5-----	indeno (1,2,3-cd) pyrene	370	U
53-70-3-----	dibenz (a,h) anthracene	370	U
191-24-2-----	benzo (g,h,i) perylene	370	U

u
↓

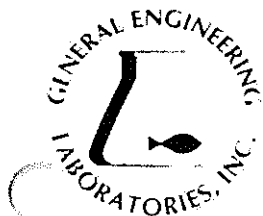

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831
Contact: Mr. Nile Luedtke
Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: November 03, 1996

Page 1 of 2

Sample ID : 1402C1
Lab ID : 9609426-07
Matrix : Soil
Date Collected : 09/20/96
Date Received : 09/21/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		12.0	1.00	1.00	wt%	1.0	JDB	10/02/96	1550	91524	1
General Chemistry											
Total Rec. Petro. Hydrocarbons B		96.6 mg/kg =	FDS 7.71	11.4	mg/kg	1.0	EAN	09/26/96	1300	91171	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

P O Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29414

(803) 556-8171 • Fax (803) 766-1178



Printed on recycled paper



9609426-07

0205

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402D1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69427S

Matrix: (soil/water) SOIL Lab Sample ID: 9609427-02

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1C45

% Moisture: 27 decanted: (Y/N) N Date Received: 09/21/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 10/03/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

71-43-2-----Benzene	6.8	U
108-88-3-----Toluene	6.8	U
100-41-4-----Ethylbenzene	6.8	U
1330-20-7-----Xylenes (total)	6.8	U

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402D1

Lab Name: GENERAL ENGINEERING LABOR Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69427S

Matrix: (soil/water) SOIL Lab Sample ID: 9609427-02

Sample wt/vol: 30.8 (g/mL) g Lab File ID: 1N409

Level: (low/med) LOW Date Received: 09/21/96

% Moisture: 27 decanted: (Y/N) N Date Extracted: 10/03/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 10/04/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	445	U
91-58-7-----	2-chloronaphthalene	445	U
209-96-8-----	acenaphthylene	445	U
83-32-9-----	acenaphthene	445	U
86-73-7-----	fluorene	445	U
85-01-8-----	phenanthrene	445	U
120-12-7-----	anthracene	445	U
206-44-0-----	fluoranthene	445	U
129-00-0-----	pyrene	445	U
56-55-3-----	benzo (a) anthracene	445	U
218-01-9-----	chrysene	445	U
205-99-2-----	benzo (b) fluoranthene	445	U
207-08-9-----	benzo (k) fluoranthene	445	U
50-32-8-----	benzo (a) pyrene	445	U
193-39-5-----	indeno (1,2,3-cd) pyrene	445	U
53-70-3-----	dibenz (a,h) anthracene	445	U
191-24-2-----	benzo (g,h,i) perylene	445	U



GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow

Laboratory Certifications

STATE	GEL	EPI
FL	E87156/87294	E87472/87458
NC	233	
SC	10120	10582
TN	02934	02934

Client: Science Applications International Corp.

P.O. Box 2502

800 Oak Ridge Turnpike

Oak Ridge, Tennessee 37831

Contact: Mr. Nile Luedtke

Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: October 25, 1996

Page 1 of 2

Sample ID : 1402D1
Lab ID : 9609427-02
Matrix : Soil
Date Collected : 09/20/96
Date Received : 09/21/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		27.0	1.00	1.00	wt%	1.0	JDB	10/02/96	1550	91524	1
General Chemistry											
Total Rec. Petro. Hydrocarbons	B	24.9	9.26	13.7	mg/kg	1.0	EAN	09/26/96	1300	91171	2

M = Method

Method-Description

M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

255

P O Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29414

(803) 556-8171 • Fax (803) 766-1178



Printed on recycled paper



9609427-02

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403A1

b Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 96179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-12

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2Z417

% Moisture: 9 decanted: (Y/N) N Date Received: 09/10/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: _____ (uL) Date Analyzed: 09/12/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	30.4		
108-88-3-----Toluene	12.7	P	↓
100-41-4-----Ethylbenzene	132	P	↓
1330-20-7-----Xylenes (total)	309	P	↓

J GAI, KAI
↓ ↓ ↓ ↓

DATA VALIDATION
COPY

USE

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403A1

Lab Name: Contract: Lab Code: Case No.: SAS No.: SDG No.: 69179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-12

Sample wt/vol: 30.7 (g/mL) g Lab File ID: 1L419

Level: (low/med) LOW Date Received: 09/10/96

% Moisture: 9 decanted: (Y/N) N Date Extracted: 09/17/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 09/19/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	775	
91-58-7-----	2-chloronaphthalene	358	U
209-96-8-----	acenaphthylene	358	U
83-32-9-----	acenaphthene	358	U
86-73-7-----	fluorene	358	U
85-01-8-----	phenanthrene	358	U
120-12-7-----	anthracene	358	U
206-44-0-----	fluoranthene	358	U
129-00-0-----	pyrene	358	U
56-55-3-----	benzo(a)anthracene	358	U
218-01-9-----	chrysene	358	U
205-99-2-----	benzo(b)fluoranthene	358	U
207-08-9-----	benzo(k)fluoranthene	358	U
50-32-8-----	benzo(a)pyrene	358	U
193-39-5-----	indeno(1,2,3-cd)pyrene	358	U
53-70-3-----	dibenz(a,h)anthracene	358	U
191-24-2-----	benzo(g,h,i)perylene	358	U

11
u
↓

Client: Science Applications International Corporation
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Date: 10/19/96

Contact: Mr. Chris Potter
ProjectDescription: Ft. Stewart UST Sites

Client Code: SAIC00396

Project Manager: Linda Darrington

Page: 1

Sample I.D.: 1403A1
Lab I.D.: 9609179-12
Sample Matrix: Soil
Date Collected: 09/08/96
Date Received: 09/10/96
Priority: Routine
Collected by: Client

Parameter

Analyte:	Qualifier	Result	Units	Method	Analyst	DateTime
Total Rec. Petro.Hydrocarbons	B	28.9	mg/kg	EPA 418.1 Mod.	EAN	09/12/961400
Evaporative Loss	UF, FOT	9	%			

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403B1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 96179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-02

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2Z47

% Moisture: 16 decanted: (Y/N) N Date Received: 09/10/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: _____ (uL) Date Analyzed: 09/12/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	11.6	
108-88-3-----Toluene	6.0	U
100-41-4-----Ethylbenzene	14.3	P
1330-20-7-----Xylenes (total)	47.9	

=
U
J, M & E
=

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403B1

b Name: Contract: Lab Code: Case No.: SAS No.: SDG No.: 69179S
Matrix: (soil/water) SOIL Lab Sample ID: 9609179-02
Sample wt/vol: 30.9 (g/mL) g Lab File ID: 1L409
Level: (low/med) LOW Date Received: 09/10/96
% Moisture: 16 decanted: (Y/N) N Date Extracted: 09/17/96
Concentrated Extract Volume: 1 (mL) Date Analyzed: 09/19/96
Injection Volume: 1.0 (uL) Dilution Factor: 1.0
GPC Cleanup: (Y/N) N pH: 7.0

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg		Q
91-20-3	naphthalene	385	U	U ↓
91-58-7	2-chloronaphthalene	385	U	
209-96-8	acenaphthylene	385	U	
83-32-9	acenaphthene	385	U	
86-73-7	fluorene	385	U	
85-01-8	phenanthrene	385	U	
120-12-7	anthracene	385	U	
206-44-0	fluoranthene	385	U	
129-00-0	pyrene	385	U	
56-55-3	benzo (a) anthracene	385	U	
218-01-9	chrysene	385	U	
205-99-2	benzo (b) fluoranthene	385	U	
207-08-9	benzo (k) fluoranthene	385	U	
50-32-8	benzo (a) pyrene	385	U	
193-39-5	indeno (1,2,3-cd) pyrene	385	U	
53-70-3	dibenz (a,h) anthracene	385	U	
191-24-2	benzo (g,h,i) perylene	385	U	

Client: Science Applications International Corporation
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Date: 10/19/96

Contact: Mr. Chris Potter
ProjectDescription: Ft. Stewart UST Sites

Client Code: SAIC00396

Project Manager: Linda Darrington

Page: 1

Sample I.D.: 1403B1
Lab I.D.: 9609179-02
Sample Matrix: Soil
Date Collected: 09/08/96
Date Received: 09/10/96
Priority: Routine
Collected by: Client

Parameter

Analyte:	Qualifier	Result	Units	Method	Analyst	DateTime
Total Rec. Petro.Hydrocarbons	JB	UF 01 FO 6 9.7	mg/kg	EPA 418.1 Mod.	EAN	09/12/961400
Evaporative Loss		16	%			

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404A1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 96179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-08

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2Z413

% Moisture: 11 decanted: (Y/N) N Date Received: 09/10/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: _____ (uL) Date Analyzed: 09/12/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	5.6	U	u = 5 3
108-88-3-----Toluene	6.2		
100-41-4-----Ethylbenzene	5.6	U	
1330-20-7-----Xylenes (total)	5.6	U	

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404A1

Lab Name: Contract: Lab Code: Case No.: SAS No.: SDG No.: 69179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-08

Sample wt/vol: 31.0 (g/mL) g Lab File ID: 1L415

Level: (low/med) LOW Date Received: 09/10/96

% Moisture: 11 decanted: (Y/N) N Date Extracted: 09/17/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 09/19/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	363	U
91-58-7-----	2-chloronaphthalene	363	U
209-96-8-----	acenaphthylene	363	U
83-32-9-----	acenaphthene	363	U
86-73-7-----	fluorene	363	U
85-01-8-----	phenanthrene	363	U
120-12-7-----	anthracene	363	U
206-44-0-----	fluoranthene	363	U
129-00-0-----	pyrene	363	U
56-55-3-----	benzo(a)anthracene	363	U
218-01-9-----	chrysene	363	U
205-99-2-----	benzo(b)fluoranthene	363	U
207-08-9-----	benzo(k)fluoranthene	363	U
50-32-8-----	benzo(a)pyrene	363	U
193-39-5-----	indeno(1,2,3-cd)pyrene	363	U
53-70-3-----	dibenz(a,h)anthracene	363	U
191-24-2-----	benzo(g,h,i)perylene	363	U

Client: Science Applications International Corporation
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Date: 10/19/96

Contact: Mr. Chris Potter
ProjectDescription: Ft. Stewart UST Sites

Client Code: SAIC00396

Project Manager: Linda Darrington

Page: 1

Sample I.D.:	1404A1
Lab I.D.:	9609179-08
Sample Matrix:	Soil
Date Collected:	09/08/96
Date Received:	09/10/96
Priority:	Routine
Collected by:	Client

Analyte:	Qualifier	Result	Units	Method	Analyst	DateTime
Total Rec. Petro.Hydrocarbons	B	UF01, F07 27.0	mg/kg	EPA 418.1 Mod.	EAN	09/12/961400
Evaporative Loss		11	%			

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404B1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 96179S

Matrix: (soil/water) SOIL Lab Sample ID: 9609179-18

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2Z423

% Moisture: 9 decanted: (Y/N) N Date Received: 09/10/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: _____ (uL) Date Analyzed: 09/13/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----	Benzene	5.5	U
108-88-3-----	Toluene	8.5	U
100-41-4-----	Ethylbenzene	5.5	U
1330-20-7-----	Xylenes (total)	5.5	U

u = u u

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404B1

Lab Name: Contract: Lab Code: Case No.: SAS No.: SDG No.: 69179S
Matrix: (soil/water) SOIL Lab Sample ID: 9609179-18
Sample wt/vol: 30.8 (g/mL) g Lab File ID: 1L457
Level: (low/med) LOW Date Received: 09/10/96
% Moisture: 9 decanted: (Y/N) N Date Extracted: 09/17/96
Concentrated Extract Volume: 1 (mL) Date Analyzed: 09/20/96
Injection Volume: 1.0 (uL) Dilution Factor: 1.0
GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	357	U
91-58-7-----	2-chloronaphthalene	357	U
209-96-8-----	acenaphthylene	357	U
83-32-9-----	acenaphthene	357	U
86-73-7-----	fluorene	357	U
85-01-8-----	phenanthrene	357	U
120-12-7-----	anthracene	357	U
206-44-0-----	fluoranthene	357	U
129-00-0-----	pyrene	357	U
56-55-3-----	benzo (a) anthracene	357	U
218-01-9-----	chrysene	357	U
205-99-2-----	benzo (b) fluoranthene	357	U
207-08-9-----	benzo (k) fluoranthene	357	U
50-32-8-----	benzo (a) pyrene	357	U
193-39-5-----	indeno (1,2,3-cd) pyrene	357	U
53-70-3-----	dibenz (a,h) anthracene	357	U
191-24-2-----	benzo (g,h,i) perylene	357	U

Client: Science Applications International Corporation
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Date: 10/19/96

Contact: Mr. Chris Potter
ProjectDescription: Ft. Stewart UST Sites

Client Code: SAIC00396

Project Manager: Linda Darrington

Page: 1

Sample I.D.: 1404B1
Lab I.D.: 9609179-18
Sample Matrix: Soil
Date Collected: 09/08/96
Date Received: 09/10/96
Priority: Routine
Collected by: Client

Parameter

Analyte:	Qualifier	Result	Units	Method	Analyst	DateTime
Total Rec. Petro.Hydrocarbons	JB U F01, F06	7.83	mg/kg	EPA 418.1 Mod.	SDW	09/16/961100
Evaporative Loss		9	%			

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405A1

Lab Name: GENERAL ENGINEERING LABOR Contract: N/A

Lab Code: N/A Case No.: N/A SAS No.: N/A SDG No.: 6C339S

Matrix: (soil/water) SOIL Lab Sample ID: 9612339-06

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1N425

% Moisture: 8 decanted: (Y/N) N Date Received: 12/16/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 12/19/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	5.4	U	
108-88-3-----Toluene	6.3		
100-41-4-----Ethylbenzene	13.8		
1330-20-7-----Xylenes (total)	13.9	P	

U
=
J M08

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405A1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C339S

Matrix: (soil/water) SOIL Lab Sample ID: 9612339-06

Sample wt/vol: 30.3 (g/mL) g Lab File ID: 2A517

Level: (low/med) LOW Date Received: 12/16/96

% Moisture: 8 decanted: (Y/N) N Date Extracted: 12/18/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 01/03/97


Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	182	J
91-58-7-----	2-chloronaphthalene	359	U
209-96-8-----	acenaphthylene	359	U
83-32-9-----	acenaphthene	359	U
86-73-7-----	fluorene	359	U
85-01-8-----	phenanthrene	359	U
120-12-7-----	anthracene	359	U
206-44-0-----	fluoranthene	359	U
129-00-0-----	pyrene	359	U
56-55-3-----	benzo (a) anthracene	359	U
218-01-9-----	chrysene	359	U
205-99-2-----	benzo (b) fluoranthene	359	U
207-08-9-----	benzo (k) fluoranthene	359	U
50-32-8-----	benzo (a) pyrene	359	U
193-39-5-----	indeno (1,2,3-cd) pyrene	359	U
53-70-3-----	dibenz (a,h) anthracene	359	U
191-24-2-----	benzo (g,h,i) perylene	359	U

DATA VALIDATION
COPY

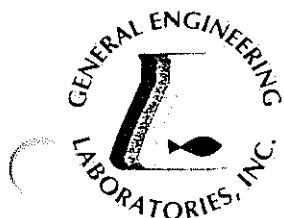

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow.

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831
Contact: Mr. Nile Luedtke
Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: January 07, 1997

Page 1 of 2

Sample ID : 1405A1
Lab ID : 9612339-06
Matrix : Soil
Date Collected : 12/15/96
Date Received : 12/16/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		8.00	1.00	1.00	wt%	1.0	CEC	12/16/96	2200	95137	1
General Chemistry											
Total Rec. Petro. Hydrocarbons		69.1 = F28	14.7	21.8	mg/kg	2.0	TSM	01/06/97	1545	95779	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

DATA VALIDATION
COPY

171

PO Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29407

(803) 556-8171 • Fax (803) 766-1178



9612339-06

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405F1

Lab Name: GENERAL ENGINEERING LABOR Contract: N/A

Lab Code: N/A Case No.: N/A SAS No.: N/A SDG No.: 6C338S

Matrix: (soil/water) SOIL Lab Sample ID: 9612338-01

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B2N33

% Moisture: 21 decanted: (Y/N) N Date Received: 12/16/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 12/18/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	6.3	U
108-88-3-----Toluene	6.3	U
100-41-4-----Ethylbenzene	6.3	U
1330-20-7-----Xylenes (total)	6.3	U


1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405F1

Lab Name: GENERAL ENGINEERING LABS. Contract: NA
 Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C338S
 Matrix: (soil/water) SOIL Lab Sample ID: 9612338-01
 Sample wt/vol: 30.8 (g/mL) g Lab File ID: 6A407
 Level: (low/med) LOW Date Received: 12/16/96
 % Moisture: 21 decanted: (Y/N) N Date Extracted: 12/18/96
 Concentrated Extract Volume: 1 (mL) Date Analyzed: 01/02/97
 Injection Volume: 1.0 (uL) Dilution Factor: 1.0
 GPC Cleanup: (Y/N) N pH: 7.0

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg		Q
91-20-3	naphthalene	411	U	U ↓
91-58-7	2-chloronaphthalene	411	U	
208-96-8	acenaphthylene	411	U	
83-32-9	acenaphthene	411	U	
86-73-7	fluorene	411	U	
85-01-8	phenanthrene	411	U	
120-12-7	anthracene	411	U	
206-44-0	fluoranthene	411	U	
129-00-0	pyrene	411	U	
56-55-3	benzo (a) anthracene	411	U	
218-01-9	chrysene	411	U	
205-99-2	benzo (b) fluoranthene	411	U	
207-08-9	benzo (k) fluoranthene	411	U	
50-32-8	benzo (a) pyrene	411	U	
193-39-5	indeno (1,2,3-cd) pyrene	411	U	
53-70-3	dibenz (a,h) anthracene	411	U	
191-24-2	benzo (g,h,i) perylene	411	U	

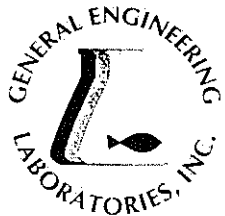

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow.

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Contact: Mr. Nile Luedtke

Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: January 14, 1997

Page 1 of 2

Sample ID : 1405F1
Lab ID : 9612338-01
Matrix : Soil
Date Collected : 12/15/96
Date Received : 12/16/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		21.0	1.00	1.00	wt%	1.0	CEC	12/16/96	2030	95110	1
General Chemistry											
Total Rec. Petro. Hydrocarbons		275 = F28	85.9	127	mg/kg	10.	TSM	01/06/97	1153	95749	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

DATA VALIDATION
COPY

PO Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29407

(803) 556-8171 • Fax (803) 766-1178



9612338-01

180

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406A1

b Name: GENERAL ENGINEERING LABOR Contract: N/A

Lab Code: N/A Case No.: N/A SAS No.: N/A SDG No.: 6C378S

Matrix: (soil/water) SOIL Lab Sample ID: 9612378-04

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1N426

% Moisture: 10 decanted: (Y/N) N Date Received: 12/17/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 12/19/96

Injection Volume: (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	5.9	P	
108-88-3-----Toluene	8.8	P	
100-41-4-----Ethylbenzene	155	P	
1330-20-7-----Xylenes (total)	35.5	P	

J GDI, MZ
↓ ↓, MZ

USE

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406A1

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C378S

Matrix: (soil/water) SOIL Lab Sample ID: 9612378-04

Sample wt/vol: 30.6 (g/mL) g Lab File ID: 6Z417

Level: (low/med) LOW Date Received: 12/17/96

% Moisture: 10 decanted: (Y/N) N Date Extracted: 12/19/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 12/26/96


Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg Q

91-20-3-----	naphthalene	398	
91-58-7-----	2-chloronaphthalene	364	U
208-96-8-----	acenaphthylene	364	U
83-32-9-----	acenaphthene	364	U
86-73-7-----	fluorene	364	U
85-01-8-----	phenanthrene	364	U
120-12-7-----	anthracene	364	U
206-44-0-----	fluoranthene	364	U
129-00-0-----	pyrene	364	U
56-55-3-----	benzo (a) anthracene	364	U
218-01-9-----	chrysene	364	U
205-99-2-----	benzo (b) fluoranthene	364	U
207-08-9-----	benzo (k) fluoranthene	364	U
50-32-8-----	benzo (a) pyrene	364	U
193-39-5-----	indeno (1,2,3-cd) pyrene	364	U
53-70-3-----	dibenz (a,h) anthracene	364	U
191-24-2-----	benzo (g,h,i) perylene	364	U

DATA VALIDATION
COPY

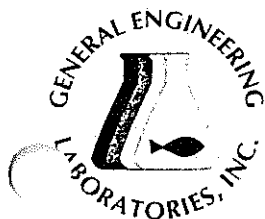

GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow.

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831
Contact: Mr. Nile Luedtke
Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: January 07, 1997

Page 1 of 2

Sample ID : 1406A1
Lab ID : 9612378-04
Matrix : Soil
Date Collected : 12/15/96
Date Received : 12/17/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		10.0	1.00	1.00	wt%	1.0	CEC	12/17/96	1900	95222	1
General Chemistry											
Total Rec. Petro. Hydrocarbons		637 = F08	75.0	111	mg/kg	10.	TSM	01/06/97	1640	95779	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.


* indicates that a quality control analyte recovery is outside of specified acceptance criteria.

Data reported in mass/mass units is reported as 'dry weight'.

DATA VALIDATION
COPY 211

PO Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29407

(803) 556-8171 • Fax (803) 766-1178

 Printed on recycled paper.



9612378-04

1D
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406B1

Lab Name: GENERAL ENGINEERING LABOR Contract: N/A

Lab Code: N/A Case No.: N/A SAS No.: N/A SDG No.: 6C378S

Matrix: (soil/water) SOIL Lab Sample ID: 9612378-06

Sample wt/vol: 5.0 (g/mL) g Lab File ID: B1N421

% Moisture: 14 decanted: (Y/N) N Date Received: 12/17/96

Extraction: (SepF/Cont/Sonc) PURGETRAP Date Extracted: N/A

Concentrated Extract Volume: 10 (ml) Date Analyzed: 12/19/96

Injection Volume: _____ (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0 Sulfur Cleanup: (Y/N) N

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/Kg	Q
---------	----------	---	---

71-43-2-----Benzene	15.2		
108-88-3-----Toluene	16.2		
100-41-4-----Ethylbenzene	11.1	P	
1330-20-7-----Xylenes (total)	5.8	U	

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406B1

Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C378S

Matrix: (soil/water) SOIL Lab Sample ID: 9612378-06

Sample wt/vol: 30.5 (g/mL) g Lab File ID: 6Z419

Level: (low/med) LOW Date Received: 12/17/96

% Moisture: 14 decanted: (Y/N) N Date Extracted: 12/19/96

Concentrated Extract Volume: 1 (mL) Date Analyzed: 12/26/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/Kg

CAS NO.

COMPOUND

121-14-2-----	2,4-dinitrotoluene	382	U
106-46-7-----	1,4-dichlorobenzene	382	U
621-64-7-----	N-nitroso-di-n-propylamine	382	U
120-82-1-----	1,2,4-trichlorobenzene	382	U
91-20-3-----	naphthalene	382	U
91-58-7-----	2-chloronaphthalene	382	U
208-96-8-----	acenaphthylene	382	U
83-32-9-----	acenaphthene	382	U
86-73-7-----	fluorene	382	U
85-01-8-----	phenanthrene	382	U
120-12-7-----	anthracene	382	U
206-44-0-----	fluoranthene	382	U
129-00-0-----	pyrene	382	U
56-55-3-----	benzo(a)anthracene	382	U
218-01-9-----	chrysene	382	U
205-99-2-----	benzo(b)fluoranthene	382	U
207-08-9-----	benzo(k)fluoranthene	382	U
50-32-8-----	benzo(a)pyrene	382	U
193-39-5-----	indeno(1,2,3-cd)pyrene	382	U
53-70-3-----	dibenz(a,h)anthracene	382	U
191-24-2-----	benzo(g,h,i)perylene	382	U

PAH ONLY
mmf
2/13/97

DATA VALIDATION
COPY



GENERAL ENGINEERING LABORATORIES

Meeting today's needs with a vision for tomorrow.

Client: Science Applications International Corp.
P.O. Box 2502
800 Oak Ridge Turnpike
Oak Ridge, Tennessee 37831

Contact: Mr. Nile Luedtke

Project Description: Ft. Stewart UST Sites

cc: SAIC00396

Report Date: January 07, 1997

Page 1 of 2

Sample ID : 1406B1
Lab ID : 9612378-06
Matrix : Soil
Date Collected : 12/16/96
Date Received : 12/17/96
Priority : Routine
Collector : Client

Parameter	Qualifier	Result	DL	RL	Units	DF	Analyst	Date	Time	Batch	M
Organic Prep											
Evaporative Loss @ 105 C		14.0	1.00	1.00	wt%	1.0	CEC	12/17/96	1900	95222	1
General Chemistry											
Total Rec. Petro. Hydrocarbons		144 = F28	15.7	23.2	mg/kg	2.0	TSM	01/06/97	1646	95779	2

M = Method	Method-Description
M 1	EPA 3550
M 2	EPA 418.1 Modified

Notes:

The qualifiers in this report are defined as follows:

ND indicates that the analyte was not detected at a concentration greater than the detection limit.

J indicates presence of analyte at a concentration less than the reporting limit (RL) and greater than the detection limit (DL).

U indicates that the analyte was not detected at a concentration greater than the detection limit.

* indicates that a quality control analyte recovery is outside of specified acceptance criteria.


Data reported in mass/mass units is reported as 'dry weight'.

DATA VALIDATION
()

215

PO Box 30712 • Charleston, SC 29417 • 2040 Savage Road • 29407

(803) 556-8171 • Fax (803) 766-1178

 Printed on recycled paper



9612378-06

APPENDIX C-2

ANALYTICAL DATA SHEETS FOR GROUNDWATER SAMPLES

Definition of Data Qualifiers (Flags)

During the data validation process, all laboratory data were assigned appropriate data validation flags and flagging codes. Validation flags are defined as follows:

- "U" When the material was analyzed for, but not detected above the level of the associated value.
- "J" When the associated value is an estimated quantity. Indicating there is cause to question accuracy or precision of the reported value.
- "UJ" When the analyte was analyzed for, but not detected, above the associated value, however, the reported value is an estimate and demonstrates an decreased knowledge of its accuracy or precision.
- "R" When the analyte value reported is unusable. The integrity of the analyte's identification, accuracy, precision, or sensitivity have raised significant question as to the reality of the information presented.

SAIC validation flagging codes have been provided on the next page.

DATA VALIDATION FLAGGING CODES

Blanks

- F01 Sample data were qualified as a result of the method blank.
- F02 Sample data were qualified as a result of the field blank.
- F03 Sample data were qualified as a result of the equipment rinsate.
- F04 Sample data were qualified as a result of the trip blank.
- F05 Gross contamination exists.
- F06 Concentration of the contaminant was detected at a level below the CRQL.
- F07 Concentration of the contaminant was detected at a level less than the action limit, but greater than the CRQL.
- F08 Concentration of the contaminant was detected at a level that exceeds the action level.
- F09 No laboratory blanks were analyzed.
- F10 Blank had a negative value $> 5 \times$ the IDL.
- F11 Blanks were not analyzed at required frequency.
- F12 Professional judgement was used to qualify the data.

Surrogate Recovery

- G01 Surrogate recovery was above the upper control limit.
- G02 Surrogate recovery was below the lower control limit.
- G03 Surrogate recovery was $< 10\%$.
- G04 Surrogate recovery was zero.
- G05 Surrogate was not present.
- G06 Professional judgement was used to qualify the data.

Matrix Spike/Matrix Spike Duplicate

- H01 MS/MSD recovery was above the upper control limit.
- H02 MS/MSD recovery was below the lower control limit.
- H03 MS/MSD recovery was $< 10\%$.
- H04 MS/MSD pairs exceed the RPD limit.
- H05 No action was taken on MS/MSD results.
- H06 Professional judgement was used to qualify the data.

Matrix Spike

- I01 MS recovery was above the upper control limit.
- I02 MS recovery was below the lower control limit.
- I03 MS recovery was $< 30\%$.
- I04 No action was taken on MS data.
- I05 Professional judgement was used to qualify the data.

Laboratory Duplicate

- J01 Duplicate RPD was outside the control limit.
- J02 Duplicate sample results were $> 5 \times$ the CRDL.
- J03 Duplicate sample results were $< 5 \times$ the CRDL.
- J04 Professional judgement was used to qualify the data.

Internal Area Summary

- K01 Area counts were outside the control limits.
- K02 Extremely low area counts or performance was exhibited by a major drop off.
- K03 IS retention time varied by more than 30 seconds.
- K04 Professional judgement was used to qualify the data.

Laboratory Control Samples (LCSs)

- P01 LCS recovery was above upper control limit.
- P02 LCS recovery was below lower control limit.
- P03 LCS recovery was $< 50\%$.
- P04 No action was taken on the LCS data.
- P05 LCS was not analyzed at required frequency.

Target Compound Identification

- M01 Incorrect identifications were made.
- M02 Qualitative criteria were not met.
- M03 Cross contamination occurred.
- M04 Confirmatory analysis was not performed.
- M05 No results were provided.
- M06 Analysis occurred outside 12 hr GC/MS window.
- M07 Professional judgement was used to qualify the data.
- M08 The %D between the two pesticide/PCB column checks was $> 25\%$.

Initial/Continuing Calibration - Organics

- C01 Initial calibration RRF was < 0.05 .
- C02 Initial calibration RSD was $> 30\%$.
- C03 Initial calibration sequence was not followed as required.
- C04 Continuing calibration RRF was < 0.05 .
- C05 Continuing calibration %D was $> 25\%$.
- C06 Continuing calibration was not performed at the required frequency.
- C07 Resolution criteria were not met.
- C08 RPD criteria were not met.
- C09 RSD criteria were not met.
- C10 Retention time of compounds was outside windows.
- C11 Compounds were not adequately resolved.
- C12 Breakdown of endrin or DDT was $> 20\%$.
- C13 Combined breakdown of endrin/DDT was $> 30\%$.
- C14 Professional judgement was used to qualify the data.

CHAIN OF CUSTODY RECORD

COC NO.: G10024

[illegible]

CHAIN OF CUSTODY RECORD

COC NO.: 614425

[illegible]



As Employee-Owned Company
Application International Corporation

800 Oak Ridge Turnpike, Oak Ridge, TN 37831 (423) 481-4000

Page 3 of 4

CHAIN OF CUSTODY RECORD

COC NO.: 610036

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL																					
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417																					
PROJECT MANAGER: Circle Potter														PHONE NO: (803) 558-8171																					
Sampler (Signature)				(Printed Name)				Matrix		BTEX, GRO		BTEX		PAH, Lead, DRO		PAH		Lead		DRO		PAH, Lead, TPH		PAH, TPH		PAH, DRO		TPH		No. of Bottles/Vials:		OVA SCREENING		OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS	
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	BTEX	PAH, Lead, DRO	PAH	Lead	DRO	PAH, Lead, TPH	PAH, TPH	PAH, DRO	TPH	No. of Bottles/Vials:	OVA SCREENING	OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS																			
TR00016	9/8/96	0715	WATER	2	2									2	N/A																				
1404W2	9/8/96	0905	WATER	2	2									2	0 ppm																				
5201W2	9/8/96	1600	WATER	2	2									2	0 ppm																				
1404R5	9/8/96	0825	WATER	2	2									2	0 ppm																				
4701W2	9/8/96	1440	WATER	2	2									2	0 ppm																				
4401W2	9/8/96	1805	WATER	2	2									2	8.4 ppm																				
TR00014	9/8/96	0715	WATER	2	2									2	N/A																				
4502W2	9/8/96	1440	WATER	2	2									2	0 ppm																				
1403W2	9/8/96	1210	WATER	2	2									2	0 ppm																				
1503W2	9/8/96	1025	WATER	2	2									2	0 ppm																				
4501W2	9/8/96	1600	WATER	2	2									2	0 ppm																				
4402W2	9/8/96	1225	WATER	2	2									2	8.3 ppm																				
6303W2	9/8/96	0415	WATER	2	2									2	6.3 ppm																				
RELINQUISHED BY: SAC	Date/Time 9/14/96 1540	RECEIVED BY: B. L. Williams	COMPANY NAME: SAC	Date/Time 9/14/96 1540	Date/Time 9/14/96 1540	TOTAL NUMBER OF CONTAINERS: 92 Cooler ID: #24										Cooler Temperature:																			
RECEIVED BY:	Date/Time	RELINQUISHED BY:	COMPANY NAME:	Date/Time	Date/Time																														
COMPANY NAME:		COMPANY NAME:																																	
RECEIVED BY:	Date/Time	RECEIVED BY:	COMPANY NAME:	Date/Time	Date/Time																														
COMPANY NAME:		COMPANY NAME:																																	
RELINQUISHED BY:	Date/Time	RECEIVED BY:	COMPANY NAME:	Date/Time	Date/Time																														
COMPANY NAME:		COMPANY NAME:																																	



COC NO.: 60483

[illegible]



CHAIN OF CUSTODY RECORD

COC NO.: GØØØØØ

[illegible]



COC NO.: G70893

[illegible]



SAIC
An Employee-Owned Company
Science Applications International Corporation

800 Oak Ridge Turnpike, Oak Ridge, TN 37831 (423) 481-4600

PAGE 1 OF 2

CHAIN OF CUSTODY RECORD

COC NO.: 644993

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL					
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417					
PROJECT MANAGER: Chris Potter														PHONE NO: (803) 556-8171					
Sampler (Signature) <i>Samuel Stover</i>				(Printed Name) Samuel Stover														OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS	
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	BTEX	PAH, Lead, DRO	PAH	Lead	DRO	PAH, Lead, TPH	PAH, TPH	PAH, DRO	TPH	No. of Bottles/Vials	OVA SCREENING				
✓ 3803B1	9/21/96	0910	SOIL	1	1	1								2	φ ppm	9609430-085			
✓ 3803A1	9/21/96	0910	SOIL	1	1						1			2	φ ppm	9609460-056			
✓ 3803B2	9/21/96	1105	SOIL	1	1	1								2	φ ppm	9609430-095			
✓ 3803A2	9/21/96	1105	SOIL	1	1						1			2	φ ppm	9609460-066			
✓ 2204W2	9/21/96	1125	WATER	2	2									2	not recorded	9609457-027			
✓ 1401W2	9/21/96	0935	WATER	2	2									2	774 ppm	9609457-004			
✓ 2201W2	9/21/96	1515	WATER	2	2									2	φ ppm	9609457-005			
✓ 2203W2	9/21/96	1627	WATER	2	2									2	φ ppm	9609457-006			
✓ TB0051	9/21/96	0730	WATER	2	2									2	N/A	9609457-007			
✓ 2204W4	9/21/96	1125	WATER	2	2									2	φ ppm	9609457-008			
✓ 2202W2	9/21/96	1340	WATER	2	2									2	φ ppm	9609457-009			
✓ 3803W2	9/21/96	0930	WATER	2	2									2	φ ppm	9609457-010			
✓ 3802W2	9/21/96	1115	WATER	2	2									2	φ ppm	9609457-010			
RELINQUISHED BY: <i>SAIC</i>	Date/Time 9/23/96	RECEIVED BY: <i>B. L. Stover</i>		Date/Time 9/23/96	TOTAL NUMBER OF CONTAINERS: 46										Cooler Temperature: 30				
COMPANY NAME: SAIC	Date/Time 1330	COMPANY NAME: GEL		Date/Time 1330	Cooler ID: #218														
RECEIVED BY:	Date/Time	RELINQUISHED BY: <i>B. L. Stover</i>		Date/Time 9/23/96															
COMPANY NAME:	Date/Time	COMPANY NAME: GEL		Date/Time 1800															
RELINQUISHED BY:	Date/Time	RECEIVED BY: <i>B. L. Stover</i>		Date/Time 9/23/96															
COMPANY NAME:	Date/Time	COMPANY NAME: GEL		Date/Time 1800															



COC NO.: GØ114

CHAIN OF CUSTODY RECORD

[illegible]

005

PROJECT NAME: Fort Stewart UST Sites				REQUESTED PARAMETERS										LABORATORY NAME: GEL	
PROJECT NUMBER: 0003														LABORATORY ADDRESS: 2040 Savage Road Charleston, SC 29417	
PROJECT MANAGER: Chris Potter														PHONE NO: (803) 556-8171	
Sampler (Signature) <i>Sharon Stoller</i>				(Printed Name) SHARON STOLLER										OBSERVATIONS, COMMENTS, SPECIAL INSTRUCTIONS	
Sample ID	Date Collected	Time Collected	Matrix	BTEX, GRO	BTEX	PAH, Lead, DRO	PAH	Lead	DRO	PAH, Lead, TPH	PAH, TPH	TPH	No. of Bottles/Vials	OVA SCREENING	
1304D1	12/14/96	0815	SOIL		1						1		2	1.4 ppm	9612339-02
1304B1	12/14/96	0810			1								2	11.5 ppm	9612340-1617
1303C1	12/14/96	0945			1								2	1.3 ppm	9612340-1218
1303B1	12/14/96	0920			1						1		2	0.5 ppm	9612339-03
0803B1	12/14/96	1055			1								2	9.0 ppm	9612340-1819
0803B3	12/14/96	1055			1								2	9.0 ppm	9612340-1820
0803A1	12/14/96	1055			1						1		2	6.1 ppm	9612339-04
0803A3	12/14/96	1055	↓		1						1		2	6.1 ppm	9612339-05
TB0072	12/15/96	0630	WATER		2								2	N/A	9612334-01
1405R5	12/15/96	1445			2								2	N/A	9612334-02
TB0071	12/15/96	0630			2								2	N/A	9612334-03
1405W2	12/15/96	1630			2								2	0 ppm	9612334-04
0803W2	12/15/96	1425	↓		2								2	not recorded	9612334-05
RELINQUISHED BY: <i>[Signature]</i>				Date/Time 12/14/96	RECEIVED BY:		Date/Time	TOTAL NUMBER OF CONTAINERS: 76							
COMPANY NAME: SHIL				1330	COMPANY NAME:			Cooler ID: #37							
RECEIVED BY: <i>B. Hochstetler</i>				Date/Time 12/16/96	RELINQUISHED BY:		Date/Time	Cooler Temperature: 40							
COMPANY NAME: GEL				1330	COMPANY NAME:										
RELINQUISHED BY: <i>[Signature]</i>				Date/Time 12/16/96	RECEIVED BY: <i>[Signature]</i>		Date/Time 12-16-96								
COMPANY NAME: GEL				1600	COMPANY NAME: GEL		1545								



CHAIN OF CUSTODY RECORD

COC NO.: GØ127

CHAIN OF CUSTODY RECORD

[illegible]

CHAIN OF CUSTODY RECORD

COC NO.: G06130

[illegible]

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401W2

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69457W

Matrix: (soil/water) WATER Lab Sample ID: 9609457-03

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1C516

Level: (low/med) LOW Date Received: 09/24/96

% Moisture: not dec. _____ Date Analyzed: 10/04/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: _____ (uL) Soil Aliquot Volume: _____ (uL)

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/l	Q
---------	----------	--	---

71-43-2-----benzene	5.0	U	
108-88-3-----toluene	5.0	U	
100-41-4-----ethylbenzene	5.0	U	
1330-20-7-----xylenes (total)	5.0	U	

FORM I VOA

OLM03.0

000025

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1401W2

Lab Name: GENERAL ENGINEERING LABS Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69453W

Matrix: (soil/water) GROUNDH2O Lab Sample ID: 9609453-09

Sample wt/vol: 500 (g/mL) mL Lab File ID: 1N118

Level: (low/med) LOW Date Received: 09/24/96

% Moisture: _____ decanted: (Y/N) _____ Date Extracted: 09/25/96

Concentrated Extract Volume: 0.5 (mL) Date Analyzed: 09/30/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/L Q

91-20-3-----	naphthalene	10.0	U
91-58-7-----	2-chloronaphthalene	10.0	U
209-96-8-----	acenaphthylene	10.0	U
83-32-9-----	acenaphthene	10.0	U
86-73-7-----	fluorene	10.0	U
85-01-8-----	phenanthrene	10.0	U
120-12-7-----	anthracene	10.0	U
206-44-0-----	fluoranthene	10.0	U
129-00-0-----	pyrene	10.0	U
56-55-3-----	benzo (a) anthracene	10.0	U
218-01-9-----	chrysene	10.0	U
205-99-2-----	benzo (b) fluoranthene	10.0	U
207-08-9-----	benzo (k) fluoranthene	10.0	U
50-32-8-----	benzo (a) pyrene	10.0	U
193-39-5-----	indeno (1,2,3-cd) pyrene	10.0	U
53-70-3-----	dibenz (a,h) anthracene	10.0	U
191-24-2-----	benzo (g,h,i) perylene	10.0	U

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402W2

Lab Name: GENERAL ENGINEERING LABS. Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69424W

Matrix: (soil/water) WATER Lab Sample ID: 9609424-16

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1C424

Level: (low/med) LOW Date Received: 09/21/96

% Moisture: not dec. _____ Date Analyzed: 10/03/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: _____ (uL) Soil Aliquot Volume: _____ (uL)

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/l Q

71-43-2-----benzene	2.8	J	J
108-88-3-----toluene	5 0.38	JB	U FD1, FD6
100-41-4-----ethylbenzene	0.17	J	J
1330-20-7-----xylenes (total)	2.4	J	J

MAP
12/24/96

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1402W2

Lab Name: GENERAL ENGINEERING LABOR Contract:

Lab Code: Case No.: SAS No.: SDG No.: 69423W

Matrix: (soil/water) GROUNDH2O Lab Sample ID: 9609423-10

Sample wt/vol: 500 (g/mL) mL Lab File ID: 2M412

Level: (low/med) LOW Date Received: 09/21/96

% Moisture: _____ decanted: (Y/N) _____ Date Extracted: 09/24/96

Concentrated Extract Volume: 0.5 (mL) Date Analyzed: 09/27/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/L Q

91-20-3-----	naphthalene	10.0	U
91-58-7-----	2-chloronaphthalene	10.0	U
209-96-8-----	acenaphthylene	10.0	U
83-32-9-----	acenaphthene	10.0	U
86-73-7-----	fluorene	10.0	U
85-01-8-----	phenanthrene	10.0	U
120-12-7-----	anthracene	10.0	U
206-44-0-----	fluoranthene	10.0	U
129-00-0-----	pyrene	10.0	U
56-55-3-----	benzo (a) anthracene	10.0	U
218-01-9-----	chrysene	10.0	U
205-99-2-----	benzo (b) fluoranthene	10.0	U
207-08-9-----	benzo (k) fluoranthene	10.0	U
50-32-8-----	benzo (a) pyrene	10.0	U
193-39-5-----	indeno (1,2,3-cd) pyrene	10.0	U
53-70-3-----	dibenz (a,h) anthracene	10.0	U
191-24-2-----	benzo (g,h,i) perylene	10.0	U

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403W2

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69177W

Matrix: (soil/water) WATER Lab Sample ID: 9609177-09

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1A122

Level: (low/med) LOW Date Received: 09/11/96

% Moisture: not dec. DATA VALIDATION Date Analyzed: 09/16/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: (uL) Soil Aliquot Volume: (uL)

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/l

71-43-2-----benzene	238	117	ED	=
108-88-3-----toluene		6.0	B	= FDB
100-41-4-----ethylbenzene		71.4		=
1330-20-7-----xylenes (total)		180		=

FORM I VOA

OLM03.0

DATA VALIDATION

1B
COPY SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1403W2

Lab Name: Contract: Lab Code: Case No.: SAS No.: SDG No.: 69167W
Matrix: (soil/water) GROUNDH2O Lab Sample ID: 9609167-13
Sample wt/vol: 500 (g/mL) mL Lab File ID: 5L407
Level: (low/med) LOW Date Received: 09/10/96
% Moisture: _____ decanted: (Y/N) _____ Date Extracted: 09/13/96
Concentrated Extract Volume: 0.5 (mL) Date Analyzed: 09/19/96
Injection Volume: 1.0 (uL) Dilution Factor: 1.0
GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/L Q

91-20-3-----	naphthalene	51.2	
91-58-7-----	2-chloronaphthalene	10.0	U
208-96-8-----	acenaphthylene	10.0	U
83-32-9-----	acenaphthene	10.0	U
86-73-7-----	fluorene	10.0	U
85-01-8-----	phenanthrene	10.0	U
120-12-7-----	anthracene	10.0	U
206-44-0-----	fluoranthene	10.0	U
129-00-0-----	pyrene	10.0	U
56-55-3-----	benzo (a) anthracene	10.0	U
218-01-9-----	chrysene	10.0	U
205-99-2-----	benzo (b) fluoranthene	10.0	U
207-08-9-----	benzo (k) fluoranthene	10.0	U
50-32-8-----	benzo (a) pyrene	10.0	U
193-39-5-----	indeno (1,2,3-cd) pyrene	10.0	U
53-70-3-----	dibenz (a,h) anthracene	10.0	U
191-24-2-----	benzo (g,h,i) perylene	10.0	U

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404W2

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 69177W

Matrix: (soil/water) WATER Lab Sample ID: 9609177-02

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1A116

Level: (low/med) LOW Date Received: 09/11/96

% Moisture: not dec. _____ Date Analyzed: 09/16/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: _____ (uL) Soil Aliquot Volume: _____ (uL)

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/l Q

71-43-2-----benzene	5.0	U	U
108-88-3-----toluene	5 0.28	JB	UFD, F06
100-41-4-----ethylbenzene	5.0	U	U
1330-20-7-----xylenes (total)	5.0	U	U

FORM I VOA

OLM03.0

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1404W2

Lab Name:

Contract:

Lab Code:

Case No.:

SAS No.:

SDG No.: 69172W

Matrix: (soil/water) GROUNDH2O

Lab Sample ID: 9609172-01

Sample wt/vol: 500 (g/mL) mL

Lab File ID: 6L411

Level: (low/med) LOW

Date Received: 09/11/96

% Moisture: _____ decanted: (Y/N) _____

Date Extracted: 09/16/96

Concentrated Extract Volume: 0.5 (mL)

Date Analyzed: 09/19/96

Injection Volume: 1.0 (uL)

Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/L

Q

121-14-2-----	2,4-dinitrotoluene	PAH ONLY	10.0	U
106-46-7-----	1,4-dichlorobenzene		10.0	U
621-64-7-----	N-nitroso-di-n-propylamine		10.0	U
120-82-1-----	1,2,4-trichlorobenzene		10.0	U
91-20-3-----	naphthalene		10.0	U
91-58-7-----	2-chloronaphthalene		10.0	U
208-96-8-----	acenaphthylene		10.0	U
83-32-9-----	acenaphthene		10.0	U
86-73-7-----	fluorene		10.0	U
85-01-8-----	phenanthrene		10.0	U
120-12-7-----	anthracene		10.0	U
206-44-0-----	fluoranthene		10.0	U
129-00-0-----	pyrene		10.0	U
56-55-3-----	benzo (a) anthracene		10.0	U
218-01-9-----	chrysene		10.0	U
205-99-2-----	benzo (b) fluoranthene		10.0	U
207-08-9-----	benzo (k) fluoranthene		10.0	U
50-32-8-----	benzo (a) pyrene		10.0	U
193-39-5-----	indeno (1,2,3-cd) pyrene		10.0	U
53-70-3-----	dibenz (a,h) anthracene		10.0	U
191-24-2-----	benzo (g,h,i) perylene		10.0	U

R G04

, H02

, H02

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405W2

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C334W

Matrix: (soil/water) WATER Lab Sample ID: 9612334-04

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1N515

Level: (low/med) LOW Date Received: 12/16/96

% Moisture: not dec. _____ Date Analyzed: 12/20/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: _____ (uL) Soil Aliquot Volume: _____ (uL)

CAS NO. COMPOUND CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/l Q

71-43-2-----benzene	5.0	U	U
108-88-3-----toluene	5 0.17	J	U F24, F06
100-41-4-----ethylbenzene	0.098	J	J
1330-20-7-----xylenes (total)	4.6	J	J

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1405W2

Lab Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C332W

Matrix: (soil/water) GROUNDH2O Lab Sample ID: 9612332-03

Sample wt/vol: 500 (g/mL) mL Lab File ID: 2Y510

Level: (low/med) LOW Date Received: 12/16/96

% Moisture: _____ decanted: (Y/N) _____ Date Extracted: 12/17/96

Concentrated Extract Volume: 0.5 (mL) Date Analyzed: 12/20/96

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/L	Q
91-20-3-----	naphthalene	10.0 U	U ↓
91-58-7-----	2-chloronaphthalene	10.0 U	
209-96-8-----	acenaphthylene	10.0 U	
83-32-9-----	acenaphthene	10.0 U	
86-73-7-----	fluorene	10.0 U	
85-01-8-----	phenanthrene	10.0 U	
120-12-7-----	anthracene	10.0 U	
206-44-0-----	fluoranthene	10.0 U	
129-00-0-----	pyrene	10.0 U	
56-55-3-----	benzo (a) anthracene	10.0 U	
218-01-9-----	chrysene	10.0 U	
205-99-2-----	benzo (b) fluoranthene	10.0 U	
207-08-9-----	benzo (k) fluoranthene	10.0 U	
50-32-8-----	benzo (a) pyrene	10.0 U	
193-39-5-----	indeno (1,2,3-cd) pyrene	10.0 U	
53-70-3-----	dibenz (a,h) anthracene	10.0 U	
191-24-2-----	benzo (g,h,i) perylene	10.0 U	

DATA VALIDATION
COPY

1A
VOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406W2

Lab Name: GENERAL ENGINEERING LABOR Contract: N/A

Lab Code: N/A Case No.: N/A SAS No.: N/A SDG No.: 6C372W

Matrix: (soil/water) WATER Lab Sample ID: 9612372-16

Sample wt/vol: 20 (g/ml) ml Lab File ID: 1P117

Level: (low/med) LOW Date Received: 12/17/96

% Moisture: not dec. _____ Date Analyzed: 12/30/96

GC Column: DB624 ID: 0.53 (mm) Dilution Factor: 1.0

Soil Extract Volume: _____ (uL) Soil Aliquot Volume: _____ (uL)

CAS NO.	COMPOUND	CONCENTRATION UNITS: (ug/L or ug/Kg) ug/l	Q
---------	----------	--	---

71-43-2-----	benzene	2.4	J	
108-88-3-----	toluene	5 0.27	J	U FD4, FD6
100-41-4-----	ethylbenzene	0.53	J	J
1330-20-7-----	xylene (total)	5.0	U	U

inf 2/5/96

FORM I VOA

OLM03.0

DATA VALIDATION
COPY

1B
SEMIVOLATILE ORGANICS ANALYSIS DATA SHEET

EPA SAMPLE NO.

1406W2RE1

b Name: GENERAL ENGINEERING LABOR Contract: NA

Lab Code: NA Case No.: NA SAS No.: NA SDG No.: 6C372W

Matrix: (soil/water) GROUNDH2O Lab Sample ID: 9612372-03

Sample wt/vol: 500 (g/mL) mL Lab File ID: 2B206

Level: (low/med) LOW Date Received: 12/17/96

% Moisture: _____ decanted: (Y/N) _____ Date Extracted: 01/06/97

Concentrated Extract Volume: 0.5 (mL) Date Analyzed: 01/07/97

Injection Volume: 1.0 (uL) Dilution Factor: 1.0

GPC Cleanup: (Y/N) N pH: 7.0

CONCENTRATION UNITS:
(ug/L or ug/Kg) ug/L

CAS NO.

COMPOUND

Q

91-20-3-----	naphthalene	10.0	U	0.5 API ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓ ↓
91-58-7-----	2-chloronaphthalene	10.0	U	
209-96-8-----	acenaphthylene	10.0	U	
83-32-9-----	acenaphthene	10.0	U	
86-73-7-----	fluorene	10.0	U	
85-01-8-----	phenanthrene	10.0	U	
120-12-7-----	anthracene	10.0	U	
206-44-0-----	fluoranthene	10.0	U	
129-00-0-----	pyrene	10.0	U	
56-55-3-----	benzo (a) anthracene	10.0	U	
218-01-9-----	chrysene	10.0	U	
205-99-2-----	benzo (b) fluoranthene	10.0	U	
207-08-9-----	benzo (k) fluoranthene	10.0	U	
50-32-8-----	benzo (a) pyrene	10.0	U	
193-39-5-----	indeno (1,2,3-cd) pyrene	10.0	U	
53-70-3-----	dibenz (a,h) anthracene	10.0	U	
191-24-2-----	benzo (g,h,i) perylene	10.0	U	



APPENDIX C-3

QUALITY CONTROL SUMMARY REPORT

APPENDIX C-3
QUALITY CONTROL SUMMARY REPORT
for
PHASE I & II CAP-PART A INVESTIGATIONS
FORMER UNDERGROUND STORAGE TANK SITES
FORT STEWART, GEORGIA
March 1997

1.0 INTRODUCTION

The purpose of this project was to perform initial characterization investigations at former underground storage tank (UST) sites located throughout the Fort Stewart garrison area to determine the nature and extent of petroleum contamination at each site and to define a Site Investigation Plan for each site where the initial characterization effort was insufficient to complete delineation of soil and/or groundwater contamination extent. A total of 81 individual former USTs located at 57 separate sites segregated into 26 general areas were included in this project.

Each of the project UST sites were initially assigned either preliminary groundwater status or CAP-Part A status. Preliminary groundwater status was assigned to sites where analytical results for soil samples collected during removal of the tank(s) suggested that groundwater contamination exceeding applicable regulatory limits may be present. CAP-Part A status was assigned to sites where results for the tank(s) removal soil samples indicated that soil and/or groundwater contamination exceeding applicable regulatory limits was present. Of the 57 separate sites included in the project scope, 33 sites were assigned preliminary groundwater status and the remaining 24 sites were assigned CAP-Part A status.

This Quality Control Summary Report (QCSR) consolidates quality control information for the Phase I & II investigations. Sampling and analytical efforts were coordinated for the various tank locations providing a combined data set for evaluation of data integrity.

1.1 Project Description

Phase I field sampling activities for the 57 UST sites began and were completed in September of 1996. Phase II sampling activities for 20 of the 57 UST sites began and were completed in December of 1996. Phase I inspection activities at preliminary groundwater sites consisted of continuous collection of soil samples over 2.5-foot intervals from two boreholes located within the former tank pit. Each borehole was advanced down to the water table using the hollow-stem auger drilling method and soil samples were collected using a split-barrel sampler. Immediately after collection of each soil sample, a portion of the sample underwent field screening to determine organic vapor

headspace gas concentration. Based on these results, two soil samples were selected for laboratory chemical analysis from boreholes where detectable vapor concentrations were encountered, or one sample was selected for analysis from boreholes where no vapor concentrations were encountered.

Phase I inspection activities at CAP-Part A sites were similar to those described for the preliminary groundwater sites with the following exceptions. First, four soil boreholes were drilled within and around the former tank pit. Second, two soil samples were selected for laboratory chemical analysis from each borehole regardless of the field screening results. Phase II inspection activities were conducted at those Phase I sites where sampling results were insufficient to characterize the nature and extent of soil and/or groundwater contamination. The Phase II activities were identical to those described for Phase I activities at CAP-Part A sites. However, soil boreholes drilled during the Phase II investigations were all located around the perimeter of the former tank pit locations and/or downgradient of the pit locations.

Upon completion of Phase I and Phase II soil sampling at both preliminary groundwater and CAP-Part A sites, one groundwater sample was collected from each borehole for laboratory chemical analysis. These samples were either collected directly from the saturated zone using a PowerPunch in situ sampling device, or from temporary piezometers installed within the boreholes using a Teflon bailer. Collection of samples from temporary piezometers was only implemented at borehole locations where the PowerPunch device could not be used because of subsurface obstructions or slow groundwater recharge into the device.

Phase I and Phase II laboratory analytical results for the soil samples collected at each site were screened against applicable risk-based threshold levels for those compounds identified in Chapter 391-3-15 of the Georgia Department of Natural Resources (GDNR) Rules for Underground Storage Tank Management. Phase I and Phase II analytical results for the groundwater samples collected at each site were screened against federally mandated Maximum Contaminant Levels (MCLs) for those compounds identified by the GDNR. The screening results for both soil and groundwater samples were used to delineate the nature and extent of contamination at each UST site.

1.2 Project Objectives

The scope of the project involved performance of initial characterization activities relative to the GDNR Underground Storage Tank Management Program regulations at 57 sites, and preparation of CAP-Part A reports as required based on the investigation results. The overall purpose of the site investigations was to determine the nature and extent of soil and groundwater contamination exceeding regulatory screening criteria, and to determine if additional characterization sampling was necessary to complete delineation of contaminant extent. Additional sampling requirements were defined in the Site Investigation Plan section of the CAP-Part A reports. CAP-Part A reports were not

prepared for those preliminary groundwater sites where soil and groundwater contamination was documented to be below applicable regulatory screening criteria.

Specific requirements for the preliminary groundwater and CAP-Part A investigations were defined in the Georgia Underground Storage Tank (GUST) CAP-Part A guidance document GUST-7A (issued November 1995), the project Work Plan, and subsequent work plan revisions developed by the U.S. Army Corps of Engineers (USACE)-Savannah District for the project. In summary, the objectives of the project were as follows:

1. Determine the vertical extent of Total Recoverable Petroleum Hydrocarbon (TRPH) contamination below UST sites designated for preliminary groundwater investigations. Determine if benzene, toluene, ethylbenzene, xylene (BTEX), or polyaromatic hydrocarbon (PAH) compounds were present at concentrations exceeding screening criteria.
2. Determine the horizontal and vertical extent of BTEX or PAH contamination exceeding threshold levels in soil below UST sites designated for CAP-Part A investigations. Determine horizontal and vertical extent of BTEX or PAH contamination exceeding MCLs in groundwater at these sites.
3. Delineate soil and groundwater contaminant plumes where present.
4. Determine groundwater flow direction for all sites included in the project.
5. Prepare No Further Action reports and CAP-Part A reports for the various UST sites as deemed appropriate from the information gathered.

The general quality assurance (QA) objectives of the project are as follows:

1. Ensure that the method used for borehole drilling will allow for collection of soil samples representative of surface and subsurface soil contamination conditions, and for description of the hydrogeologic environment.
2. Ensure that the method used for collection of groundwater samples will allow for collection of samples representative of water table contamination conditions.
3. Ensure that sampling methods used for soil and groundwater collection minimize alteration of contaminant concentrations, and that drilling and sampling equipment decontamination methods prevent cross-contamination between sampling locations.
4. Ensure that field measurement and analytical laboratory results are accurate, representative of site conditions, and fulfill data quality objectives (DQOs) defined for the project.

The first three QA objectives were accomplished through implementation of the procedures and requirements described in the Work Plan and associated Field Sampling Plan. The fourth QA objective was accomplished through data management practices, associated internal laboratory QC analyses, related procedures and requirements defined in the Chemical Data Acquisition Plan (CDAP), and through collection and analysis of field quality control (QC) samples.

1.3 Project Implementation

Phase I field work was initiated and completed by Science Applications International Corporation (SAIC) in September 1996. Phase II field work was initiated and completed by SAIC in December 1996. A project-specific Site Health and Safety Plan was compiled for the work completed by SAIC and sub-tier contractors. Ms. Patty Stoll was designated as Field Manager for the project. She was responsible for the collection of samples in accordance with the work plan, completion of the Daily Quality Control Reports (DQCRs), coordination of site access, shipment of samples to the laboratories, and documentation and correction of problems as they occurred. Quality Control Officer for the project was Ms. Sharon Stoller. She was responsible for data quality control for the SAIC sampling effort. This included, but was not limited to, validation of both field and laboratory data in accordance with the Geological Data Acquisition Plan (GDAP), the CDAP, and the Work Plan. As laboratory and analytical data coordinator, Mr. Nile Luedtke was responsible for maintaining analytical files for the project, approval of payment invoices from the laboratories, and documentation and correction of problems as they occurred. As the SAIC project manager, Christopher Potter was responsible for overall project success, budgetary control, USACE interfaces, and completion of Monthly Progress Reports (MPRs).

One analytical laboratory was used by SAIC for testing samples collected by SAIC personnel during both the Phase I and Phase II investigations. General Engineering Laboratory of Charleston, South Carolina completed all groundwater and soil analysis for BTEX, PAHs, gasoline range organics (GRO), diesel range organics (DRO), and TRPH. The laboratory used U.S. Environmental Protection Agency (EPA) analytical methods and is validated through the USACE Missouri River Division (MRD) laboratory review process. The QA laboratory for the entire project was the USACE South Atlantic Division (SAD) Laboratory in Marietta, Georgia.

1.4 Purpose of This Report

Environmental data must always be interpreted relative to known limitations and intended use. As can be expected in environmental media of this type, there are areas and data points where the user needs to be cautioned relative to the quality of the project information presented. The data validation process and this data quality assessment are intended to provide current and future data users assistance throughout the interpretation of these data.

The purpose of this QCSR is to describe Quality Control (QC) procedures followed to ensure data generated by SAIC during the investigations at Fort Stewart would meet project requirements, to describe the quality of the data collected, and to describe problems encountered during the course of the study and their solutions. A separate QA report will be completed by the SAD Laboratory covering data generated from SAIC collected samples remanded to their custody.

This appendix provides an assessment of the analytical information gathered during the course of the Phase I and Phase II UST investigations and documents that the quality of the data employed for the CAP-Part A reports met the objectives. Evaluation of field and laboratory QC measures will constitute the majority of this assessment; however, references will also be directed toward those QA procedures that establish data credibility. The primary intent of this assessment is to illustrate that data generated for the UST investigations can withstand scientific scrutiny, are appropriate for their intended purpose, are technically defensible, and are of known and acceptable sensitivity, precision, and accuracy.

Multiple activities were performed to achieve the desired data quality in this project. As discussed in the text, decisions were made during the initial scoping to define the quality and quantity of data required. DQOs were established to guide the implementation of the field sampling and laboratory analysis. A QA program was established to standardize procedures and to document activities. This program provided a means to detect and correct any deficiencies in the process. Upon receipt by the project team, data were subjected to a verification and validation review that identified and qualified problems related to the analysis. These review steps contribute to this final Data Quality Assessment (DQA) that defines that data used in the investigation met the criteria and are used appropriately.

2.0 QUALITY ASSURANCE PROGRAM

A CDAP was developed for this project and was included as one of several subplans with the overall project Work Plan. The purpose of this document was to enumerate the quantity and type of samples to be taken to inspect the various sites, and to define the quantity and type of Quality Assurance/Quality Control (QA/QC) samples to be used to evaluate the quality of the data obtained.

The CDAP established requirements for both field and laboratory QC procedures. In general, field QC duplicates and QA split samples were required for each environmental sample matrix collected at sites being investigated at a frequency of 10%; volatile organic compound (VOC) trip blanks were to accompany each cooler containing water samples for VOC determinations; and analytical laboratory QC duplicates, matrix spikes, laboratory control samples, and method blanks were required for every 20 samples or less of each matrix and analyte.

A primary goal of the QA program was to ensure that the quality of results for all environmental measurements were appropriate for their intended use. To this end, a CDAP and standardized field procedures were compiled to guide the investigation. Through the process of readiness review, training, equipment calibration, QC implementation, and detailed documentation, the project has successfully accomplished the goals set by the QA Program.

2.1 Monthly Progress Reports

An MPR was completed by the SAIC Project Manager for every month during project implementation. The MPRs contain the following information: work completed, problems encountered, corrective actions/solutions, summary of findings, and upcoming work. These reports were issued to the USACE-Savannah District Project Manager and may be obtained through their office.

2.2 Daily Quality Control Reports (DQCRs)

The Field Manager, Patty Stoll, produced all Daily Quality Control Reports. These include information such as, but not limited to, sub-tier contractors on site, equipment on site, work performed summaries, QC activities, Health and Safety activities, problems encountered, and corrective actions. The DQCRs were submitted to the SAIC and USACE-Savannah District Project Managers, and are on file in their offices.

2.3 Laboratory "Definitive" Level Data Reporting

The CDAP for this project identified requirements for laboratory data reporting and identified General Engineering Laboratories as the laboratory for the project. EPA "definitive" data have been reported including the following basic information:

- a. laboratory case narratives
- b. sample results
- c. laboratory method blank results
- d. laboratory control standard results
- e. laboratory sample matrix spike recoveries
- f. laboratory duplicate results
- g. surrogate recoveries (BTEX, GRO, PAHs, DRO)
- h. sample extraction dates
- i. sample analysis dates

This information from the laboratory, along with field information, provides the basis for subsequent data evaluation relative to sensitivity, precision, accuracy, representativeness, and completeness. These have been presented in Section 4.0 of this appendix.

3.0 DATA VALIDATION

The objective when evaluating the quality of the project data is to determine its usability. The evaluation is based on the interpretation of laboratory QC measures, field QC measures, and the project DQOs.

This project implemented the use of data validation checklists to facilitate laboratory data validation. These checklists were completed by the project-designated SAIC validation staff and were reviewed by the project laboratory coordinator. Data validation checklists for each laboratory sample delivery group (SDG) have been retained with laboratory data deliverables by SAIC.

3.1 Field Data Validation

DQCRs were completed by the Field Manager. The DQCRs and other field generated documents such as sampling logs, boring logs, daily health and safety summaries, daily safety inspections, equipment calibration and maintenance logs, and sample management logs were peer reviewed on site. These logs and all associated field information have been delivered to the USACE-Savannah District Project Manager and can be obtained through their office.

3.2 Laboratory Data Validation

Analytical data generated for this project have been subjected to a process of data verification, validation, and review. The following describes this systematic process and the evaluation activities performed. Several criteria have been established against which the data are compared and from which a judgment is rendered regarding the acceptance and qualification of the data. Because it is beyond the scope of this report to cite those criteria, the reader is directed to the following documents for specific detail:

- SAIC Technical Support Contractor QA Technical Procedure (TP-DM-300-7) Data Verification and Validation;
- Region I EPA - Laboratory Data Validation, Functional Guidelines for Evaluating Inorganic Analyses;
- Region I EPA- Laboratory Data Validation, Functional Guidelines for Evaluating Organic Analyses; and
- Work Plan for Preliminary Groundwater and Corrective Action Plan - Part A & Part B Investigations at Former Underground Storage Tank Sites, Fort Stewart, Georgia, August 1996.

Upon receipt of field and analytical data, SAIC verification staff performed a systematic examination of the reports, following standardized data package checklists, to ensure the

content, presentation, and administrative validity of the data. Discrepancies identified during this process were recorded and documented using the QA program Analytical Data Nonconformance Report (ADNCR) and Nonconformance Report (NCR) systems.

In conjunction with the data verification, and if standardized laboratory electronic data diskettes were available, the diskette deliverables were subjected to review using SAIC Electronic Data Deliverable (EDD) review software. This software performed both a structural and technical assessment of the laboratory-delivered electronic reports. The structural evaluation ensured that all required data had been reported and contract specified requirements were met (i.e., analytical holding times, contractual turnaround times, etc.).

During the validation phase of the review and evaluation process, data were subjected to a systematic technical review by examining all field and analytical QC results and laboratory documentation, following appropriate guidelines for laboratory data validation. These data validation guidelines define the technical review criteria, methods for evaluation of the criteria, and actions to be taken resulting from the review of these criteria. The primary objective of this phase was to assess and summarize the quality and reliability of the data for the intended use and to document factors that may affect the usability of the data. Data verification/validation included but was not necessarily limited to the following parameters:

Inorganic	Organic
Data completeness	Data completeness
Holding times	Holding times
Calibration	Calibration
- Initial	- Initial
- Continuing	- Continuing
Blanks	Blanks
Sample results verification	Surrogate recovery
Matrix spike recovery	
Field duplicate sample analysis	
Laboratory control sample analysis	Internal standards performance
Furnace atomic absorption QC (when implemented)	
Detection limits	Compound quantitation and reported detection limits
Secondary dilutions	Secondary dilutions

As an end result of this phase of the review, the data were qualified based on the technical assessment of the validation criteria. Qualifiers were applied to each field and analytical result to indicate the usability of the data for their intended purpose.

3.3 Definition of Data Qualifiers (Flags)

During the data validation process, all laboratory data were assigned appropriate data validation flags and reason codes. Validation flags are defined as follows:

- “U” When the material was analyzed for, but not detected above the level of the associated value.
- “J” When the associated value is an estimated quantity, indicating there is cause to question accuracy or precision of the reported value.
- “UJ” When the analyte was analyzed for, but not detected, above the associated value; however, the reported value is an estimate and demonstrates a decreased knowledge of its accuracy or precision.
- “R” When the analyte value reported is unusable. The integrity of the analyte's identification, accuracy, precision, or sensitivity have raised significant question as to the reality of the information presented.

SAIC validation flagging codes have been provided in Attachment 1 of this appendix, while copies of validation checklists and qualified data forms are on-file with the analytical laboratory deliverable.

3.4 Data Acceptability

3.4.1 Phase I

A total of 749 environmental soil, groundwater, and field QC samples were collected with approximately 11,000 discrete analyses (i.e., analytes) being obtained, reviewed, and integrated into the assessment (these totals do not include field measurements and field descriptions). The project produced acceptable results for over 99% of the sample analyses performed and successfully collected all required investigation samples. Rejected data were relegated to PAH determinations in one soil and two groundwater samples.

Table 1 presents a summary of the number of collected investigation samples for each of the 26 general investigation areas. It also tallies the successful collection of appropriate targeted field QC and QA split samples. Table 2 provides a summary of rejected analyses grouped by media and analyte category. Copies of the project Chain-of-Custody forms are provided in Appendices C-1 and C-2 of the CAP-Part A reports.

Through appropriate data verification, validation, and review, analytical information has been identified as estimated and rejected. Analyses were estimated for several soil samples due to missed analytical holding times. This occurred because of the need to re-analyze these samples or it consisted of a time lapse of only a few days. Subsequently, the data has been estimated, however, it is considered useable to the project. None of the

Table 1. Summary of Samples Collected

Phase I

Tank Area	Environmental Samples			Field QC Samples--			QA Split Samples
	Soil	Soil Duplicates	Water	Water Duplicates	Trip Blanks	Equipment Rinsates	
A	13	2	7	1	2	0	2
C	18	4	10	1	3	3	3
D	37	2	24	3	8	3	1
E	12	0	6	0	1	2	3
E/F	16	2	8	1	1	0	3
G	3	0	2	0	1	2	0
H	10	2	6	1	2	0	0
I	7	0	4	1	2	0	1
J	4	0	2	0	1	0	2
K	8	2	4	1	1	0	0
L	7	0	4	0	1	2	2
M	26	3	14	2	3	2	2
N	26	5	13	1	3	2	3
O	6	0	4	1	1	0	0
P	17	0	9	0	2	3	3
Q	9	2	5	0	1	1	0
R	16	2	8	1	3	0	3
S	13	1	9	0	2	3	3
T	18	4	9	2	2	0	2
U	8	0	4	0	1	0	0
V	22	4	11	1	2	3	0
W	20	2	12	3	3	0	5
X	12	2	6	0	1	1	0
Y	28	2	16	3	6	4	4
Z	28	1	14	1	0	4	3
Totals	384	42	211	24	53	35	

Table 1. (Continued)

Phase II

Tank Area	Environmental Samples			Field QC Samples--			QA Split Samples
	Soil	Soil Duplicates	Water	Water Duplicates	Trip Blanks	Equipment Rinsates	
A	6	-	3	-	1	-	-
C	-	-	-	-	-	-	-
D	12	2	6	1	1	1	3
E	4	-	2	-	1	1	-
E/F	-	-	-	-	-	-	-
G	-	-	-	-	-	-	-
H	-	-	-	-	-	-	-
I	-	-	-	-	-	-	-
J	-	-	-	-	-	-	-
K	-	-	-	-	-	-	-
L	-	-	-	-	-	-	-
M	16	2	8	1	2	2	3
N	10	2	5	-	1	2	2
O	4	-	2	1	-	-	1
P	6	-	3	-	2	1	-
Q	6	2	3	-	1	-	3
R	-	-	-	-	-	-	-
S	-	-	-	-	-	-	-
T	6	-	3	1	1	-	-
U	-	-	-	-	-	-	-
V	6	2	3	-	1	-	3
W	4	-	2	1	-	-	1
X	4	2	2	-	1	-	2
Y	4	-	2	1	1	1	-
Z	6	-	3	-	1	1	-
Totals	94	12	47	6	13	9	

Table 2. Summary of Rejected Analytes
(grouped by media and analysis group)

Media	Analysis Group	Rejected/Total	Percent Rejected
Soil	BTEX Compounds	0/ 1,280	0.0
	Diesel Range Org.	0/ 165	0.0
	Gasoline Range Org.	0/ 165	0.0
	PAH Compounds	9/ 5,432	0.2
	TRPH	0/ 154	0.0
	Subtotal	9/ 7,196	0.1
Groundwater	BTEX Compounds	0/ 735	0.0
	PAH Compounds	34/ 3,084	1.1
	Subtotal	34/ 3,819	0.9
Phase I Total		43/ 11,015	0.4
Soil	BTEX Compounds	0/ 408	0.0
	Diesel Range Org.	0/ 28	0.0
	Gasoline Range Org.	0/ 28	0.0
	PAH Compounds	0/ 1,802	0.0
	TRPH	0/ 78	0.0
	Subtotal	0/ 2,344	0.0
Groundwater	BTEX Compounds	0/ 212	0.0
	PAH Compounds	0/ 833	0.0
	Subtotal	0/ 1,045	0.0
Phase II Total		0/ 3,389	0.0
OVERALL TOTAL		43/ 14,404	0.3

soil or groundwater BTEX, DRO, or GRO data were rejected. BTEX values were estimated in various soil samples due to poor second column gas chromatograph (GC) confirmation percent difference comparisons ($>25\%$). None of the results were extremely disparate and the data have been appropriately identified. Approximately 2% of the DRO and GRO data have been estimated due to variable matrix spike/matrix spike duplicate (MS/MSD) recoveries or continuing calibration variances, however, all data are considered useable for the project needs.

A total of three sample's (1-soil, 2-water) PAH analyses have been rejected. Soil data were rejected relative to internal standard deviations, while groundwater data were rejected due to extremely poor surrogate standard recoveries. Additional PAH data have been estimated due to less extreme variation in these same control parameters. All rejected results reflect a tendency to exhibit extreme negative bias and were therefore unable to support the requirements of the project.

3.4.2 Phase II

A total of 181 environmental soil, groundwater, and field QC samples were collected with approximately 3,400 discrete analyses (i.e., analytes) being obtained, reviewed, and integrated into the assessment (these totals do not include field measurements and field descriptions). This phase of the project produced acceptable results for 100% of the sample analyses performed and successfully collected all required investigation samples.

Table 1 presents a summary of the number of collected investigation samples for each of the 26 general investigation areas. It also tallies the successful collection of appropriate targeted field QC and QA split samples. Table 2 provides a summary of rejected analyses grouped by media and analyte category. Copies of the project Chain-of-Custody forms are provided in Appendices C-1 and C-2 of the CAP-Part A reports.

Analytical information has been identified as estimated where necessary. Analyses were estimated for three water samples due to missed analytical holding times. These consisted of a time lapse of only a few days. Subsequently, the data have been estimated, however, it is considered useable to the project. None of the soil or groundwater BTEX, DRO, or GRO data were rejected. BTEX values were estimated in various soil samples due to poor second column gas chromatograph (GC) confirmation percent difference comparisons ($>25\%$). None of the results were extremely disparate and the data have been appropriately identified.

4.0 DATA EVALUATION

4.1 Accuracy

Accuracy provides a gauge or measure of the agreement between an observed result and the true value for an analysis. Analytical accuracy is evaluated by measuring the agreement between an analytical result and its known or true value. This is generally

determined through use of Laboratory Control Samples (LCSs), Matrix Spike (MS) analysis, and Performance Evaluation (PE) Samples. Accuracy as measured through the use of LCSs determines the method implementation accuracy independent of sample matrix. They document laboratory analytical process control. Accuracy determined by the MS is a function of both matrix and analytical process. Tables 3 and 4 present average LCS recovery values for the various parameters under investigation during these studies. Method blank surrogate compound recoveries and method blank target compound spiked analyses are two forms of laboratory control sample analyses. Table 5 consolidates the average sample matrix spike (MS) recovery values for BTEX, GRO, PAH, DRO, and TRPH parameters.

Volatile Organic Compounds

Volatile organic compounds (BTEX) LCS recovery, surrogate recovery, and MS recovery information provide measures of accuracy. Recoveries determined for laboratory volatile organic method blank spike and method blank surrogate analyses indicate the analytical processes for both GC and gas chromatograph/mass spectrometer (GC/MS) procedures were in control. Individual sample surrogate recoveries and sample MS recoveries indicate analytical accuracy for these compounds was in control and the data are usable.

Phase I

Average method blank surrogate recoveries (Table 3) were all within 80 to 100% for the volatile analyses. Summaries in Table 4 show average soil and water LCS values range from 94.8% to 104.1%, while all recoveries were within 80 to 120% for the four target compounds.

BTEX sample MS recoveries (Table 5) indicate analytical accuracy was in control with average soil MS recoveries of 105.5%, 97.6%, 97.7%, and 88.2% for benzene, toluene, ethylbenzene, and xylenes, respectively. Average groundwater sample MS recoveries for benzene and toluene were 104.9% and 93.5%, respectively. The wider range of spike recovery observed in actual environmental samples is indicative of matrix heterogeneity variations, especially when dealing with soil matrices.

Phase II

Method blank surrogate recoveries for Phase II analyses (Table 3) were also within 80 to 100% for the volatile analyses. Summaries in Table 4 show average soil and water LCS values range from 88.1% to 104.5%, while all recoveries were within 75 to 120% for the four target compounds.

BTEX sample MS recoveries (Table 5) indicate analytical accuracy was also in control during Phase II activities, with average soil MS recoveries of 94.0%, 108.6%, 87.8%, and 92.4% for benzene, toluene, ethylbenzene, and xylenes, respectively. Average

Table 3. Laboratory Control Sample Evaluation - Method Blank Average Surrogate
Percent Recovery (%Rec)

Analysis	Phase I							
	Soil				Water			
	Average %Rec	Min. %Rec	Max. %Rec	N	Average %Rec	Min. %Rec	Max. %Rec	N
<u>Volatile Organic Compounds (BTEX)</u>								
TOLUENE-d8	-	-	-	-	105.2	86	111	29
BROMOFLUOROBENZENE	-	-	-	-	108.4	89	116	29
DIBROMOFLUOROMETHANE	-	-	-	-	116.8	95	135	29
<u>Volatile Organic Compounds (BTEX)</u>								
n-PROPYLBENZENE (primary column)	101.6	87	136	35	-	-	-	-
n-PROPYLBENZENE (secondary column)	100.6	84	107	35	-	-	-	-
<u>Gasoline Range Organics</u>								
n-PROPYLBENZENE	97.6	47	144	22	94.0	61	110	6
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
NITROBENZENE-d5	62.8	23	96	23	75.5	48	101	26
2-FLUOROBIPHENYL	68.2	37	103	23	77.7	52	90	26
TERPHENYL-d14	90.2	74	103	23	83.4	54	112	26
<u>Diesel Range Organics</u>								
o-TERPHENYL	83.4	58	109	16	81.4	76	89	7

Table 3. (Continued)

Phase II

Analysis	Soil			N	Water			
	Average %Rec	Min. %Rec	Max. %Rec		Average %Rec	Min. %Rec	Max. %Rec	
<u>Volatile Organic Compounds (BTEX)</u>								
TOLUENE-d8	-	-	-	-	104.8	102	109	10
BROMOFLUOROBENZENE	-	-	-	-	105.1	97	112	10
DIBROMOFLUOROMETHANE	-	-	-	-	118.1	112	128	10
<u>Volatile Organic Compounds (BTEX)</u>								
n-PROPYLBENZENE (primary column)	96.5	90	100	10	-	-	-	-
n-PROPYLBENZENE (secondary column)	92.5	59	101	10	-	-	-	-
<u>Gasoline Range Organics</u>								
n-PROPYLBENZENE	91.4	83	105	5	105.0	105	105	2
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
NITROBENZENE-d5	80.6	66	98	9	72.7	56	85	13
2-FLUOROBIPHENYL	83.3	76	95	9	79.8	68	90	13
TERPHENYL-d14	79.0	72	87	9	85.5	65	107	13
<u>Diesel Range Organics</u>								
o-TERPHENYL	91.5	82	98	4	87.5	84	91	2

Table 4. Laboratory Control Sample Evaluation - Method Blank Matrix Spike Average
Percent Recovery (%Rec)

Analysis	Phase I							
	Soil				Water			
	Average %Rec	Min. %Rec	Max. %Rec	N	Average %Rec	Min. %Rec	Max. %Rec	N
<u>Volatile Organic Compounds (BTEX)</u>								
BENZENE	98.3	80	110	51	102.2	94	110	19
TOLUENE	103.0	90	115	51	94.8	87	101	19
ETHYLBENZENE	98.7	85	110	51	-	-	-	-
XYLENES	104.1	88	120	51	-	-	-	-
<u>Gasoline Range Organics</u>								
GRO	91.9	78	108	42	89.0	79	105	4
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
ACENAPTHENE	77.8	47	108	45	79.6	52	94	50
PYRENE	87.5	65	103	45	88.8	53	115	50
<u>Diesel Range Organics</u>								
DRO	57.5	44	73	32	68.5	60	81	10
<u>Total Recoverable Petroleum Hydrocarbon</u>								
TRPH	113.0	102	126	22	102.3	83	121	4

Table 4. (Continued)

Phase II

Analysis	Soil			N	Water		
	Average %Rec	Min. %Rec	Max. %Rec		Average %Rec	Min. %Rec	Max. %Rec
<u>Volatile Organic Compounds (BTEX)</u>							
BENZENE	96.3	89	114	10	104.5	92	118
TOLUENE	96.1	88	116	10	96.6	90	102
ETHYLBENZENE	88.1	77	96	10	-	-	-
XYLENES	96.1	76	106	10	-	-	-
<u>Gasoline Range Organics</u>							
GRO	94.4	81	107	8	88.5	83	94
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>							
ACENAPHTHENE	82.0	74	92	9	86.2	72	96
PYRENE	81.8	67	103	9	92.9	76	102
<u>Diesel Range Organics</u>							
DRO	84.3	71	114	4	76.0	67	85
<u>Total Recoverable Petroleum Hydrocarbon</u>							
TRPH	94.6	74	113	9	75.5	72	79

Table 5. Sample Matrix Spike Evaluation - Average Percent Recovery (%Rec)

Phase I									
Analysis	Soil			Water					
	Average %Rec	Min. %Rec	Max. %Rec	Average %Rec	Min. %Rec	Max. %Rec			
<u>Volatile Organic Compounds (BTEX)</u>									
BENZENE	105.5	80	280	104.9	96	118			34
TOLUENE	97.6	10	210	93.5	86	99			34
ETHYLBENZENE	97.7	70	176	-	-	-			-
XYLENES	88.2	70	128	-	-	-			-
<u>Gasoline Range Organics</u>									
GRO	74.7	6	213	92.5	88	101			4
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>									
ACENAPHTHENE	68.7	22	94	70.1	31	147			26
PYRENE	84.9	23	123	82.0	30	146			26
<u>Diesel Range Organics</u>									
DRO	49.3	8	110	65.7	47	95			10
<u>Total Recoverable Petroleum Hydrocarbon</u>									
TRPH	84.3	76	103	-	-	-			-

Table 5. (Continued)

Phase II

Analysis	Soil			N	Water			N
	Average %Rec	Min. %Rec	Max. %Rec		Average %Rec	Min. %Rec	Max. %Rec	
<u>Volatile Organic Compounds (BTEX)</u>								
BENZENE	94.0	80	104	14	98.4	83	119	14
TOLUENE	108.6	86	142	14	97.2	92	102	14
ETHYLBENZENE	87.8	72	97	14	-	-	-	-
XYLENES	92.4	66	104	12	-	-	-	-
<u>Gasoline Range Organics</u>								
GRO	72.2	69	84	6	46.5	46	47	2
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
ACENAPHTHENE	85.1	70	93	14	75.5	60	94	10
PYRENE	87.6	62	104	14	82.8	43	113	10
<u>Diesel Range Organics</u>								
DRO	78.0	77	79	2	88.0	71	114	4
<u>Total Recoverable Petroleum Hydrocarbon</u>								
TRPH	77.9	63	105	6	-	-	-	-

groundwater sample MS recoveries for benzene and toluene were 98.4% and 97.2%, respectively. Phase II analyses exhibited only a slightly wider range for sample matrix spike recovery than LCS results, with a low of 66% and a high of 142%. The wider range of spike recovery observed in actual environmental samples is indicative of matrix heterogeneity variations, especially when dealing with soil matrices.

Polyaromatic Hydrocarbon Compounds

Phase I

Average LCS percent recovery values for PAH compounds in soils and waters range from 77.8% to 88.8%. These values are well within the normally accepted advisory limits established by the analytical methods. They are also within project accuracy goals of 30 to 140% for semivolatile compounds. None of the soil data required qualification based on the LCS, while only a few of the groundwater samples required qualification as estimated due to low LCS recoveries. Method blank surrogate recoveries (Table 3) were all well within acceptable ranges for semivolatile compounds. Re-enforcing the analytical process was in control.

Sample MS information (Table 5) for PAH compounds parallels LCS data, with the overall accuracy for these measurements being considered acceptable.

Phase II

Method blank surrogate recoveries, LCS values, and sample matrix spike recoveries combine to document the overall accuracy of Phase II data. As presented in Tables 3, 4, and 5, method blank surrogate average recoveries range from 72.7% to 85.5%, LCS average recovery values range from 81.8% to 92.9%, while sample MS recoveries range from 74.5% to 76.6%.

Gasoline Range, Diesel Range, and Total Recoverable Petroleum Hydrocarbons

Phase I and II

The laboratory analytical process for these measurements in both Phase I and Phase II was demonstrated to be under control by maintaining a general 50 to 150% LCS percent recovery for both water and soil matrices. Average method blank surrogate recoveries were maintained in the range of 80 to 120%.

Matrix spike information demonstrated acceptable accuracy control for both soils and waters. A few low soil MS recovery values did cause some data to be estimated. During data use and interpretation, these values present the possibility of providing false negative results and must be interpreted relative to validation flags placed on the data.

4.2 Precision

Laboratory Precision

As a measure of analytical precision, Tables 6 and 7 contain average relative percent differences (RPD) for laboratory duplicate sample pairs for the various analytical groups. Data are presented for parameters where both values meet or exceed five times the project required detection limits for that analyte. TRPH duplicate pairs evaluate actual sample concentrations while other organic duplicate pairs compare MS and MSD values. As the RPD approaches zero, complete agreement is achieved between the duplicate sample pairs. Sample homogeneity, analytical method performance, and the quantity of the analyte being measured all contribute to this measure of sample analytical precision.

Soil and water precision are considered acceptable when the RPD does not exceed 40. This limit was not exceeded for most analytes. All average RPD values were well within this criteria, with only one average RPD exceeding 15%. In only a few instances did individual duplicate comparisons fall outside the criteria as demonstrated by the maximum RPDs presented. RPD values are quite good for these samples and reflect great effort on the part of the field and laboratory teams to homogenize the samples prior to aliquotting and analysis.

Duplicate comparison for those data within five times the reporting level have also been reviewed and evaluated. Acceptance limits for these data were set at \pm two times the reporting level. In all cases, laboratory duplicate comparison at these low levels were in agreement.

Individual data points affected by poor precision measures appear in the data set qualified as estimated, when necessary. The precision for those data is considered acceptable and has been determined to be useable for project objectives.

Field Precision

Field duplicate samples were collected to ascertain the contribution to variability (i.e., precision) due to the combination of environmental media, sampling consistency, and analytical precision. Field duplicate samples were collected from the same spatial and temporal conditions as the primary environmental sample. Soil samples were collected from the same sampling device after homogenization for all analytes except BTEX.

Tables 8 and 9 provide a summary of soil and groundwater field duplicate comparisons by analyte. The tables present both absolute difference and RPD evaluations for field duplicate measurements. RPD was calculated only when both samples were >5 times the analyte reporting level. When one or both sample values were between the quantitation level and 5 times the analyte reporting level, the absolute difference was evaluated. If both samples were not detected for a given analyte, precision was considered acceptable. Only duplicate pairs having measurable values are included in the tabulation.

Table 6. Laboratory Control Sample Evaluation - Method Blank Matrix Spike
Duplicate Relative Percent Difference (RPD)

Analysis	Phase I									
	Soil					Water				
	Average RPD	Min. RPD	Max. RPD	N		Average RPD	Min. RPD	Max. RPD	N	
<u>Volatile Organic Compounds (BTEX)</u>										
BENZENE	7.6	0	22	18		-	-	-	-	
TOLUENE	7.0	0	20	18		-	-	-	-	
ETHYLBENZENE	7.9	0	21	18		-	-	-	-	
XYLENES	6.7	0	17	18		-	-	-	-	
<u>Gasoline Range Organics</u>										
GRO	7.3	0	24	21		12.0	6	18	2	
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>										
ACENAPHTHENE	10.6	1	50	21		8.0	0	35	24	
PYRENE	6.6	2	19	21		7.7	0	36	24	
<u>Diesel Range Organics</u>										
DRO	5.8	0	13	16		9.6	3	17	5	
<u>Total Recoverable Petroleum Hydrocarbon</u>										
TRPH	6.7	4	13	11		5.7	5	7	2	

Table 6. (Continued)

Analysis	Phase II									
	Soil					Water				
	Average RPD	Min. RPD	Max. RPD	N		Average RPD	Min. RPD	Max. RPD	N	
<u>Volatile Organic Compounds (BTEX)</u>										
BENZENE	4.0	3	5	2		-	-	-	-	
TOLUENE	5.5	5	6	2		-	-	-	-	
ETHYLBENZENE	1.0	1	1	1		-	-	-	-	
XYLENES	0.0	0	0	1		-	-	-	-	
<u>Gasoline Range Organics</u>										
GRO	9.3	4	12	4		12.0	12	12	1	
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>										
ACENAPHTHENE	-	-	-	-		-	-	-	-	
PYRENE	-	-	-	-		-	-	-	-	
<u>Diesel Range Organics</u>										
DRO	-	-	-	-		-	-	-	-	
<u>Total Recoverable Petroleum Hydrocarbon</u>										
TRPH	4.3	1	10	3		9.0	9	9	1	

Table 7. Sample Matrix Spike Duplicate or Duplicate Evaluation - Relative Percent Difference (RPD)

Analysis	Phase I							
	Soil				Water			
	Average RPD	Min. RPD	Max. RPD	N	Average RPD	Min. RPD	Max. RPD	N
<u>Volatile Organic Compounds (BTEX)</u>								
BENZENE	6.2	0	21	21	3.9	0	9	17
TOLUENE	13.2	0	133	21	1.4	0	4	17
ETHYLBENZENE	7.0	0	22	21	-	-	-	-
XYLENES	8.0	0	24	21	-	-	-	-
<u>Gasoline Range Organics</u>								
GRO	26.9	0	162	15	10.0	6	14	2
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
ACENAPHTHENE	8.5	0	26	21	12.3	0	57	13
PYRENE	8.2	0	28	21	14.5	0	58	13
<u>Diesel Range Organics</u>								
DRO	38.2	8	86	9	9.4	0	22	5
<u>Total Recoverable Petroleum Hydrocarbon</u>								
TRPH	11.8	0	29	14	-	-	-	-

Table 7. (Continued)

Phase II

Analysis	Soil			Water		
	Average RPD	Min. RPD	Max. RPD	Average RPD	Min. RPD	Max. RPD
<u>Volatile Organic Compounds (BTEX)</u>						
BENZENE	3.7	0	7	4.9	1	10
TOLUENE	8.1	2	17	2.9	0	10
ETHYLBENZENE	5.2	2	8	-	-	-
XYLENES	4.3	0	9	-	-	-
<u>Gasoline Range Organics</u>						
GRO	9.7	1	24	2.0	2	1
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>						
ACENAPHTHENE	4.4	1	17	9.4	0	19
PYRENE	7.5	2	16	5.2	1	11
<u>Diesel Range Organics</u>						
DRO	2.0	2	2	8.5	1	16
<u>Total Recoverable Petroleum Hydrocarbon</u>						
TRPH	-	-	-	-	-	-

Table 8. Soil Field Duplicate Evaluation - Relative Percent Difference (RPD) and Absolute Difference

Phase I Analysis	Area A 0101A1/0101A3 RPD(%)	Area C 0304A1/0304A3 RPD(%)	Area C 0304B1/0304B3 RPD(%)	Area E/F 1505B1/1505B3 RPD(%)	Area H 1803D1/1803D3 RPD(%)	Area K 2203B1/2203B3 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>						
BENZENE	*	*	*	*	*	*
TOLUENE	*	*	*	*	97	*
ETHYLBENZENE	*	*	UNAC	*	*	*
XYLENES	27	98	126	*	*	*
<u>Gasoline Range Organics</u>	-	114	5	2	*	-
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>						
NAPHTHALENE	*	*	*	*	*	*
2-CHLORONAPHTHALENE	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*
FLUORENE	*	*	*	*	*	*
PHENANTHRENE	*	*	*	*	*	*
ANTHRACENE	*	*	*	*	*	*
FLUORANTHENE	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*
BENZO(a)ANTHRACENE	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*
BENZO(g)PYRENE	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*
<u>Diesel Range Organics</u>	-	*	*	*	*	-
<u>Total Petroleum Hydrocarbon</u>	59	-	-	-	-	*

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.
 UNAC Unacceptable = At least one value is >5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 8. (Continued)

Phase I Analysis		Area K	Area N	Area N	Area N	Area R	Area R	Area T
		2203C1/2203C3	3001B1/3001B3	3001D1/3001D3	3401A1/3401A3	3401C1/3401C3	3903C1/3903C3	
		RPD(%)	RPD(%)	RPD(%)	RPD(%)	RPD(%)	RPD(%)	
<u>Volatile Organic Compounds (BTEX)</u>								
BENZENE		*	101	132	*	*	*	*
TOLUENE		3	63	*	*	*	*	*
ETHYLBENZENE		*	52	187	*	38	*	*
XYLENES		*	76	*	*	9	*	*
<u>Gasoline Range Organics</u>								
		-	28	118	56	5	*	*
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>								
NAPHTHALENE		*	*	*	*	*	*	*
2-CHLORONAPHTHALENE		*	*	*	*	*	*	*
ACENAPHTHYLENE		*	*	*	*	*	*	*
ACENAPHTHENE		*	*	*	*	*	*	*
FLUORENE		*	*	*	*	*	*	*
PHENANTHRENE		*	*	*	*	*	*	*
ANTHRACENE		*	*	*	*	*	42	*
FLUORANTHENE		*	*	*	*	103	*	*
PYRENE		*	*	114	*	*	*	*
BENZO(a)ANTHRACENE		*	*	115	*	*	*	*
CHRYSENE		*	*	*	*	*	*	*
BENZO(b)FLUORANTHENE		*	*	*	*	*	*	*
BENZO(k)FLUORANTHENE		*	*	*	*	*	*	*
BENZO(e)PYRENE		*	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE		*	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE		*	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE		*	*	*	*	*	*	*
<u>Diesel Range Organics</u>								
		-	UNAC	13	126	135	38	
<u>Total Petroleum Hydrocarbon</u>								
		*	-	-	-	-	-	-

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.

UNAC Unacceptable = At least one value is >5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 8. (Continued)

Phase I Analysis	Area T 4002C1/4002C3 RPD(%)	Area T 4002D1/4002D3 RPD(%)	Area V 4203B1/4203B3 RPD(%)	Area V 4203D1/4203D3 RPD(%)	Area W 4401A1/4401A3 RPD(%)	Area W 4401B1/4401B3 RPD(%)	Area Y 5401E1/5401E3 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>							
BENZENE	*	*	74	*	*	*	*
TOLUENE	*	*	81	*	*	*	UNAC
ETHYLBENZENE	95	40	48	*	*	*	82
XYLENES	103	18	45	*	*	*	120
<u>Gasoline Range Organics</u>	-	-	5	17	-	-	67
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>							
NAPHTHALENE	*	5	35	*	*	*	4
2-CHLORONAPHTHALENE	*	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*	*
ACENAPHTHENE	55	*	29	*	*	*	*
FLUORENE	*	*	*	*	*	*	*
PHENANTHRENE	*	35	48	*	*	*	5
ANTHRACENE	*	*	*	*	*	*	*
FLUORANTHENE	*	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*	6
BENZO(a)ANTHRACENE	*	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*	*
BENZO(a)PYRENE	*	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*	*
<u>Diesel Range Organics</u>	-	-	83	*	-	-	81
<u>Total Petroleum Hydrocarbon</u>	54	19	-	-	46	13	-

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.

UNAC Unacceptable = At least one value is >5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 8. (Continued)

Phase II Analysis	Area D 0803A1/0803A3 RPD(%)	Area D 0803B1/0803B3 RPD(%)	Area M 2603A1/2603A3 RPD(%)	Area M 2603C1/2603C3 RPD(%)	Area N 3005A1/3005A3 RPD(%)	Area N 3005B1/3005B3 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>						
BENZENE	*	*	*	*	*	*
TOLUENE	*	59	7	*	108	*
ETHYLBENZENE	*	*	*	*	*	67
XYLENES	*	*	*	*	7	104
<u>Gasoline Range Organics</u>	-	-	-	-	48	49
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>						
NAPHTHALENE	*	*	*	*	*	11
2-CHLORONAPHTHALENE	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*
ACENAPHTHENE	*	*	*	*	*	*
FLUORENE	*	*	*	*	*	*
PHENANTHRENE	*	*	*	*	*	*
ANTHRACENE	*	*	*	*	*	*
FLUORANTHENE	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*
BENZO(a)ANTHRACENE	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*
BENZO(a)PYRENE	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*
<u>Diesel Range Organics</u>	-	-	-	-	3	39
<u>Total Petroleum Hydrocarbons</u>	*	135	48	22	-	*

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.

UNAC Unacceptable = At least one value is >5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 8. (Continued)

Phase II Analysis	Area Q 3303A1/3303A3 RPD(%)	Area Q 3303C1/3303C3 RPD(%)	Area V 4305B1/4305B3 RPD(%)	Area V 4305C1/4305C3 RPD(%)	Area X 4805B1/4805B3 RPD(%)	Area X 4805C1/4805C3 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>						
BENZENE	*	*	*	*	*	*
TOLUENE	*	*	107	UNAC	*	*
ETHYLBENZENE	*	*	*	*	5	*
XYLENES	*	*	22	*	45	95
<u>Gasoline Range Organics</u>	-	-	-	-	3	4
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>						
NAPHTHALENE	*	*	*	*	67	*
2-CHLORONAPHTHALENE	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*
ACENAPHTHENE	*	*	*	*	34	*
FLUORENE	*	*	*	*	*	*
PHENANTHRENE	*	*	*	*	174	*
ANTHRACENE	*	*	*	*	38	*
FLUORANTHENE	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*
BENZO(g)ANTHRACENE	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*
BENZO(e)PYRENE	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*
<u>Diesel Range Organics</u>	-	-	-	-	51	1
<u>Total Petroleum Hydrocarbon</u>	1	-	83	*	-	-

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.

UNAC Unacceptable = At least one value is <5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 9. Groundwater Field Duplicate Evaluation - Relative Percent Difference (RPD)
and Absolute Difference

Phase I Analysis	Area D	Area D	Area E/F	Area I	Area M	Area N	Area R
	0802W2/0802W4 RPD(%)	1302W2/1302W4 RPD(%)	1506W2/1506W4 RPD(%)	1901W2/1901W4 RPD(%)	2602W2/2602W4 RPD(%)	3002W2/3002W4 RPD(%)	3402W2/3402W4 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>							
BENZENE	*	*	14	*	*	*	*
TOLUENE	*	*	*	*	6	*	*
ETHYLBENZENE	*	*	*	*	3	*	*
XYLENES	*	*	*	*	4	*	*
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>							
NAPHTHALENE	*	*	*	*	41	*	*
2-CHLORONAPHTHALENE	*	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*	*
ACENAPHTHENE	*	*	*	*	*	*	*
FLUORENE	*	*	*	*	51	*	*
PHENANTHRENE	*	*	*	*	*	*	*
ANTHRACENE	*	*	*	*	*	*	*
FLUORANTHENE	*	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*	*
BENZO(a)ANTHRACENE	*	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*	*
BENZO(a)PYRENE	*	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*	*

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.
UNAC Unacceptable = At least one value is >5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

Table 9. (Continued)

Phase II Analysis	Area D 1003W2/1003W4 RPD(%)	Area M 2505W2/2505W4 RPD(%)	Area O 2803W2/2803W4 RPD(%)	Area T 4003W2/4003W4 RPD(%)	Area W 4705W2/4705W4 RPD(%)	Area Y 5303W2/5303W4 RPD(%)
<u>Volatile Organic Compounds (BTEX)</u>						
BENZENE	*	*	*	*	*	*
TOLUENE	*	*	*	*	*	*
ETHYLBENZENE	*	*	*	*	*	*
XYLENES	*	*	*	*	*	*
<u>Polycyclic Aromatic Hydrocarbons (PAHs)</u>						
NAPHTHALENE	*	*	*	*	*	*
2-CHLORONAPHTHALENE	*	*	*	*	*	*
ACENAPHTHYLENE	*	*	*	*	*	*
ACENAPHTHENE	*	*	*	*	*	*
FLUORENE	*	*	*	*	*	*
PHENANTHRENE	*	*	*	*	*	*
ANTHRACENE	*	*	*	*	*	*
FLUORANTHENE	*	*	*	*	*	*
PYRENE	*	*	*	*	*	*
BENZO(a)ANTHRACENE	*	*	*	*	*	*
CHRYSENE	*	*	*	*	*	*
BENZO(b)FLUORANTHENE	*	*	*	*	*	*
BENZO(k)FLUORANTHENE	*	*	*	*	*	*
BENZO(a)PYRENE	*	*	*	*	*	*
INDENO(1,2,3-cd)PYRENE	*	*	*	*	*	*
DIBENZO(a,h)ANTHRACENE	*	*	*	*	*	*
BENZO(g,h,i)PERYLENE	*	*	*	*	*	*

* Acceptable = At least one value is <5X the reported detection level and duplicate comparison is within 3X the reported detection level.

UNAC Unacceptable = At least one value is <5X the reported detection level and duplicate comparison is greater than 3X the reported detection level.

In order to review information, this data quality assessment has implemented general criteria for comparison of absolute difference measurements and RPDs. RPD criteria are identified below. Absolute difference criteria were set at three times the analyte reporting level.

RPD Evaluation Categories

Matrix	Good	Fair	Poor	Unacceptable
Water	< 30%	< 60%	< 100%	> 100%
Soil	< 50%	< 90%	< 150%	> 150%

Soil field duplicate RPDs are considered Fair (51 % = Good; 23 % = Fair; 24 % = Poor, and 2 % = Unacceptable), while absolute differences were predominantly within three times the analyte reporting level criteria. Most groundwater analyte concentrations were not high enough to provide RPD evaluation, however, absolute difference considerations indicate a Good comparison for the data.

4.3 Sensitivity

Determination of minimum detectable values allows the investigation to assess the relative confidence that can be placed in a value relative to the magnitude or level of analyte concentration observed. The closer a measured value comes to the minimum detectable concentration, the less confidence and more variation the measurement will have. Project sensitivity goals were expressed as quantitation level goals in the CDAP. These levels were achieved or exceeded throughout the analytical process. There were individual exceptions that have generated qualification of the data or elevation of detections levels when the original goal was not achieved. Variations observed were caused by fluctuations in moisture content or the need to dilute high concentration analytes into linear range for analysis.

Variations in observed detection levels may affect the usability of some of the data for the project. Moisture content and blank levels did not impact data usability, however, high levels of individual compounds did impact reported detection levels for benzene and other organic compounds. In several instances, dilution factors of 100 were required to bring contaminant concentrations into their analytical linear ranges. These levels of contamination decreased the analytical sensitivity for the other analyses in that sample fraction.

Table 10 provides an overview of elevated detection level frequency for the project. Individual data point interpretation must consider the impact of elevated detection levels, however, the low percentages of elevated detection levels produced during these studies should minimize these issues. Less than 2% of BTEX data exhibit elevated detection

Table 10. Frequency of Elevated Detection Levels

Phase I - Soil

Analyte	Units	Detection Level	Total Number of Non-detects	2 - 10 X Detection Level	10 - 100 X Detection Level	> 100 X Detection Level
BTEX Compounds						
Benzene	UG/KG	5.00000	293	8	15	0
Ethylbenzene	UG/KG	5.00000	260	1	0	0
Toluene	UG/KG	5.00000	197	3	9	0
Xylenes, Total	UG/KG	5.00000	227	3	0	0
Gasoline Range Organics						
TPH-Gasoline Range Organics	UG/KG	102.00000	82	1	0	0
Polynuclear Aromatic Hydrocarbons						
2-Chloronaphthalene	UG/KG	330.00000	311	10	14	2
Acenaphthene	UG/KG	330.00000	302	10	11	0
Acenaphthylene	UG/KG	330.00000	309	10	13	2
Anthracene	UG/KG	330.00000	310	10	14	2
Benzo(a)anthracene	UG/KG	330.00000	307	9	14	2
Benzo(a)pyrene	UG/KG	330.00000	310	10	14	2
Benzo(b)fluoranthene	UG/KG	330.00000	304	9	13	2
Benzo(g,h,i)perylene	UG/KG	330.00000	310	9	15	2
Benzo(k)fluoranthene	UG/KG	330.00000	306	9	14	2
Chrysene	UG/KG	330.00000	307	9	14	2
Dibenzo(a,h)anthracene	UG/KG	330.00000	313	10	15	2
Fluoranthene	UG/KG	330.00000	298	9	11	2
Fluorene	UG/KG	330.00000	308	10	14	2
Indeno(1,2,3-cd)pyrene	UG/KG	330.00000	300	9	14	2
Naphthalene	UG/KG	330.00000	295	8	11	1
Phenanthrene	UG/KG	330.00000	293	8	9	1
Pyrene	UG/KG	330.00000	291	9	10	2

Phase II - Soil

BTEX Compounds						
Benzene	UG/KG	5.10	99	1	0	6
Ethylbenzene	UG/KG	5.10	91	0	0	2
Toluene	UG/KG	5.20	34	0	0	6
Xylenes, Total	UG/KG	5.10	86	0	0	0
Polynuclear Aromatic Hydrocarbons						
2-Chloronaphthalene	UG/KG	335.00	104	0	3	1
Acenaphthene	UG/KG	335.00	104	0	3	1
Acenaphthylene	UG/KG	335.00	104	0	3	1
Anthracene	UG/KG	335.00	104	0	3	1
Benzo(a)anthracene	UG/KG	335.00	105	0	3	1
Benzo(a)pyrene	UG/KG	335.00	105	0	3	1
Benzo(b)fluoranthene	UG/KG	335.00	105	0	3	1
Benzo(g,h,i)perylene	UG/KG	335.00	106	0	3	1
Benzo(k)fluoranthene	UG/KG	335.00	106	0	3	1
Chrysene	UG/KG	335.00	105	0	3	1
Dibenzo(a,h)anthracene	UG/KG	335.00	106	0	3	1
Fluoranthene	UG/KG	335.00	103	0	3	1
Fluorene	UG/KG	335.00	104	0	3	1
Indeno(1,2,3-cd)pyrene	UG/KG	335.00	106	0	3	1
Naphthalene	UG/KG	335.00	100	0	3	1
Phenanthrene	UG/KG	335.00	83	0	1	1
Pyrene	UG/KG	335.00	103	0	3	1

Table 10. (Continued)

Phase I - Waters

Analyte	Units	Detection Level	Total Number of Non-detects	2 - 10 X Detection Level	10 - 100 X Detection Level	> 100 X Detection Level
BTEX Compounds						
Benzene	UG/L	5.00000	99	1	2	1
Ethylbenzene	UG/L	5.00000	103	1	0	0
Toluene	UG/L	5.00000	17	0	0	0
Xylenes, Total	UG/L	5.00000	102	1	0	1
Polynuclear Aromatic Hydrocarbons						
2-Chloronaphthalene	UG/L	8.40000	176	9	24	4
Acenaphthene	UG/L	8.40000	169	9	22	4
Acenaphthylene	UG/L	8.40000	175	9	23	4
Anthracene	UG/L	8.40000	171	9	22	4
Benzo(a)anthracene	UG/L	8.40000	174	9	23	4
Benzo(a)pyrene	UG/L	8.40000	172	9	24	4
Benzo(b)fluoranthene	UG/L	8.40000	174	9	23	4
Benzo(g,h,i)perylene	UG/L	8.40000	174	9	23	4
Benzo(k)fluoranthene	UG/L	8.40000	175	9	24	4
Chrysene	UG/L	8.40000	173	9	22	4
Dibenzo(a,h)anthracene	UG/L	8.40000	176	9	24	4
Fluoranthene	UG/L	8.40000	166	9	19	4
Fluorene	UG/L	8.40000	161	8	18	3
Indeno(1,2,3-cd)pyrene	UG/L	8.40000	175	9	24	4
Naphthalene	UG/L	8.40000	136	6	10	1
Phenanthrene	UG/L	8.40000	151	7	13	1
Pyrene	UG/L	8.40000	162	9	17	3

Phase II - Waters

BTEX Compounds						
Benzene	UG/L	5.00	43	0	0	0
Ethylbenzene	UG/L	5.00	42	0	0	0
Toluene	UG/L	5.00	5	0	0	0
Xylenes, Total	UG/L	5.00	43	0	0	0
Polynuclear Aromatic Hydrocarbons						
2-Chloronaphthalene	UG/L	10.00	47	2	2	1
Acenaphthene	UG/L	10.00	47	2	2	1
Acenaphthylene	UG/L	10.00	47	2	2	1
Anthracene	UG/L	10.00	47	2	2	1
Benzo(a)anthracene	UG/L	10.00	47	2	2	1
Benzo(a)pyrene	UG/L	10.00	45	2	2	1
Benzo(b)fluoranthene	UG/L	10.00	47	2	2	1
Benzo(g,h,i)perylene	UG/L	10.00	47	2	2	1
Benzo(k)fluoranthene	UG/L	10.00	47	2	2	1
Chrysene	UG/L	10.00	47	2	2	1
Dibenzo(a,h)anthracene	UG/L	10.00	47	2	2	1
Fluoranthene	UG/L	10.00	47	2	2	1
Fluorene	UG/L	10.00	47	2	2	1
Indeno(1,2,3-cd)pyrene	UG/L	10.00	47	2	2	1
Naphthalene	UG/L	10.00	44	2	2	1
Phenanthrene	UG/L	10.00	47	2	2	1
Pyrene	UG/L	10.00	47	2	2	1

levels greater than 10X the norm, with approximately 8% of the PAH data exhibiting elevated detection levels greater than 10X the norm.

Evaluation of overall project sensitivity can be gained through review of field blank information. These actual sample analyses may provide a comprehensive look at the combined sampling and analysis sensitivity attained by the project. Field QC blanks obtained during sampling activities included samples of VOC trip blank waters and samples of the final equipment decontamination rinse water. Summary information for those blank determinations exhibiting detectable levels is presented in Table 11.

There were a minimal number of detected VOCs in project trip blanks. These were all below their associated reporting levels and only just above the laboratory instrument detection levels. These levels are not considered significant and have not caused data qualification. Table 11 provides a list of those analytes observed in field blank samples. It is therefore determined that VOC analysis has not been affected through the transportation and storage process, and that the procedures and precautions used were effective in preserving the integrity of the sample analysis.

Equipment rinsates document that effective decontamination of equipment has been performed for those contaminants of primary interest to the project. No VOC or metal parameters were above their associated reporting levels and only minor levels were reported above the laboratory instrument detection levels. There is no indication that cross-contamination has occurred nor has any data been qualified relative to these rinsates (Table 11).

4.4 Representativeness and Comparability

Representativeness expresses the degree to which data accurately reflect the analyte or parameter of interest for the environmental site and is the qualitative term most concerned with the proper design of the sampling program. Factors that affect the representativeness of analytical data include proper preservation, holding times, use of standard sampling and analytical methods, and determination of matrix or analyte interferences. No data points were rejected based on extended holding times, while only a few analyses were estimated and qualified. Sample preservation, analytical methodologies, and soil sampling methodologies were documented to be adequate and consistently applied. Both soil and groundwater sampling methods have been proven to be an effective application for this study.

Comparability, like representativeness, is a qualitative term relative to a project data set as an individual. The UST investigations used appropriate sampling methodologies, site surveillance, use of standard sampling devices, uniform training, documentation of sampling, standard analytical protocols/procedures, QC checks with standard control limits, and universally accepted data reporting units to ensure comparability to other data sets. Through the proper implementation and documentation of these standard practices,

Table 11. Field Blank Detected Values

Phase I**Trip Blank**

Area	Sample ID	Date Collected	Analyte	Results	Units	Qual
Tank Area D	FB0010	09/07/96	Toluene	0.19	UG/L	J
Tank Area Y	TB0050	09/21/96	Xylenes, Total	0.34	UG/L	J

Equipment Rinsate

Area	Sample ID	Date Collected	Analyte	Results	Units	Qual
Tank Area C	0302R6	09/07/96	Toluene	2.4	UG/L	J
Tank Area S	3804R5	09/17/96	TPH-Diesel Range Organics	.041	MG/L	-
Tank Area X	4804R5	09/17/96	TPH-Diesel Range Organics	0.043	MG/L	-

Phase II**Trip Blank**

Area	Sample ID	Date Collected	Analyte	Results	Units	Qual
	TB0071	12/15/96	Toluene	0.68	UG/L	J
	TB0072	12/15/96	Toluene	0.73	UG/L	J
	TB0073	12/15/96	Toluene	0.58	UG/L	J
	TB0075	12/16/96	Toluene	0.22	UG/L	J

Equipment Rinsate

Area	Sample ID	Date Collected	Analyte	Results	Units	Qual
Tank Area M	2404R5	12/10/96	Toluene	0.14	UG/L	J
Tank Area N	3003R6	12/11/96	Toluene	0.16	UG/L	J

the project has established the confidence that the data will be comparable to other project and programmatic information.

4.5 Completeness

Usable data are defined as those data that pass individual scrutiny during the verification and validation process and are accepted for unrestricted application to the human health risk assessment evaluation or equivalent type applications. It has been determined that estimated data are acceptable for the UST project objectives.

Objectives for the UST investigations have been achieved. The project produced valid results for over 99% of the sample analyses performed and successfully collected all required investigation samples.

5.0 DATA QUALITY ASSESSMENT SUMMARY

The overall quality of Fort Stewart preliminary groundwater and CAP-Part A investigation information meets or exceeds the established project objectives. Through proper implementation of the project data verification, validation, and assessment process, project information has been determined to be acceptable for use.

Data, as presented, have been qualified as usable, but estimated when necessary. Data that have been estimated provide indications of either accuracy, precision, or sensitivity being less than desired but adequate for interpretation.

Data produced for these studies demonstrate that they can withstand scientific scrutiny, are appropriate for intended purpose, are technically defensible, and are of known and acceptable sensitivity, precision, and accuracy. Data integrity has been documented through proper implementation of QA/QC measures. The environmental information presented has an established confidence that allows use for the project objectives and provides data for future needs.

6.0 REFERENCES

SAIC (Science Applications International Corporation) 1995. *Data Validation Guidelines for Analytical Data*, Quality Assurance Technical Procedure TP-DM-300-7, Rev. 1.

Work Plan for Preliminary Groundwater and Corrective Action Plan - Part A & Part B Investigations at Former Underground Storage Tank Sites, Fort Stewart, Georgia, August 1996.

ATTACHMENT 1
to
APPENDIX C-3

SAIC VALIDATION FLAGGING CODES



DATA VALIDATION FLAGGING CODES

Blanks

- F01 Sample data were qualified as a result of the method blank.
- F02 Sample data were qualified as a result of the field blank.
- F03 Sample data were qualified as a result of the equipment rinse.
- F04 Sample data were qualified as a result of the trip blank.
- F05 Gross contamination exists.
- F06 Concentration of the contaminant was detected at a level below the CRQL.
- F07 Concentration of the contaminant was detected at a level less than the action limit, but greater than the CRQL.
- F08 Concentration of the contaminant was detected at a level that exceeds the action level.
- F09 No laboratory blanks were analyzed.
- F10 Blank had a negative value $> 5 \times$ the IDL.
- F11 Blanks were not analyzed at required frequency.
- F12 Professional judgement was used to qualify the data.

Surrogate Recovery

- G01 Surrogate recovery was above the upper control limit.
- G02 Surrogate recovery was below the lower control limit.
- G03 Surrogate recovery was $< 10\%$.
- G04 Surrogate recovery was zero.
- G05 Surrogate was not present.
- G06 Professional judgement was used to qualify the data.

Matrix Spike/Matrix Spike Duplicate

- H01 MS/MSD recovery was above the upper control limit.
- H02 MS/MSD recovery was below the lower control limit.
- H03 MS/MSD recovery was $< 10\%$.
- H04 MS/MSD pairs exceed the RPD limit.
- H05 No action was taken on MS/MSD results.
- H06 Professional judgement was used to qualify the data.

Matrix Spike

- I01 MS recovery was above the upper control limit.
- I02 MS recovery was below the lower control limit.
- I03 MS recovery was $< 30\%$.
- I04 No action was taken on MS data.
- I05 Professional judgement was used to qualify the data.

Laboratory Duplicate

- J01 Duplicate RPD was outside the control limit.
- J02 Duplicate sample results were $> 5 \times$ the CRDL.
- J03 Duplicate sample results were $< 5 \times$ the CRDL.
- J04 Professional judgement was used to qualify the data.

Internal Area Summary

- K01 Area counts were outside the control limits.
- K02 Extremely low area counts or performance was exhibited by a major drop off.
- K03 IS retention time varied by more than 30 seconds.
- K04 Professional judgement was used to qualify the data.

Laboratory Control Samples (LCSs)

- P01 LCS recovery was above upper control limit.
- P02 LCS recovery was below lower control limit.
- P03 LCS recovery was $< 50\%$.
- P04 No action was taken on the LCS data.
- P05 LCS was not analyzed at required frequency.

Target Compound Identification

- M01 Incorrect identifications were made.
- M02 Qualitative criteria were not met.
- M03 Cross contamination occurred.
- M04 Confirmatory analysis was not performed.
- M05 No results were provided.
- M06 Analysis occurred outside 12 hr GC/MS window.
- M07 Professional judgement was used to qualify the data.
- M08 The %D between the two pesticide/PCB column checks was $> 25\%$.

Initial/Continuing Calibration - Organics

- C01 Initial calibration RRF was < 0.05 .
- C02 Initial calibration RSD was $> 30\%$.
- C03 Initial calibration sequence was not followed as required.
- C04 Continuing calibration RRF was < 0.05 .
- C05 Continuing calibration %D was $> 25\%$.
- C06 Continuing calibration was not performed at the required frequency.
- C07 Resolution criteria were not met.
- C08 RPD criteria were not met.
- C09 RSD criteria were not met.
- C10 Retention time of compounds was outside windows.
- C11 Compounds were not adequately resolved.
- C12 Breakdown of endrin or DDT was $> 20\%$.
- C13 Combined breakdown of endrin/DDT was $> 30\%$.
- C14 Professional judgement was used to qualify the data.

APPENDIX D

DOCUMENTATION OF WATER SUPPLY SURVEY FOR THE FORT STEWART GARRISON AREA



**FORT STEWART DIRECTORATE OF PUBLIC WORKS
SUMMARY OF WATER SUPPLY WELL INFORMATION**

Well No. 1:

1750 gallons per minute
Water Tank Storage Capacity - 300,000 gallons
High Water Elevation - 149.5 feet
Overflow - 144 feet
Pump Outlet - 93.43 feet

Well No. 2:

No Operational Information Available

Well No. 3:

1400 gallons per minute
Pump Elevation - 71.0 feet

Well No. 4:

1400 gallons per minute

Well No. 5:

500 gallons per minute
100 HP Electric Pump
200 PSI Pressure
Water Tank Storage Capacity - 25,000 gallons

Water Tower:

Hero Road near Davis Avenue
Storage Capacity - 250,000 gallons
Well Number and Operational Information Not Available

Well No. 8:

No Operational Information Available
Water Tank Storage Capacity - 250,000 gallons



APPENDIX E

**SITE RANKING FORM
FOR FACILITY ID #9-089088**



APPENDIX II

SITE RANKING FORM

1. Soil Contamination

- | a. | Total PAHs -
Maximum Concentration | b. | Total BTEX -
Maximum Concentration |
|-------------------------------------|---|-------------------------------------|---|
| <input type="checkbox"/> | > 10 mg/kg = 50 | <input type="checkbox"/> | > 150 mg/kg = 50 |
| <input type="checkbox"/> | 1 - 10 mg/kg = 25 | <input type="checkbox"/> | 50 - 149.9 mg/kg = 40 |
| <input checked="" type="checkbox"/> | 0.66 - 0.99 mg/kg = 10 | <input type="checkbox"/> | 10 - 49.9 mg/kg = 25 |
| <input type="checkbox"/> | < 0.660 = 0 | <input type="checkbox"/> | 0.5 - 9.9 mg/kg = 10 |
| | | <input checked="" type="checkbox"/> | 0.005 - .499 mg/kg = 1 |
| | | <input type="checkbox"/> | <0.005 mg/kg = 0 |
-
- | c. | Depth to Groundwater (bls =
Below Land Surface) |
|-------------------------------------|--|
| <input checked="" type="checkbox"/> | < 10' bls = 10 |
| <input type="checkbox"/> | 10' - 25' bls = 5 |
| <input type="checkbox"/> | 25' - 50' bls = 2 |
| <input type="checkbox"/> | >50' bls = 1 |

2. Groundwater Contamination

- | a. | Free Product (Nonaqueous-phase
liquid hydrocarbons) | b. | Dissolved Benzene -
Maximum Concentration |
|-------------------------------------|--|-------------------------------------|--|
| <input type="checkbox"/> | > 6" = 2,000 | <input type="checkbox"/> | > 10,000 ug/L = 250 |
| <input type="checkbox"/> | 1/8" - 6" = 1,500 | <input type="checkbox"/> | 1,000 - 10,000 ug/L = 100 |
| <input type="checkbox"/> | Sheen - 1/8" = 250 | <input checked="" type="checkbox"/> | 100 - 1,000 ug/L = 50 |
| <input checked="" type="checkbox"/> | No free product = 0 | <input type="checkbox"/> | 5 - 100 ug/L = 10 |
| | | <input type="checkbox"/> | <5 ug/L = 0 |

If (1.a.) + (1.b.) + (2.a.) + (2.b) is < 1, and the CAP is complete, then no further action is required. Go to summary.

3. Distance from Contaminant Plume to Point of Withdrawal for Water Supply

A. Public				B. Non-public			
CATEGORY	NUMBER IDENTIFIED	SCORE	TOTAL	CATEGORY	NUMBER IDENTIFIED	SCORE	TOTAL
Impacted	<u>0</u> X	100 =	<u>0</u>	Impacted	<u>0</u> X	100 =	<u>0</u>
< 500'	<u>0</u> X 0.5 X	50 =	<u>0</u>	< 100'	<u>0</u> X 0.5 X	26 =	<u>0</u>
500' - 1/4 mi	<u>0</u> X 0.5 X	20 =	<u>0</u>	100' - 500'	<u>0</u> X 0.5 X	10 =	<u>0</u>
1/4 mi - 1 mi	<u>4</u> X 0.5 X	10 =	<u>20</u>	500' - 1/4 mi	<u>0</u> X 0.5 X	6 =	<u>0</u>
1 mi - 2 mi	<u>1</u> X 0.5 X	6 =	<u>3</u>	1/4 - 1/2 mi	<u>0</u> X 0.5 X	4 =	<u>0</u>
> 3 mi	N/A	0 =	<u>0</u>	> 1/2 mi	N/A	0 =	<u>0</u>
		A. Subtotal =	<u>23</u>			B. Subtotal =	<u>0</u>

Note: If site is in lower susceptibility area, do not use the shaded area.

4. Distance from Contaminant Plume to Surface-Waters or Utility Trenches Below the Water Table

= Impacted = 100
~~X~~ < 500 = 12
 = 500' - 1000' = 6
 = > 1,000 = 1

5. Susceptibility Area Multiplier

= If site is located in a Low Ground-Water Pollution Susceptibility Area,
and no points of withdrawal for water supply lie within 500'
and no surface water bodies or submerged utility trenches lie within 500'
 of the source: = 0.5
~~X~~ All other sites = 1

SUMMARY

$$[(1.a. + 1.b.) \times (1.c.) + (2.a. + 2.b.) \times (3.a. + 3.b. + 4.)] \times [(5.)] = \frac{1860}{\text{ENVIRONMENTAL SENSITIVITY SCORE}}$$

APPENDIX F

**PUBLIC NOTIFICATION
NEWSPAPER ANNOUNCEMENT
FOR THE FACILITY ID #9-089088
CAP-PART A ACTIVITIES**



****** PUBLIC NOTICE ******

**Notification of Corrective Action Plan
Underground Storage Tank Releases
Fort Stewart Garrison Area
Fort Stewart, Georgia**

The United States Army Corps of Engineers and Fort Stewart Directorate of Public Works have prepared Corrective Action Plan (CAP)-Part A reports to assess the environmental impact of diesel, gasoline, or waste oil releases from numerous underground storage tanks (USTs) located at the above referenced property. These reports were submitted to the Georgia Environmental Protection Division on or about February 3, 1997. A listing of the UST sites for which CAP-Part A reports have been prepared is presented at the end of this notification.

The Georgia rules for UST Management require notification of the public most directly affected by the plans. If you would like a copy of any of the plans, please contact:

**Commander
24th Infantry Division (Mechanized) and Fort Stewart
ATTN: AFZP-DEV (M. Little)
Building 1139
Fort Stewart, Georgia 31314-5000**

A copy of each requested plan will be mailed at a nominal copying and shipping fee.

If you desire to make comments on any of the plans, or to examine the Georgia Environmental Protection Division's files, you should contact the Corrective Action Unit, Underground Storage Tank Management Program, Environmental Protection Division, at (404) 362-2687. The Underground Storage Tank Management Program will accept public comments on the CAP-Part A reports up to 30 days after submittal to the Georgia Environmental Protection Division. Their mailing address is:

**Corrective Action Unit
Underground Storage Tank Management Program
4244 International Parkway
Suite 100
Atlanta, Georgia 30354**

Fort Stewart CAP-Part A Underground Storage Tank Sites

<u>Facility ID Number</u>	<u>Building Number</u>	<u>Tank Number</u>
9-089064	Building 1841	Tank #1
9-089068	Building 1810	Tank #11, #12
9-089069	Building 1811	Tank #14
9-089012	Building 1721	Tank #15, #16
9-089011	Building 1722/1720	Tank #18, #20, #28A
9-089088	Building 1636/1643	Tank #29
9-089114	Building 1630	Tank #30, #31, #32
9-089028	Building 1622	Tank #33, #34, #35
9-089013	Building 1544	Tank #43, #44
9-089104	Building 1161	Tank #61
9-089046	Building 1130	Tank #64A
9-089021	Building 967	Tank #67
9-089020	Building 961	Tank #68, #69
9-089019	Building 955	Tank #70
9-089024	Building 1205/1255	Tank #72, #73
9-089003	Building 1809	Tank #75
9-089025	Building 1213	Tank #77, #78
9-089089	Building 1266/1268	Tank #80, #81
9-089029	Building 1281	Tank #82
9-089074	Building 1247	Tank #89
9-089075	Building 1333	Tank #90, #91
9-089111	Building 1331	Tank #92
9-089078	Building 1320	Tank #94A
9-089077	Building 1325	Tank #95, #96, #97
9-089079	Building 1346	Tank #98, #99
9-089115	Building 1343	Tank #100
9-089040	Building 233	Tank #205, #206
9-089036	Building 275	Tank #208, #209
9-089035	Building 272	Tank #210
9-089059	Building 4506	Tank #222, #223
9-089042	Building 4526/4530	Tank #226, #227
9-089061	Building 4577	Tank #232, #233
9-089117	Building 4572	Tank #234, #235
9-089062	Building 4578	Tank #236, #237
9-089100	Building 4583/4578	Tank #239, #240